

VIBXPERT® II

Dual channel FFT data collector and signal analyzer

Operating Instructions

Series: VIB 5.310

Firmware version: 3.2x



Edition: May 2012

Order no.: LIT 53.201.EN

Translation of the original manual (german)

Dear customer,

We are grateful for your trust and hope that you are happy with our product. If you have any suggestions for improving this product or this instruction manual, please let us know.

PRÜFTECHNIK Condition Monitoring

Fax: +49 89 99616-300

eMail: info@pruftechnik.com

Foreword

* Also referred to as 'VIBXPART' and 'device' in these operating instructions.

Congratulations! And thank you for selecting the VIBXPART II FFT data collector and signal analyzer*. This newly developed measurement device is not just the ideal companion for your routine measurement round, but also a reliable on-site aid for recording and analyzing complex machine signals.

VIBXPART records all types of machine vibrations, bearing conditions as well as process and visual inspection data, and transfers this information to the OMNITREND maintenance software for evaluation, archiving and documentation.

The combination of its extensive range of features and easy operation makes VIBXPART the effective choice for a wide range of applications:

- High measurement accuracy and high-speed data collection
- Operating modes:
 - 'Route' for routine data collection for condition-based maintenance,
 - 'Multimode' for individual measurements for machine diagnosis
 - 'Balancing' in one or two planes (optional).
 - 'Machine templates' for recurrent measurement tasks within the scope of acceptance or service measurements
- Almost every type of sensor can be connected
- One or two measurement channels (analog);
 - Upgrade to 2-channel device at any time via password.

Hardware

- Two synchronous measurement channels for diagnosis of complex measurements (e.g. shaft vibration).
- Unlimited storage capacity (Standard: 2 GB CompactFlash).
- Dustproof and splashproof (IP65) - ideal for use in demanding industrial environments
- Connector technology compatible to VIBSCANNER (same cable)
- Connector for NiCrNi thermocouples
- Connector for headphones

Data collection and data analysis

- Overall values
 - Vibration acceleration, velocity, displacement
 - Current & voltage (process parameters)
 - Shock pulse (bearing condition)
 - Temperature
 - RPM
- Signals
 - Frequency-based and order-based data collection
 - Amplitude, envelope, order spectra
 - Cepstrum
 - Time waveform
 - Phase measurement (synchronous, cross channel)
 - Dynamic shaft movement (Orbit and shaft displacement)

Structural analysis:

- Coast down / Run up analysis (natural frequencies, machine)
- Impact test (natural frequencies, machine components)

- Advanced measurements
 - 1+1 dual measurement (simultaneous 2-channel measurement)
 - Multitask (measure multiple measurement tasks in a sequence)
 - On-site balancing in one or two planes
 - TrendingSpectrum (a measurement provides a time signal, a spectrum and several characteristic overall values, in route and template mode).
 - Recording
 - Multiplexer measurements: Data collection via VIBRONET field multiplexer

Ergonomics

- Large, backlit color display* ensures clear data presentation and optimum readability
- Easy-to-use keypad
- Three alarm LEDs (red-yellow-green) indicate if thresholds have been exceeded (based on ISO standards). A blue LED lights up if everything is OK.
- Daylight sensor controls keyboard illumination
- Graphical user interface
- Color-coded connectors
- Online, context-sensitive HELP

*VGA (480 x 640 Pixel),
262 144 colors

Power supply

- Lithium-Ion battery of latest generation for more than 8 hours of operation
- Smart battery charging in VIBXPART or in external charging station.
- Automatic power management (display, device)

Communication

- Fully networkable
- PC connection via USB, Ethernet, RS232.

Documentation

- Printing out of reports, directly on paper or as a PDF file.

VIBXPART* from PRÜFTECHNIK once again demonstrates the company's skills and innovative strength in the field of maintenance, and is a consistent advancement in the series of successful portable device systems such as VIBSCANNER, VIBROCORD, VIBROTIP, VIBCODE.

Also, we would like to make you aware of the application-oriented seminars offered by PRÜFTECHNIK that feature a significant practical segment. They are very well received by course participants and you will find them to be a good investment.

Check with PRÜFTECHNIK or with your local distributor for availability and schedules. For further information, visit our website:

<http://www.pruftechnik.com>

* VIBXPART is protected by the following US patents:

US 4,800,512

US 5,612,544

US 6,233,527

US 5,527,111

US 5,642,089

US 5,691,904

US 5,583,493

About this manual

This manual describes the basic functions and operation of the measurement device in the 'Multimode', 'Templates' and 'Route' operating modes. The operation of the optional 'Balancing' module is described in the 'VIBXPERT - Balancing' operating manual (LIT 53.202.EN).

If you don't have this manual handy, open the online help in the device with the HELP key.

A circular icon with the word "HELP" inside, representing the online help key on the device.

This manual is valid for Firmware Version 3.2x.

© PRÜFTECHNIK Condition Monitoring; all rights reserved

Both this manual and the product it describes are copyrighted. All rights belong to the publisher. The manual may not be copied, reproduced, translated or made accessible to a third party in any form, neither in its entirety nor as an excerpt.

No liability may be claimed against the publisher regarding the product described in this manual. The publisher assumes no liability for accuracy of the manual contents. Furthermore, under no circumstances may the publisher be held liable for direct or indirect damage of any kind resulting from use of the product or the manual, even if the publisher has expressly indicated the potential for occurrence of such damage.

The publisher assumes no liability for any product defects. This warranty and liability limitation applies to all distributors and sales partners as well.

The trademarks mentioned in this manual are generally noted as such and are the property of their owners. Lack of such designation does not imply, however, that names are not protected by trademark laws.

Contents

Chapter 1: Introduction	1-8
VIBXPERT II delivery packages	1-9
Safety and operating notes.....	1-10
Chapter 2: Getting started	2-1
Overview.....	2-1
Keyboard	2-2
Status display per LED.....	2-2
Notes on operation	2-3
Interfaces	2-5
Power supply.....	2-7
Charging the battery in the device.....	2-7
Charging in the external charging station	2-8
Carrying pouch - VIB 5.356	2-9
Belt	2-9
Hand strap	2-9
Memory card.....	2-10
Replacing the memory card	2-10
Basic settings - Device Setup	2-12
Date & Time	2-12
Display settings, switchoff and additional options	2-13
Route	2-14
Transducers	2-19
Language	2-23
Registration	2-24
Units	2-24
Key controls	2-25
Printer	2-26
Analog out/headphones	2-28
Service menu.....	2-29
Memory card (CF).....	2-31
Standardization factor for dB scaling.....	2-31
Deleting files	2-31
Data transfer	2-32
Direct connection to PC	2-32
Network connection	2-33
USB pen drive.....	2-33
Setting up the network communication	2-34
IP address of the local PC in the network	2-35
Entering a fix IP address for the local PC	2-36
Update	2-37
Chapter 3: Measurement	3-1
Preparation	3-1
What is a measurement task?.....	3-2
Multimode: Measurement, Analysis, Diagnosis	3-3
Typical workflow of a measurement.....	3-3
Starting a measurement:.....	3-3
Continuous measurement (live mode).....	3-4
Save result.....	3-4
Measurement of a route.....	3-5
Preliminary remarks	3-5

Notes about routes.....	3-7
Typical workflow of a route.....	3-7
Start Route	3-7
Icons	3-9
MENU functions in the tree / list view	3-10
MENU functions in the measurement task selection screen	3-12
Measuring with a machine template.....	3-13
Preliminary remarks	3-14
Start measurement	3-15
Options before, during and after a measurement	3-17
Aborting a measurement	3-17
Repeating a measurement	3-17
Saving a result	3-17
Changing the measurement channel	3-17
Changing the sensor	3-18
Entering the RPM manually.....	3-18
Changing the measurement task (M).....	3-19
Setting up a new measurement task (M).....	3-19
Creating a new setup (M).....	3-20
Entering an Event/Comment.....	3-26
Signal sensitivity on analog output/headphones.....	3-27
Trend.....	3-28
Near location (Route).....	3-32
Triaxial sensor (Route).....	3-34
Recording.....	3-36
Starting the measurement recording.....	3-38
Ending the measurement recording	3-39
Special cases.....	3-39
Time waveform recorder	3-40
Data acquisition at the VIBRONET multiplexer	3-41
Connecting the VIBXPRT to the multiplexer.....	3-42
Automatic data acquisition	3-43
Manual data acquisition	3-43
Diagnostic measurement at VIBRONET multiplexer	3-44
Diagnostic measurement	3-44
Chapter 4: Results	4-1
Evaluating results	4-2
Result details	4-2
Characteristic overall value - single values	4-2
Characteristic overall values - trending	4-3
Time waveform	4-4
Spectrum, Cepstrum.....	4-8
3D display of spectra: Waterfall diagram.....	4-13
Sound spectrum: third-octave and octave level diagram.....	4-15
Configuring the result display (Display Setup)	4-17
Printing out reports	4-21
Preparations for direct printing	4-21
Printing the content of a result screen.....	4-21
Measurement reports	4-21
Configuring the measurement report.....	4-22
Printing out the measurement report.....	4-23
Printing out the report for route/machine template.....	4-24
Loading reports onto USB pen drive.....	4-25
Exporting measurement data in MS Excel format	4-26

Chapter 5: Measurement tasks	5-1
Characteristic overall vibration values.....	5-1
Shock pulse measurement	5-2
RPM measurements.....	5-4
Temperature measurement	5-5
Runup / Cooldown.....	5-6
Shaft centerline plot	5-12
Phase measurement	5-14
Orbit	5-16
Envelope analysis.....	5-18
Cepstrum analysis.....	5-19
User-defined measurement quantities.....	5-19
Multi-measurement task ('Multitask').....	5-20
Dual measurement (1+1).....	5-23
Impact test - 1 channel.....	5-25
Modal analysis - two-channel impact test	5-27
TrendingSpectrum	5-29
Order spectrum	5-29
Order-based spectrum	5-29
DC measurements.....	5-30
Chapter 6: Appendix.....	6-1
Numerical editor.....	6-1
Text Editor.....	6-2
File Manager	6-3
Functions of the MENU key	6-3
Printing out the PDF file.....	6-4
Transferring a PDF file on a USB pendrive.....	6-4
VIBXPRT utility	6-5
Installing and starting the program	6-5
Registering optional functions	6-6
Setting up a connection with VIBXPRT	6-7
Configuring VIBXPRT	6-7
Transferring files	6-8
Transferring system files.....	6-8
VIBCODE.....	6-10
Mechanical coding	6-10
Coding	6-11
VIBCODE concept.....	6-11
Measuring with VIBCODE	6-12
Measuring VIBCODE Route/ Pool	6-13
Technical notes.....	6-14
Storage	6-14
Cleaning.....	6-14
Maintenance & Calibration	6-14
Guarantee.....	6-15
Spare parts, accessories	6-15
Disposal.....	6-15
Technical data	6-16
Troubleshooting	6-18
Reloading firmware	6-18
VIBXPRT Firmware modules	6-20
Upgrade matrix for VIBXPRT II packages	6-21
Index.....	6-22
Declaration of conformity.....	6-24

Chapter 1: Introduction

The VIBXPERT II delivery packages contain the parts listed below. If you discover that a part is missing or is damaged, please contact your PRÜFTECHNIK agent immediately.

The Data collector packages include the basic equipment and are only available as a 1-channel version. The Advanced packages extend the capabilities of the instrument and the packages with the OMNITREND PC software enable the analysis of data on the PC.

ex
OMNITREND
PC-Software

VIB 5.310-1E Data collector package, 1-channel device

VIB 5.310	VIBXPERT II FFT data collector, incl. battery (VIB 5.325)
VIB 5.320 INT	Charger
VIB 5.328	Case
VIB 5.330SUSB	USB cable for communication
VIB 5.356	Carrying pouch
VIB 5.436	Spiral cable for mobile industrial accelerometer
VIB 6.142R	Mobile accelerometer, electrically insulated, M5 flat, TNC conn.
VIB 3.420	Magnetic holder for curved surfaces
LIT 53.201.EN	VIBXPERT II manual (this manual)
LIT 53.202.EN	VIBXPERT II 'Balancing' manual
LIT 53.102.EN	VIBXPERT II short instructions
<i>Not shown:</i>	
VIB 5.318-E	Firmware certificate, E-Registration
LIT 01.800	CD ROM, Condition Monitoring catalogs, brochures, magazines
VIB 8.970	Condition Monitoring software / firmware, CD (includes OMNITREND demo version)

VIB 5.310-1 Advanced package, 1-channel device includes all parts of the Data collector package plus

<i>Not shown:</i>	
VIB 5.311	Firmware certificate, 1 channel (instead of VIB 5.318-E)

VIB 5.310-2 Advanced package, 2-channel device includes all parts of the Data collector package plus

VIB 5.436	Spiral cable for mobile industrial accelerometer
VIB 6.142R	Mobile accelerometer, electrically insulated, M5 flat, TNC conn.
VIB 3.420	Magnetic holder for curved surfaces
<i>Not shown:</i>	
VIB 5.311	Firmware certificate, 1 channel (instead of VIB 5.318-E)
VIB 5.311-CH2	Firmware certificate, 2 channels

VIB 5.314-1E Data collector package + OMNITREND, 1-ch. dev.


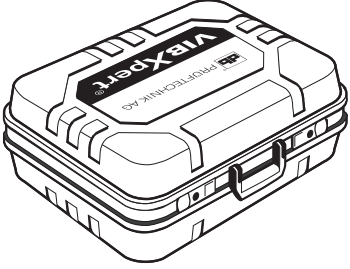

 






VIB 5.314-1 Advanced package + OMNITREND, 1-ch. device


 

VIB 5.314-2 Advanced package + OMNITREND, 2-ch. device includes all parts of the respective Data collector / Standard package plus

VIB 8.981	OMNITREND for VIBXPERT, PC software (instead of VIB 8.970)
VIB 9.631.G	Getting started with OMNITREND
<i>Not shown:</i>	
VIB 8.115	OMNITREND web single user registration certificate
VIB 5.312-P	PC licence for VIBXPERT II

with
OMNITREND
PC-Software

VIBXPERT II delivery packages

Data collector package, 1-channel device		VIB 5.310-1E	
 <p>VIB 5.310 VIB 5.356 (VIB 5.325)</p>	 <p>VIB 5.328</p>	 <p>VIB 6.142R</p>	 <p>VIB 3.420</p>
 <p>VIB 5.320 INT</p>		 <p>LIT 01.800</p>	 <p>LIT 53.201.EN LIT 53.202.EN LIT 53.102.EN</p>
 <p>VIB 5.436</p>		 <p>VIB 8.970</p>	
 <p>VIB 5.330USB</p>			

Advanced package, 2-channel device (additional content)		VIB 5.310-2	
<p>The packages for the 2-channel device additionally include:</p>			
 <p>VIB 6.142R</p>	 <p>VIB 3.420</p>	 <p>VIB 5.436</p>	

Data collector package + OMNITREND, 1-channel device (additional content)		VIB 5.314-1E	
<p>The packages with OMNITREND PC software additionally include:</p>			
 <p>VIB 8.981</p>		 <p>VIB 9.631.G</p>	

Safety and operating notes

Read this section carefully, paying especially close attention to the safety notes, before working with the device.

Symbols used



WARNING!

Danger to life and limb!



Attention!

Operating errors that can lead to data loss or equipment damage.



Note

Information and tips on operating the data collector.

Intended use

- The measurement device may only be used for the measurement of machine signals in industrial environments while taking into consideration the technical specifications (see "Appendix - Technical data").
- Transducers and cables may be used only for their respective intended uses as defined in the corresponding sales leaflets.

Any other use shall not be considered an intended use and is impermissible. Incorrect or impermissible use and failure to observe the instructions in this manual result in a loss of warranty from PRÜFTECHNIK.

General safety

The following notes must be carefully read and completely understood before the device is put into service.

- ◆ Risk of injury when measuring on a running machine!
Observe the safety regulations. Install the measurement equipment properly. During measurement on machines with rotating parts exposed, ensure that no brackets, cables etc. can become caught in rotating machine parts.



WARNING!

- ◆ The measurement device may only be operated if it is undamaged, dry and clean.
- ◆ Operation and maintenance are to be performed only by properly trained personnel.
- ◆ Repairs to the device may be carried out only by a PRÜFTECHNIK-authorized service technician.
- ◆ Only original spare parts and accessories may be used.
- ◆ Only properly functioning, regularly-maintained electrical equipment may be used. Any defects such as broken plugs or loose sockets must be corrected immediately. Damaged cables must be replaced by an authorized service technician.
- ◆ Any alterations that affect device design or operating safety are not permitted.



Attention!



Environmental influences

- ◆ Portable radio-based devices can interfere with proper functioning of the device when operated nearby. In case of doubt, check the connecting cable between the device and its transducer.
- ◆ Avoid exposing the device, its transducers and cables to environmental conditions that exceed the tolerances listed in the 'Technical Data' section at the rear of this manual.
- ◆ Keep the protective caps on the connector sockets when they are not in use to keep them clean.


Nameplates

The diagram below shows the locations and the contents of the device nameplate and the battery nameplate (standard version).

Nameplate for the VIBXPERT device with serial number ('S.No.')

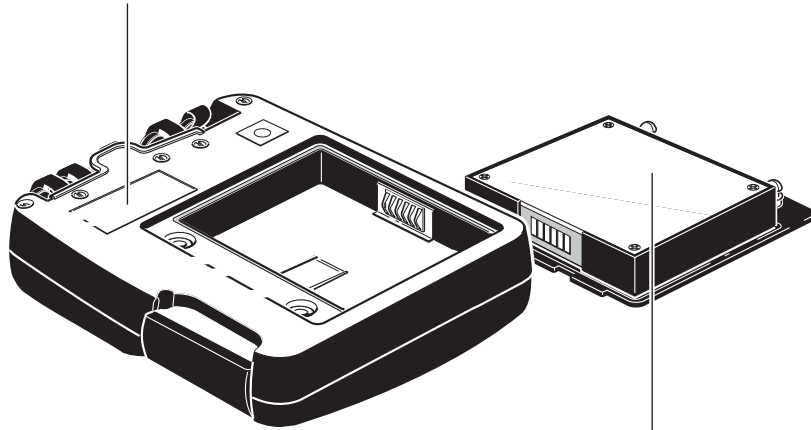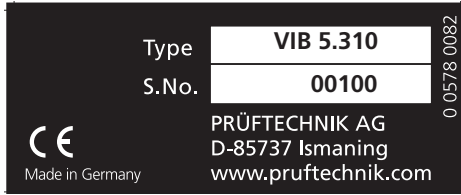

Nameplate for the rechargeable battery with with serial number and safety notes

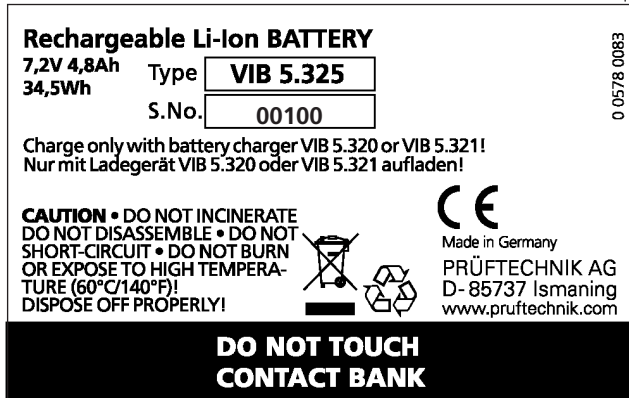

Chapter 2: Getting started

Overview

The illustrations show the interfaces and operating elements:




- ① **Full color display** - large, backlit, high contrast.
- ② **Ambient light sensor** controls keyboard illumination.
- ③ Four **LEDs** indicate:
 - Alarm condition
 - Measurement error
 - Battery charge status.
- ④ **Keyboard** - ergonomic, backlit.
- ⑤ **Memory card** (built-in) 2 MB, replaceable.
- ⑥ **Rechargeable battery** (built-in), replaceable
- ⑦ **Additional key** with ENTER function (Rear panel)

- ⑧ **A / B** - measuring channels for analog signals and charging sockets.
- ⑨ **Temperature** - interface for thermo couple type K
- ⑩ **Digital input/ analog output** for:
 - Trigger / RPM sensor
 - Data transfer via RS 232
 - Headphone / Oscilloscope
 - Strobe control
- ⑪ **Communication** via Ethernet / USB


Getting started

Keyboard

The keys can be comfortably operated with the thumb of the right hand. In a dark environment the keyboard illumination automatically turns on.

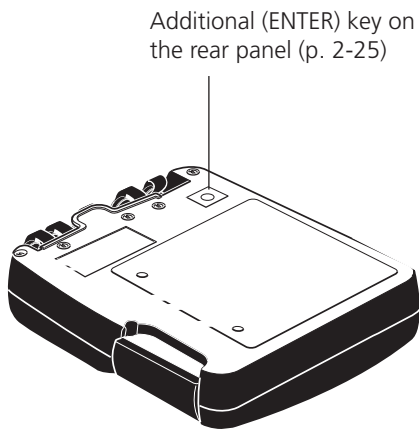

- ① **Plus (+) / Minus (-) key**
- Zoom for X axis
- Change tab
- ② **F key** for special functions such as tab, fast key, search
- ③ **Navigation keys and Enter key**
- ④ **MENU key** opens the menu with context-sensitive functions.
- ⑤ **On/ Off key** for switching on, switching off and restarting VIBXPRT.
- ⑥ **HELP key** opens context-sensitive help page in the active language.
- ⑦ **ESC key** is used to cancel an operation, to page back and to switch off VIBXPRT (only in the start screen).

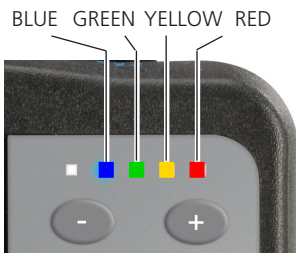

Status display per LED

Four colored LEDs indicate threshold violations, errors, and system status and show the battery status while charging in the device.

Flashing LEDs have the higher priority, i.e RED flashes with signal overload and alarm level exceeded.

Status and alarm indication

LED	RED ■	YELLOW ■	GREEN ■	BLUE ■
constant	Alarm	Warning	Prewarning	Meas. OK
flashing slow	Signal overload	Signal unstable	Display off / Meas. incomplete	Battery almost empty
flashing fast	Battery empty*	---	Trigger signal	---

* only when switching on

Battery status during charging

constant	Error	Battery charging	Battery full	---
-----------------	-------	------------------	--------------	-----

Notes on operation

To keep operation as simple and intuitive as possible, the graphical user interface guides the user step-by-step and is based on the 'Microsoft Windows' operating concept.

Switch on / off

To switch on the device, hold the On/Off key down for two seconds. VIBXPRT is ready for operation when the start screen appears. To switch off, press the On/Off key again for 2 seconds and confirm the resulting query to switch off with 'YES'.

Reset:

Press the On/Off key for approx. 5 seconds until the device switches off and restarts.


Switching on VIBXPRT



Navigation and editing

Select the screen elements with the cursor which can be moved by the navigation keys. The selected element is highlighted. To confirm the selection, press the 'Enter' key.

Some examples of navigation and editing are shown below:

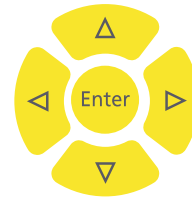

Fields

Black frame => 'Measurement channel' field is selected.

Grey frame => Selection confirmed. The settings can now be modified ('Channel A' or 'Channel B').



Tree view

'Plus symbol' => The folder contains further subfolders/files. To open a branch, press 'Enter' or the right navigation key.

To close a branch, press 'Enter' or the left navigation key.



File name	Type	Size	Date
Result files			
[-] FFT	Dir		01.03.2010 15:12:24
[+] Kennwerte	Dir		01.03.2010 15:12:24
[-] Modal	Dir		01.03.2010 15:12:33
[-] Nachlauf	Dir		01.03.2010 15:12:37
[-] Orbit	Dir		01.03.2010 15:12:37
[-] Phase	Dir		01.03.2010 15:12:16
[-] Rec FFT	Dir		01.03.2010 15:12:16

File name	Type	Size	Date
Result files			
[-] FFT	Dir		01.03.2010 15:12:24
[+] Kennwerte	Dir		01.03.2010 15:12:24
[-] vmrs 1K	ov all vel	1472	28.02.2010 19:16:53
[-] vmrs 1Ktrend	ov all vel	1673	28.02.2010 19:16:53
[-] vmrs 2K	1+1	2396	28.02.2010 19:16:53
[-] Modal	Dir		01.03.2010 15:12:33
[-] Nachlauf	Dir		01.03.2010 15:12:37
[-] Orbit	Dir		01.03.2010 15:12:37
[-] Phase	Dir		01.03.2010 15:12:16
[-] Rec FFT	Dir		01.03.2010 15:12:16


Menu

The functions of the current program section are found in the 'Menu' which is displayed with the MENU key and hidden again with the ESC key.

MENU



An arrow next to a menu entry indicates a further submenu. To open it, press the right navigation key.

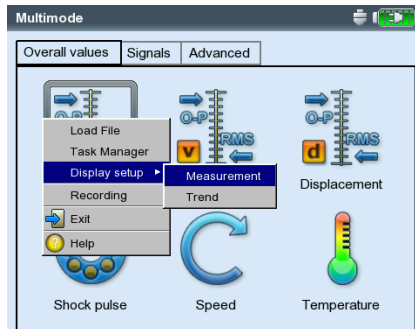


HELP

Tips and operating instructions are available for every screen in the program. Call up these help pages at any time by pressing the HELP key and close them by pressing the HELP key again.

Interfaces

The connections for the sensor and data cables are located on the front of the measurement device. The cable connectors and sockets are colored for easy identification.

To unplug the connector, push the connector sleeve backwards to release the lock. Only then should you remove the connector from the device. Never pull directly on the cable!

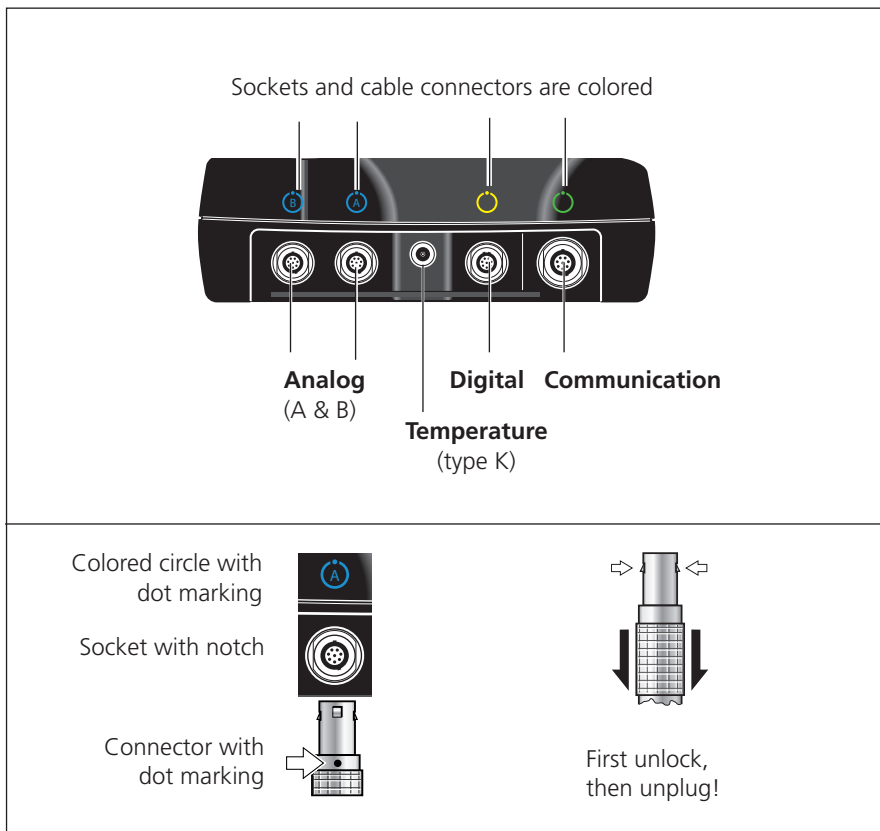


Top view

Analog

The blue channels marked with 'A' and 'B' are used as the:

- Input for analog signals
- Charging socket for the battery (A or B)

The sensor cable is connected to the channel (A or B) set in the measurement task.

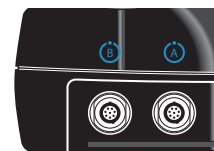

The analog measurement channels are not electrically insulated. For 2-channel measurement on two machines, check the potential equalization (VDE 0100) or use electrically insulated sensors.





Digital

The yellow channel is used as the:

- Input for digital signals from a trigger or a RPM sensor
- Serial interface for data transmission (RS 232)
- Output for the analog signal (connection for headphone/oscilloscope)
- Output for stroboscope control (TTL signal)



Attention!

The permissible range for trigger signals is:
-26V ... 0V (negative) or -5V ... +26V (positive).

Switching threshold positive:	max. 2.5V rising min. 0.6V falling
Switching threshold negative:	min. -8V rising max. -10V falling

The input signal must not exceed the switching threshold of the positive and negative range as otherwise incorrect measurements can occur.



Temperature

This interface is used for the connection of a thermo couple type K.



Communication


The green channel is used as the:

- Communication interface to the PC. The connection is established via a network (Ethernet) or directly via a USB cable.
- USB printer port.
- Connection interface for an USB pendrive.





The network is configured in the 'Device Setup' (see 'Ethernet' on page 2-34).

Power supply

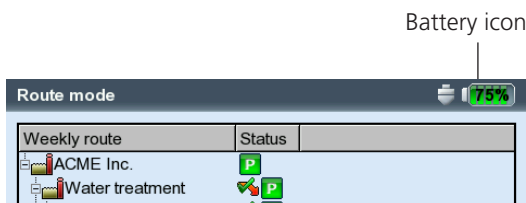VIBXPRT is supplied with energy by a Lithium-Ion rechargeable battery. With the power on the the battery icon on the display indicates the residual charge of the battery:



 Battery icon

-  Battery is being charged
-  Residual charge 100%
-  Residual charge 25%
-  Battery almost empty


If the battery is almost empty, a message appears on the display and the blue LED flashes. The battery can be charged either in the device or in the external charging station (option, VIB 5.324) using the VIBXPRT charger (VIB 5.320 INT).

Follow the safety instructions enclosed with the charger.



Charging the battery in the device

Connect the charger to one of the two analog input channels (A / B). VIBXPRT can be operated during charging.

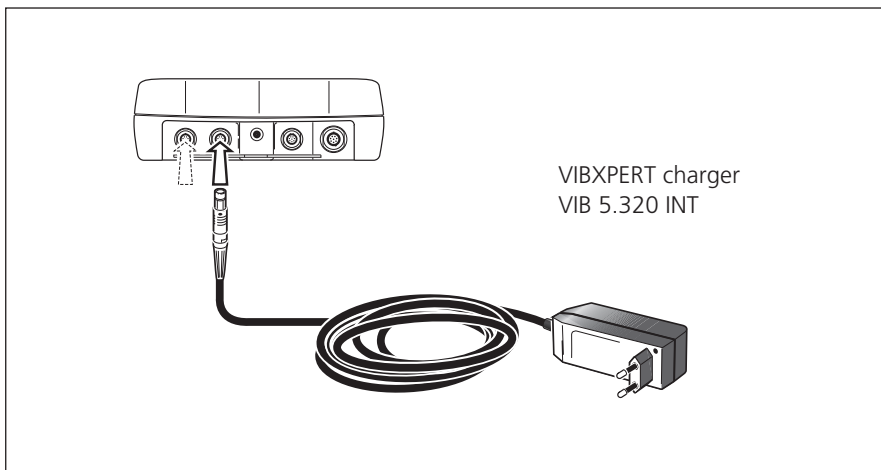

Follow the instructions for connection and disconnection of the cable in the section 'Interfaces' (page 2-5).

The second free channel can in fact be used for measuring, but electrical interference can lead to faulty measurements under certain circumstances!



Getting started - Power supply

During extended periods of non-use and during storage, connect VIBXPERT regularly to the mains supply. This prevents the battery from becoming completely discharged, and the date and time settings are retained.



Attention!

- Do not use damaged batteries!
- Do not send back damaged batteries!
- Do not use force to open the battery or throw it in the fire!
- Do not short-circuit connection contacts!
- Maximum charge temperature: 40°C.
- Dispose of used batteries properly in accordance with regulations (P. 6-17).

Charging in the external charging station


To remove the battery, loosen both screws on the back.




Attention!

The metal contacts on the battery, in the charging station and in the device should be protected against contamination and inadvertent contact!

Remove the battery

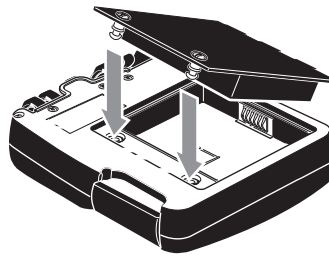

VIBXPERT charging station
VIB 5.324

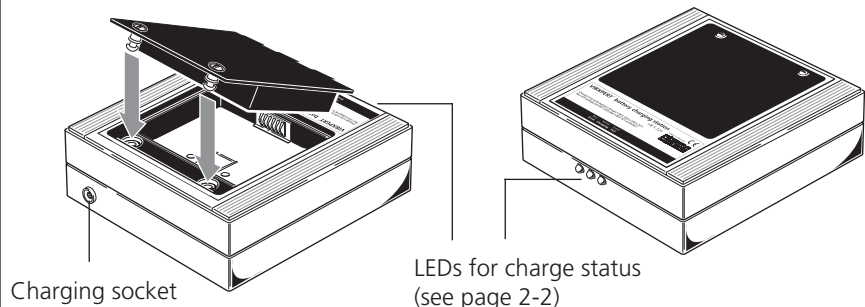

Carrying pouch - VIB 5.356

The stable and functional carrying pouch allows safe and convenient transport of the measurement device. A belt and a hand strap can be attached to the pouch:

Belt

Fasten the belt to the two diagonally opposite eyelets. Adjust the belt length so that the measurement device hangs comfortably from the shoulder to allow convenient operation.

Hand strap

The hand grip strap can be attached on the right or left side. To ensure a stable grip, put one hand in the strap.



Memory card

A CompactFlash (CF) card with 2 GB memory capacity is installed in the VIBXPERT as standard. If required, the standard card can be replaced by a card with greater memory capacity.



Attention!

Backup all data before replacing the card using the 'VIBXPERT utility' program (see page 6-8)!

When closing the cover, it must be additionally sealed with a silicone adhesive (NOVASIL S 11) to ensure the dust seal (IP 65).

Replacing the memory card

- Switch off VIBXPERT.
- Carefully remove the cover in the grip. Make sure that the clip of the cover is not damaged.
- Pull out the memory card by the adhesive strip.




Compartment for memory card open



Carefully pull out the memory card by the adhesive strip

- Installation:
Insert the new card in the guide rails of the card slot. Carefully press in the card up to the endstop. Make sure the card is correctly oriented! The top of the card should face the back of the device.

- Coat the groove along the edge of the card compartment cover with a small amount of silicone adhesive (NOVASIL S-11) and replace the cover. Remove any excess adhesive with a cloth.

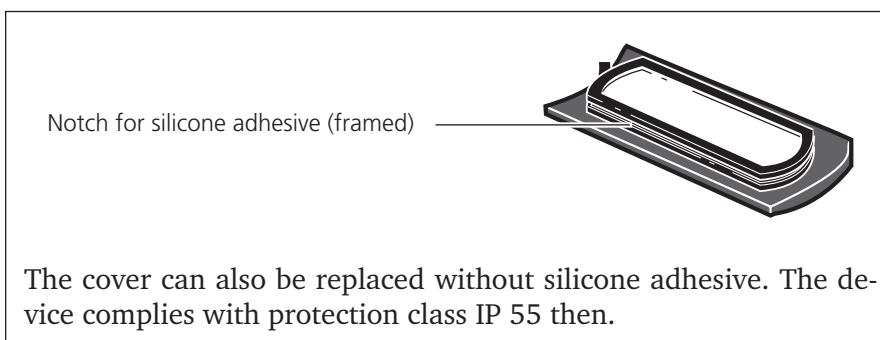

Note

When the device is switched on, the card is automatically tested. The following scenarios are possible:

Card formatted, which version?

- The card is new and has not yet been formatted in a VIBXPert: you are prompted to format the card.
- The card has already been used in another VIBXPert:
Card version < firmware version in the device: the files on the card are automatically updated.
Card version > firmware version in the device: you are prompted to reset all settings to the "factory settings" ('Reset', P. 2-29).
Card version = latest firmware version: no action.

Card faulty?

- The file system on the card is damaged. A warning appears along with the instruction to have the card repaired. If possible, make a backup copy of the measurement data (see 'Backup', page 6-8).

Start card formatting and repair in the 'Service' menu (P. 2-29).

How much free memory capacity is there?

The free memory capacity is checked regularly during operation. A message appears when the memory is almost full.

Basic settings - Device Setup

 
Before carrying out measurements with VIBXPRT, the basic settings in the 'Device Setup' should be checked and changed if necessary.



- Switch on VIBXPRT.
- Click on 'Device Setup' in the start screen. The 'Device Setup' screen appears.

Date & Time

The time and date are saved together with the measurement result.



To change the settings:

- Click on 'Date & Time'.
- Click in the 'Time' window and select the numerals for the hours, minutes or seconds.
- To change the numeric value, press the navigation key up or down.
- When finished click on the 'Enter' key to leave the 'Time' window.
- Select the 'Time format':
HH:mm:ss = 24 h / hh:mm:ssAP = 12 h
- The date is set in the same way. Select the appropriate 'Date format'.


Other parameters

Time zone: Time shift to GMT (Greenwich Mean Time)
Daylight saving: Yes = + 1h

- To accept the changes, press MENU and click on 'OK'.

Left:
Basic settings in the Device Setup

Right:
Time and Date

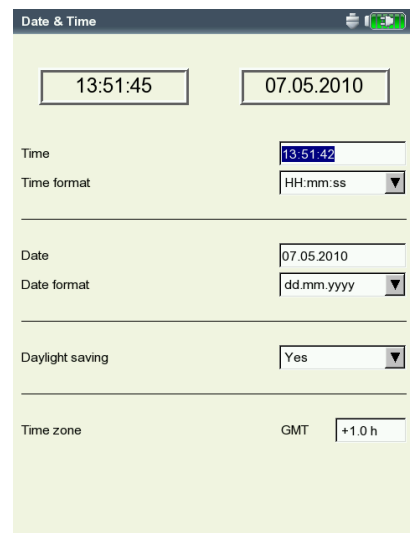

Display settings, switchoff and additional options

- Click on 'Display' in the 'Device Setup' screen.

BRIGHTNESS: Press the navigation key right or left until the desired brightness is achieved. To accept the setting, press 'Enter'.

SWITCH BACKLIGHT OFF / AUTO POWER OFF: The display/ the device automatically switches off if no action occurs within the turn-off time (illumination: 10s ... 1m / device: 6m ... 6h). To switch on the display, press any key. The automatic switch off is disabled in the measurement screen / results screen.

SHOW BATTERY CHARGE: Display the residual battery charge in percent.

SPECTRUM: SHOW LINES BELOW LOWER FREQUENCY (f_{\min}): In spectra with a lower limit frequency of $f_{\min.} > 0$ Hz, the lines between 0 Hz and $f_{\min.}$ are displayed in the diagram if this option is enabled.

HIDE CALIBRATION HINT: The message for overdue calibration is not shown.

- To accept the settings, press MENU and click on 'OK'.




Protective display film

To protect the display against damage, it is covered with a scratch-proof transparent film. The film is easy to remove.




Note

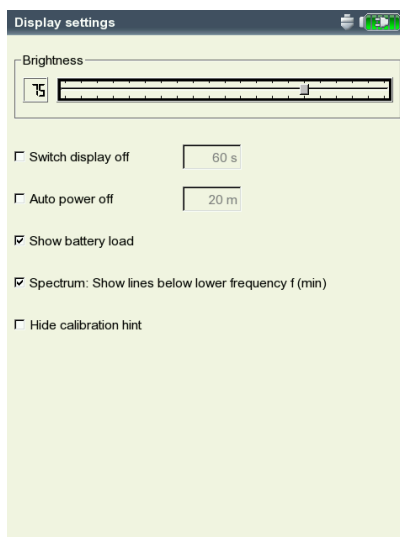

Display settings


 
Getting started - Basic settings



Route

- Click on 'Route' in the 'Device Setup'.

  The settings in the Route Setup apply to measurements in the 'Route' / 'Template' mode. The Route Setup can be called up and adjusted at any time in the route/template. For clarity, the numerous settings in the Route Setup are grouped into three submenus (see below):



Route display settings

- Click on 'Display' to set up the following options:

Route display type

The route/machine template can be displayed in the hierarchical tree view or as a list.

- **TREE:** In this view, the measurement locations and the higher-level hierarchies are displayed as a tree structure, as they are in OMNI-TREND. The measurement locations are processed in the defined order.
- **LIST:** The list view shows the measurement locations in the order in which they are processed.



Note


If the machine templates were created in the 'Production test' mode, a list view is not possible.

Graphic Route

Graphic user guidance using machine graphics that indicate the position of the measurement locations and the measurement direction. This display mode is only possible when the route is displayed in the tree view.

Left:
Basic settings for the route/
template operating mode

Right:
Setting up the display

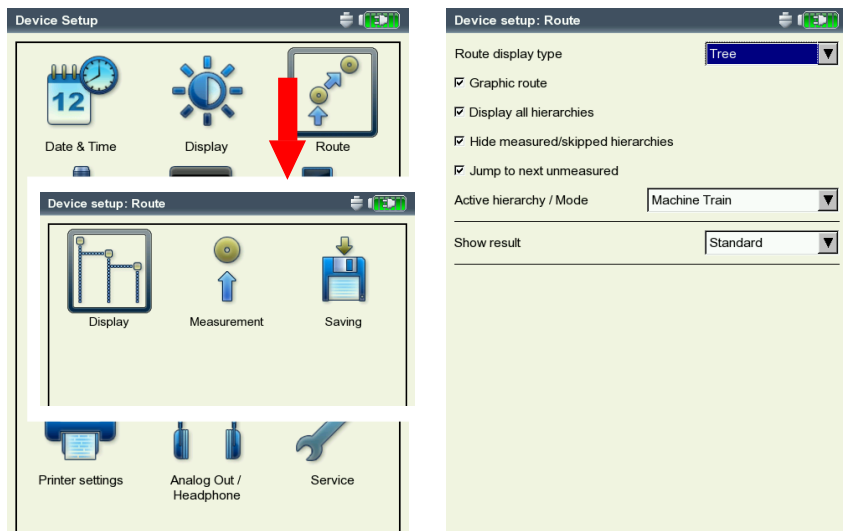

- **ENABLED:** Display of machine images. The position of the measurement locations and the measurement direction is indicated by symbols.
- **DISABLED:** The route is processed in the set display mode (tree / list)

Display all hierarchies

This option applies to the tree view only.

- **ENABLED:** The tree displays all hierarchy levels.
- **DISABLED:** The tree only opens the branch with the first non-measured measurement location.

Hide measured/ skipped hierarchies

This option applies to the tree view only.

- **ENABLED:** Measured/skipped hierarchy levels are hidden in the tree.
- **DISABLED:** Measured/skipped hierarchy levels are displayed in the tree.

Jump to next unmeasured (measurement location)

Here you can define to which measurement location the cursor should jump after you view a stored result and close the measurement task selection window.

- **ACTIVATED:** the cursor jumps to the next unmeasured measurement location.
- **DISABLED:** the cursor remains on the current measurement location.

Active Hierarchy/ Mode

The following settings determine how the tree structure should appear when opening the route / machine template:

- **TRAIN / MACHINE / MEASUREMENT LOCATION:** The tree opens to the selected hierarchy level*.
- **AUTO:** Dynamic adaptation of the tree view. The type of display depends on whether the route contains graphical information and whether the 'Graphic Route' option is enabled.

Show result

With every measurement task, older, historic measurements can be saved in the route and called up to compare them with current results.

- **STANDARD:** last measurement saved.
- **HISTORY:** last measurement saved and historical data.

The route is set up hierarchically according to the following plan:

1. Database - highest hierarchy
2. Location - factory, plant, customer
3. Train - groups of machines
4. Machine - individual machines
5. Measurement location - position of the measurement location
6. Measurement task - e.g. vibration acceleration



Measurement settings

- Click on 'Measurement' to set up the following options:

Autostart measurement

This shortens the duration of the entire measurement.

- **ENABLED:** Clicking the measurement location starts the first measurement automatically. If multiple measurement tasks are defined for the same accelerometer at a single measurement location, these measurement tasks are automatically run consecutively, provided that the 'Auto Save' option is enabled (see next section).
- **DISABLED:** The first measurement at a measurement location must be started manually.

Autostart MUX

This options shortens the time between the measurements.

- **ACTIVATED:** The measurements start automatically as soon as a multiplexer measurement location is opened in the selection screen.
- **DEACTIVATED:** The measurements have to be started with 'Enter'.

Route optimizer

This function optimizes the processing of the route and shortens the time involved in collecting the measurement data.

- **ENABLED:** Measurement tasks for a measurement location with the same sensor are processed one after the other.
- **DISABLED:** Measurement tasks are processed in the sequence in which they were created in OMNITREND.



Optimize meas. time for MultiTask

The individual measurements are performed with a sensor but are processed in parallel on 2 channels in VIBXPRT.

- **ENABLED:** Measurements are internally distributed to both measurement channels and are processed in parallel.
- **DISABLED:** Measurements are performed in sequence on one channel.

Left:
Basic settings for the route/
template operating mode

Right:
Setting up the measurement

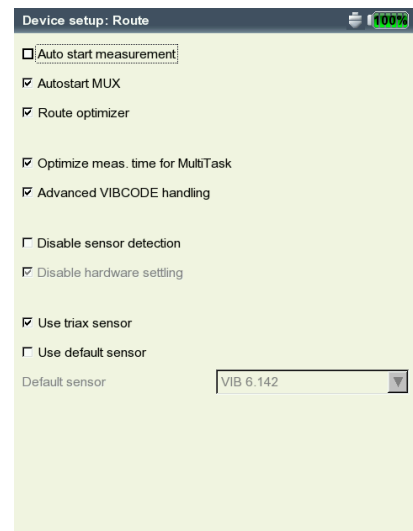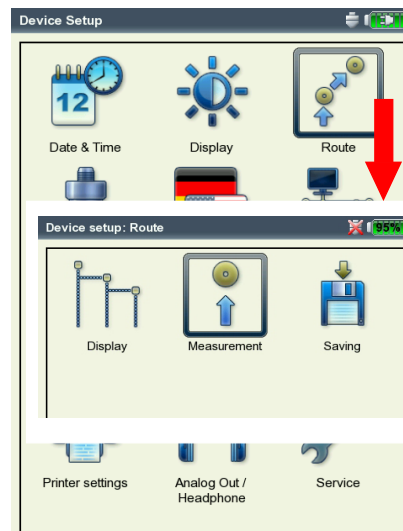

Advanced VIBCODE handling


When measurement tasks performed at a VIBCODE measurement location are not only taken by the VIBCODE sensor but by another vibration sensor, VIBXPRT recognizes these and assigns them to another measurement channel.

- **ENABLED:** Measurement tasks with the VIBCODE sensor are performed on the VIBCODE sensor channel. The other measurements are taken on the other channel.
- **DISABLED:** The measurement tasks are measured on one channel, each with the sensor that has been set up.

Disable sensor detection

This shortens the duration of the entire measurement.

- **ENABLED:** Sensor detection is deactivated. The sensor symbol is crossed out. If several measurements are taken of a single measurement location, VIBXPRT only performs the sensor detection and cable test before the first measurement.
- **DISABLED:** Sensor detection is active. Prior to every measurement, VIBXPRT checks whether the correct sensor is connected and if the cable is OK. A sensor icon appears at the upper edge of the screen next to the battery icon.

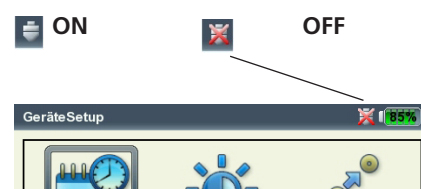Sensor detection

When measurements are taken with the VIBCODE sensor, sensor detection is always active!

**Note****Disable hardware settling**

This shortens the duration of the entire measurement.

- **ENABLED:** Amplifiers do not settle before measurement starts.
- **DISABLED:** Amplifiers settle before measurement starts.

Measurement error may occur if the amplifiers do not settle first!

When sensor detection is active (see above), the amplifiers always settle. The settings in this field are ignored.

**Note****Triax sensor**

Use the triaxial sensor in the route. The ICP sensors that were assigned to the triax measurement location in OMNITREND are only replaced by the triax sensor if this option is activated. Also, the measurement tasks are grouped into the three spatial directions (X, Y and Z) to be measured according to the following scheme:

Measure X and Y signals simultaneously on channels A and B, then change to channel B to measure the Z signal.

Getting started - Basic settings

Standard vibration sensor

Here you define the sensor to be used for all vibration measurements on a route. The settings in OMNITREND are ignored. The 'Triax sensor' option is disabled.



Note

Standard sensor is active when, in the task selection screen

- Channel A / Channel B is marked red,
- Sensor icon at the top edge of the screen lights up orange.

Use the standard sensor for measuring or deactivate this option. Otherwise, incorrect measurements may be the result.



Save settings

- Click on 'Saving' to set up the following options:

AutoSave

This shortens the duration of the entire measurement.

- **ENABLED:** The selected time (0 ... 10s) corresponds to the waiting time until the result is automatically saved.
- **DISABLED:** The result must be manually saved.


Stop AutoSave on...

- **ALARM, WARNING, PREWARNING:** When the limit value is exceeded, the AutoSave mode is deactivated.
- **NEVER:** The result is always stored automatically.

To accept the settings in the 'Route Setup' and to close the menu, press MENU and click on 'OK'.


Left:
Basic settings for the route/
template operating mode

Right:
Options for saving

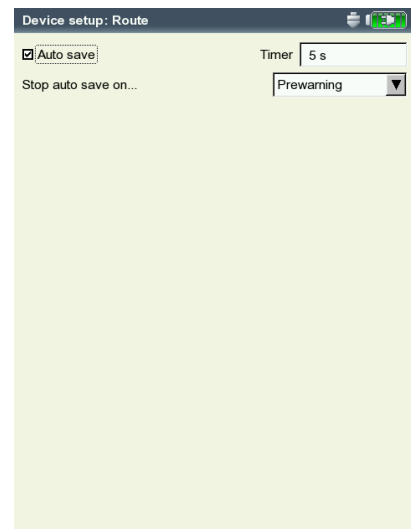

Transducers

 The transducer menu (see below) contains all of the functions and pre settings for the transducer. Click on 'Transducers' to open the menu.



Available transducers in VIBXPERT

The measurement-relevant parameters for many transducers are stored in VIBXPERT. Consequently, when putting together a measurement task, it is only necessary to select the transducer required for the measurement.

The transducer list (see below) in the 'Available transducer' menu contains all the factory-configured and user-defined transducers. Under certain circumstances, this list can be very extensive.



Preselecting available transducers

As it is probable that not all the transducers stored in VIBXPERT will be used, the choice can be restricted to those transducers that are available to the user. When setting up the measurement tasks, VIBXPERT only offers the choice of the preselected transducers as standard:


- Click on each of the relevant transducers in the list so that these are marked with a cross.

Displaying the transducer application

To check in which measurement task(s) the individual transducers are used, proceed as follows:

- Mark the relevant transducer in the list.
- Press the MENU key.
- Click on 'Usage' (see below).

A list appears to show the measurement tasks that are measured with the transducer.

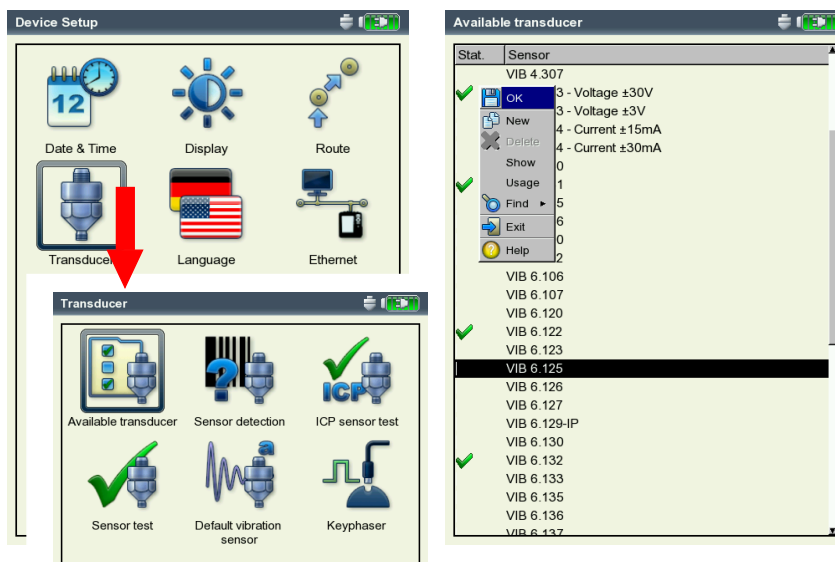

Left:
Transducer menu

Right:
Available transducers
are marked with ✓

Getting started - Basic settings

Transducer parameters

To check the parameters for transducers that have already been set up, proceed as follows:

- Select the transducer.
- Press the MENU key.
- Click on 'Show'¹ or 'Edit' to open the parameter screen (see below).

¹'Show' appears for factory-defined transducers whose parameters cannot be changed.

MEAS. QUANTITY

Measurement quantity of the sensor: vibration acceleration, velocity, displacement, current, RPM, jump, user-defined quantity

SIGNAL TYPE

Signal type of the sensor (e.g. LineDrive, ICP, voltage)

INPUT VOLTAGE RANGE

$\pm 3V / \pm 8V^1 / \pm 30V^2$; only applies for transducers of 'Voltage', 'Current', 'ext. 5V converter' and 'VIBREX/VIBRONET' signal types.

QUANTITY (USER DEF.)

Identification for a user-defined measurement variable.

UNIT (USER. DEF.)

Unit for the user-defined variable.

PRECISION

Accuracy in decimal places.

COEFFICIENT A4, A3, A2

Parameters for linearizing a sensor's non-linear characteristic line (e.g. MNS12 proximity probe - VIB 6.640).

SENSITIVITY

The sensitivity of the sensor determines the signal level.

OFFSET


Offset of the sensor

LINEAR FROM / TO

The linearity range of the sensor and the filter setting of the measurement must be adapted to one another.

¹ only for VIBREX / VIBRONET
² only for 'Voltage' signal type

Transducer parameters for VIB 6.122 accelerometer

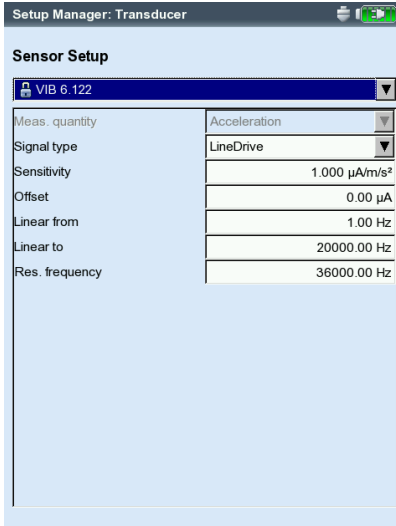

Sensor Setup	
VIB 6.122	
Meas. quantity	Acceleration
Signal type	LineDrive
Sensitivity	1.000 µA/m/s ²
Offset	0.00 µA
Linear from	1.00 Hz
Linear to	20000.00 Hz
Res. frequency	36000.00 Hz

RESONANCE FREQUENCY

The resonant frequency of the sensor is an important influencing quantity in the shock pulse measurement (bearing condition).

SETTLING TIME (RPM)

Settling time of the RPM sensor

Filtering the transducer list

The transducer list can be filtered according to specific criteria:

- Press the MENU key.
- Click on 'Find'.
- Press the right navigation key wto open the associated submenu.

The following criteria can be selected here:


- ALL:** Display all transducers
- FACTORY:** Display factory-configured transducers only
- USER:** Display user-configured transducers only
- AVAILABLE:** Display preselected transducers as 'available' only
- MEAS. QUANTITY:** Display the transducers for a specific measurement quantity only; the measurement quantity is selected in the associated submenu (see below).

Setting up new transducers

To set up a new transducer, proceed as follows:

- In the transducer list press the MENU key.
- Click on 'New'. The Text Editor appears.
- Enter a name for the new transducer.
- Set up the transducer parameters (see previous page).
- Finally, press the MENU key and click on 'OK' to save the new transducer.

To accept the settings, press MENU and click on 'OK'.

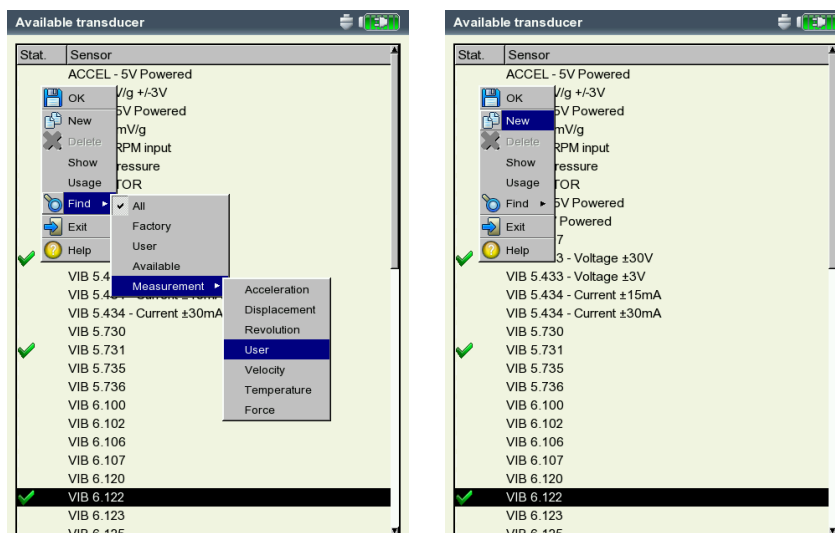

Left:

Sort transducer list:

Display transducers for the 'user-defined' meas. quantity only

Right:

Creating a new transducer

Getting started - Basic settings



Transducer detection and Hardware setting

In this menu, the transducer detection feature and the settling of the amplifier stages in VIBXPRT can be switched on and off. Additional information can be found in the 'Route Setup' section (p. 2-17).



Note

The settling of the amplifier can only be activated when the transducer detection is switched off.

The settings in this menu apply to the 'Multimode' operating mode only. The settings for the 'Route' and 'Machine template' modes are made in the 'Route Setup' menu.

After the device is switched on, the amplifiers always settle prior to the first measurement.



Sensor test

Here you can manually check the measurement path to the sensor. For ICP sensors, use the 'ICP Sensor Test' menu; for all other sensors, use the 'Sensor Test' menu.

- Select the channel to which the sensor is connected (A, B).
- Click on START.
VIBXPRT then checks the measurement path and displays the result ('LineDrive', 'Open line', 'Short circuit', etc.).




Default vibration sensor (Multimode)


A default sensor can be specified for all vibration measurements in the 'Multimode' mode. In the route / machine template, a default sensor can only be set up via the 'Runtime setup' menu (p. 3-18) or the Route Device Setup (p. 2-17) respectively.

- Activate the checkbox and select the vibration sensor.

Left:
Checking the measurement
route on channel B

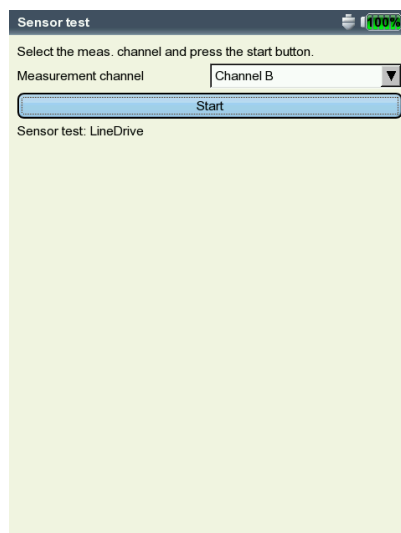

Right:
Standard sensor for vibration mea-
surement in 'Multimode'

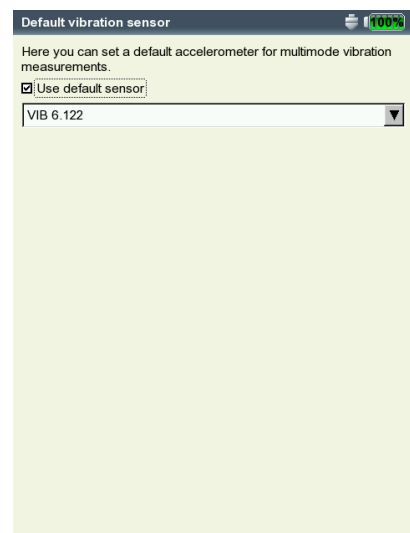

Default sensor is active, when

- Channel A / Channel B is marked red in the task selection screen
- the sensor icon at the top edge of the task selection screen is orange
- the sensor setup cannot be opened in the measurement task manager.

Use the default sensor for measuring or deactivate this option. Otherwise, incorrect measurements may be the result.



Note

Keyphaser

Here you can extend the time limit set for rpm measurements and phase measurement to enable measurements on very low-speed machines (range: 10 ... 30 s, default: 10 s). In coast-down measurements the time limit is automatically set in relation to the stop speed.

 
The 'Active edge' option is used to define whether the edge of the incoming trigger mark or outgoing trigger mark on the shaft is to be used as the reference signal.



Language




VIBXPERT includes 11 languages. The default setting is 'English'. To change the language setting, proceed as follows:

- Click on 'Language'.
- Click on 'YourLanguage' (e.g. Espanol, Francais,...).
- Press MENU and click on 'OK'.
- Confirm the resulting message to restart the application (see below).



Communication

 
Settings for network communication, see page 2-34.

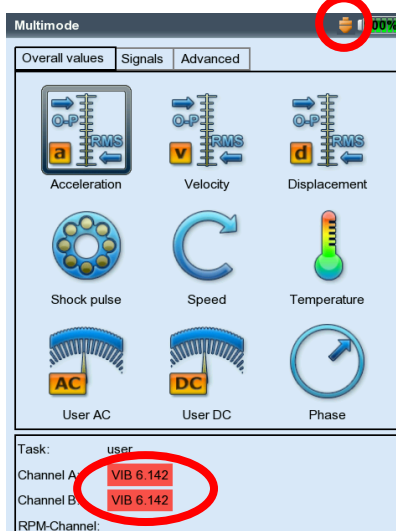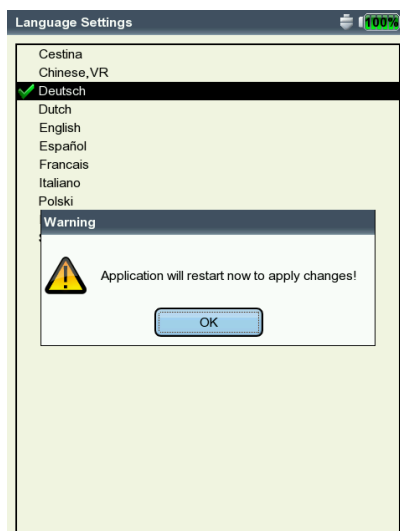

Left:
Dialog language
is changed to 'Deutsch' (German)

Right:
Default vibration sensor is enabled

 Getting started - Basic settings



*The attachment on page 6-20 contains an overview of the modules and the available measurement functions.

Registration

 
The functions and operating modes in VIBXPRT are distributed in individual modules* that can be enabled by password as required. VIBXPRT is supplied in the 'Basic' version with which overall values as well as (limited) spectra can be measured. For example, to enable the standard 1-channel version, the 'VIBXPRT firmware for 1 channel' module must be registered in VIBXPRT. The corresponding password can be found on the associated registration certificate:

- Click on 'Registration'.
- Click on the module to be registered and enter the password in the text editor.

VIBXPRT PC license

Before VIBXPRT can exchange data with OMNITREND, the device must be registered in OMNITREND. This is generally performed by entering the PC license password in OMNITREND.

Here you can enter the password in VIBXPRT. The password is then automatically read into OMNITREND when VIBXPRT first makes contact with OMNITREND.



Units

The units - where appropriate - are set to SI units in the factory. To change the unit for the respective measurement quantities, proceed as follows:

- Click on 'Units'.
- Select the units for the measurement quantities.



The accuracy in decimal places appears in the lower area of the window for the current unit as well as the conversion factor for the associated SI unit. It is not yet possible to define, delete or edit units. The number of decimal places can not be changed.

To accept the settings, press MENU and click on 'OK'.

Left:
Registration menu

Right:
Units menu


The VIBXPRT PC license automates the device registration process in OMNITREND.

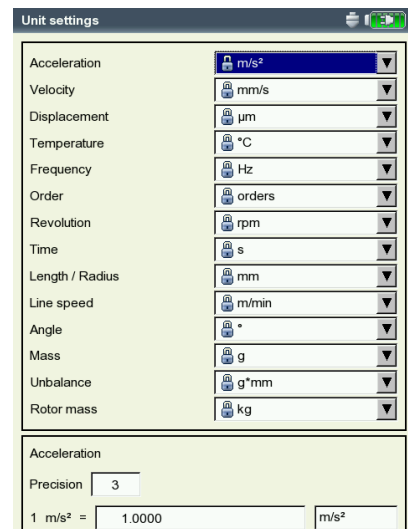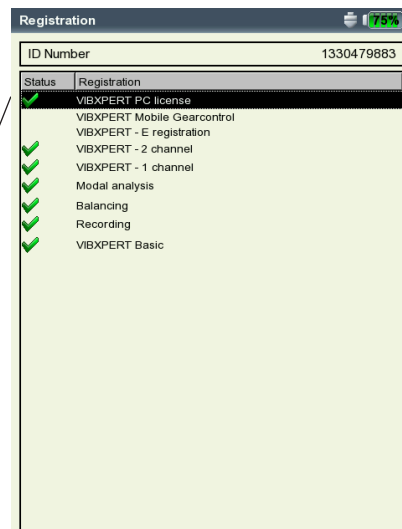

Key controls

Additional functions are activated for some keys in VIBXPRT as standard that are intended to ease working on-site on the machine or to increase data security.

 - Click on 'Key controls'.
The following options can be activated or deactivated in the next screen:



Additional key on the rear panel

VIBXPRT has an additional input key on the rear panel which can be operated with the index finger of the left hand (see below). This key can be used as an additional ENTER key or for starting a measurement.

This key is particularly useful if it is not possible to press the 'Enter' key - e.g. if a hand-held probe must be held on the machine with the right hand.



'Save?' prompt after ESC

The 'Save?' prompt appears if you press the ESC key without having saved the changes/measurement results in the current screen beforehand. This query always appears for run-up and coast-down measurements, even if this option is disabled.

Prompt for repeat measurement


A repeat measurement is normally started by pressing the 'Enter' key in the measurement screen. A corresponding prompt prevents inadvertent triggering of a repeat measurement.

To accept the changes, press MENU and click on 'OK'.

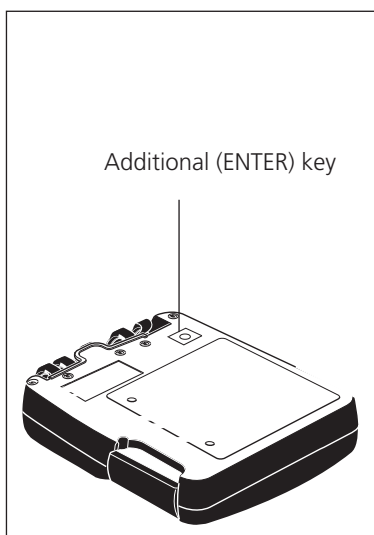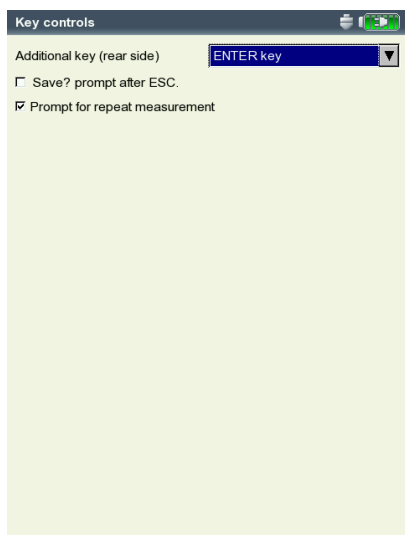

Special keyboard functions

Getting started - Basic settings

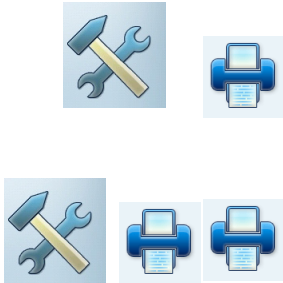

Printer

With VIBXPRT, you can print out measurement results, reports and PDF file directly on a USB-printer.

- Click on the 'Printer settings' icon to open the Printer menu.

Setting up a printer


To set up a new printer, proceed as follows:

- Click on the 'Printer settings' icon to open the 'Printer settings' menu (see below).
- Select the top menu, press the MENU key and click on 'New' (see below).
- Select your printer type.
- Enter a name in the text editor.
- Then set the print parameters:
Resolution, paper format and - depending on the printer type - the color model and paper source.
- Check the print function by printing a test page:
 - Connect VIBXPRT to the printer (see the next page).
 - Press the MENU key and click on 'Test page'!

The test page is printed as soon as the print job has been processed by VIBXPRT. If you select 'PDF' as the printer, you can print the PDF file directly from the measurement device (see page 6-4) or transfer the PDF file to a PC using the 'VIBXPRT utility' tool (see p. 6-8).


Left:
Printer menu

Right:
Printer settings

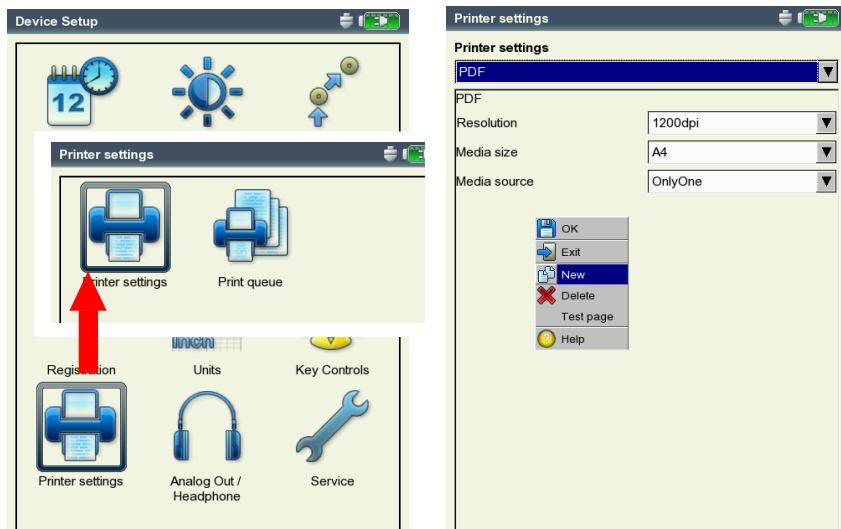


Deleting a print job

 - Click on 'Print queue' in the 'Printer settings' menu.
- Select the print job in the list.
- Press the MENU key and click on 'Delete job'.




If a print job is being processed, a print icon appears at the top edge of the screen.

Print job is being processed

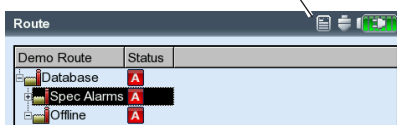

Connecting the printer


Only printers with a USB interface can be connected to VIBXPRT. Use the USB cable available as an accessory for I/O devices to connect the printer (VIB 5.3330 MUSB).

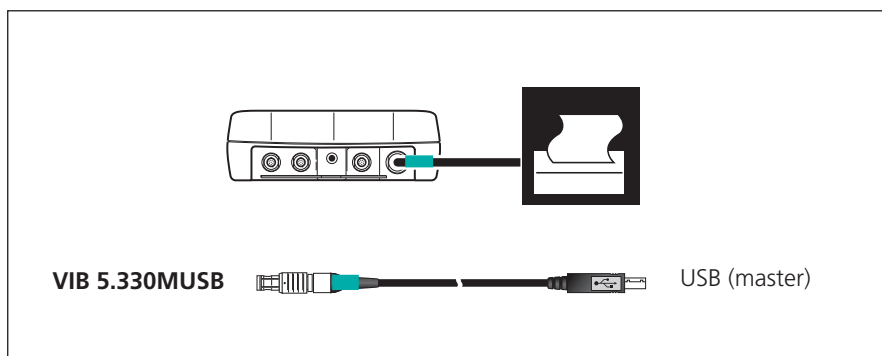

Analog out/headphones

At the analog output (yellow connector), the vibration signal can be picked up with a suitable analysis device (oscilloscope) or listened to via headphones (e.g. VIB 6.670). The output is always the pure, non-integrated signal without the DC component.

 
To use the yellow connector as the analog output, it must be enabled and parameterized in the Device Setup:





* Only for sensors with a sensitivity of $5.35 \mu\text{A}/\text{ms}^{-2}$

- Click on 'Analog Out/Headphone' in the Device Setup.
- Enable the analog output.
The signal will be output at the analog output until the measurement screen is closed.
- If needed, adjust the standard normalization for the accelerometer. You can choose from: 10mV/g, 100mV/g, 500mV/g*, 1mV/ms⁻²
A maximum output voltage of $\pm 4\text{V}$ provides the maximum possible measurement range, for example of:
80 m/s² at 500mV/g
400 m/s² at 100mV/g
- If the vibration signal is measured with a different sensor type, set a suitable gain factor in the 'Default amplification' menu (x0.1 / x1 / x5 / x10).

To connect the analysis device, use the cable for the analog output (VIB 5.431):

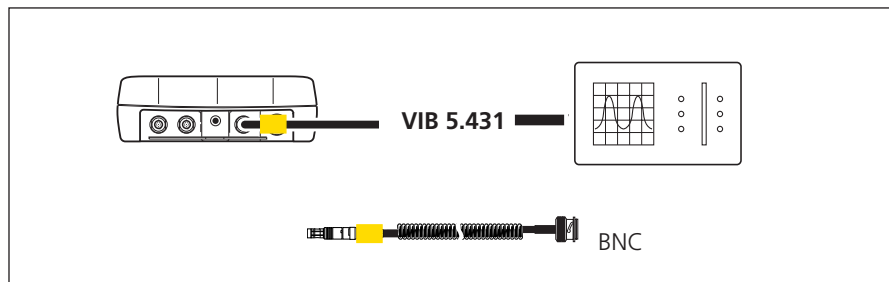


Normalization and amplification for Analog Out

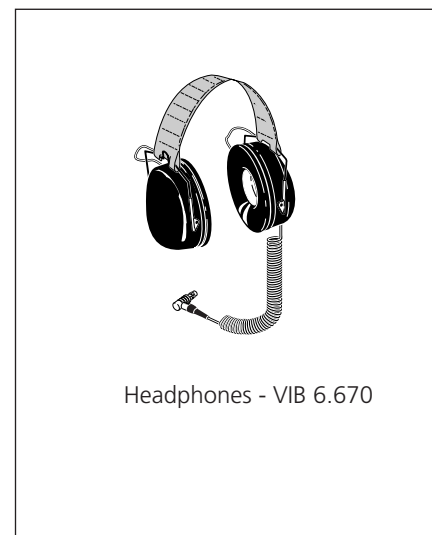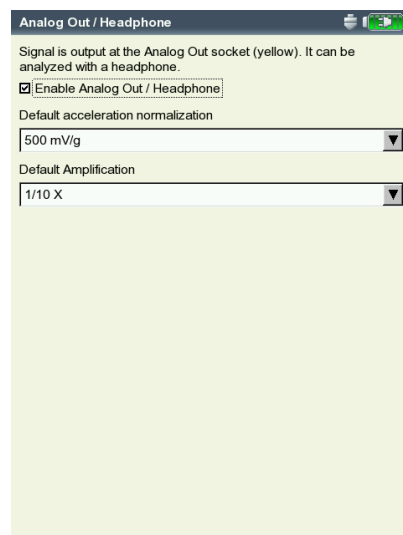

Service menu


- Click on 'Service' to open the Service main menu (see below).

 A series of functions are available for service, maintenance and training purposes. For clarity, the settings are grouped into submenus:



Device Info

 
This menu contains device information for service and repair as well as the date of the next offset compensation and calibration (for more details, see also p. 6-14).



Offset Compensation

Various factors, e.g. aging or temperature, can cause an offset in the analog electronics. This option makes it possible to maintain the measurement accuracy of the instrument by regularly (approximately every 2 months) compensating the offset.

 
- Click on 'Offset Compensation'.
- Click on 'Start' in the next screen. The process takes about 3 minutes.





Factory Defaults

This menu can be used to reset various settings in the instrument to the values set up in the factory. In addition, data that are no longer required in the instrument, e.g. language files, can be deleted.

 - Click on 'Reset'.



!! RISK of DATA LOSS !!
 Pay particular attention to which settings are reset or which data are deleted. This action cannot be undone!

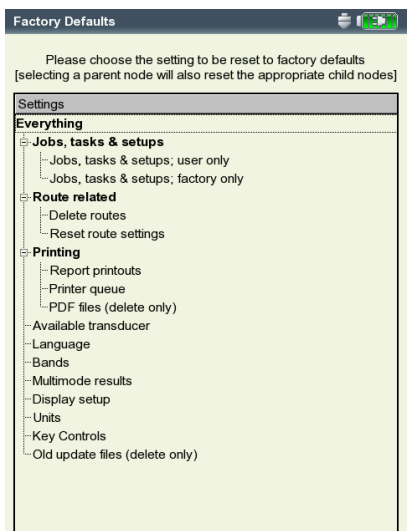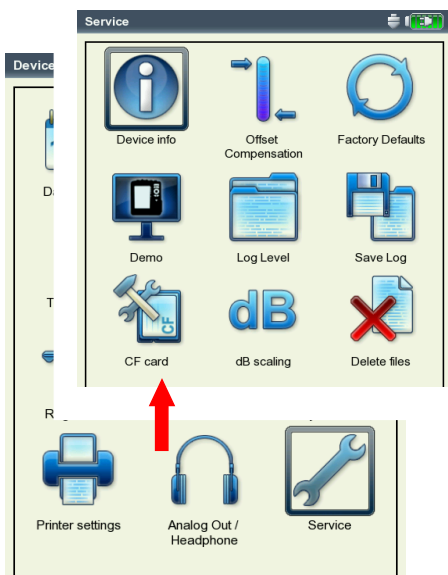

Left:
Service main menu

Right:
Factory defaults

Getting started - Basic settings

- Click on the respective tree entry and confirm the resulting prompt with 'OK'.
- For reasons of security, the word 'OK' must be entered a second time in the text editor before the action can be carried out.

Demo

 
For training or demonstration purposes, the VIBXPRT screen display can be shown on a PC monitor with the aid of the VIBXPRT demo program. VIBXPRT must be switched to 'Demo' mode for this.



- Click on the 'Demo' icon. The following options can be selected:
 - ETHERNET: VIBXPRT can only be operated using the keys on the device. The unit is connected to the PC via a patch/network connection (see p. 2-32f).
 - OFF: Stop 'Demo' mode.

LogLevel

To simplify troubleshooting, the operating steps can be logged in the device and written to a log file. This menu is used to set how much data is to be written to the log file ('LogLevel').



- Click on the 'LogLevel' icon. Select one of the following options:
 - NONE: No logging
 - DEFAULT: Only the most important operating steps are logged.
 - RUNTIME/ ... / SPECIAL USE: The amount of logged information is increased from step to step.





The higher the LogLevel is set, the higher the demands on the system resources. Increasing the LogLevel should only be carried in consultation with PRÜFTECHNIK Condition Monitoring.


When processing very long routes and Coast Down analyses set the LogLevel to 'None'. After a reboot the LogLevel is set to 'default', if the LogLevel was set before to levels higher than 'standard'.

Left:
Demo mode settings

Right:
LogLevel settings

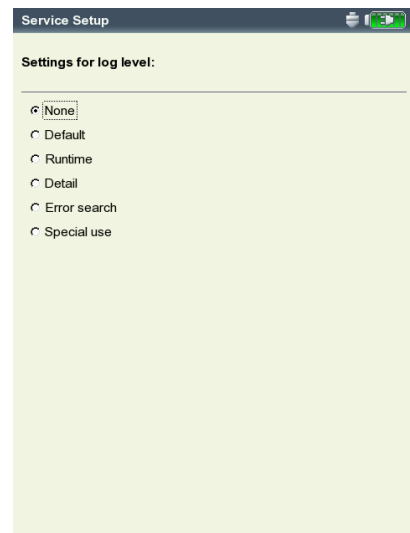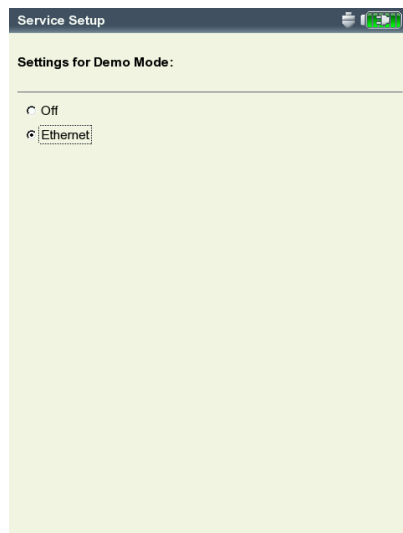

 To backup the log file on the memory card in the VIBXPERT, click on the 'Backup Log' icon and confirm the prompt with 'Yes'. The log file can be transferred to the PC using the 'VIBXPERT update tool'.



Memory card (CF)

 
In this menu, you can format, check and repair the memory card.

FORMATTING: You should only format a card if it is new and has not yet been used in VIBXPERT. This process deletes any data stored on the card!

To format it, click on 'Start' in the top field, confirm the query that is displayed and enter the word 'OK' into the text editor.

CHECKING: The degree of fragmentation is checked automatically at specific intervals. Here you can start the check function manually by clicking on the 'Start' button.


REPAIRING: If the file system on the memory card is faulty, an error message appears. If possible, save the measurement data on the PC before starting the repair function.



Standardization factor for dB scaling

The amplitude of a spectrum is converted to decibels (dB) with the following formula:
 
$$A_{\log} = 20 \cdot \log(A_{\text{lin}}/N), \text{ where } A_{\log}: \text{ amplitude in dB} \\ A_{\text{lin}}: \text{ amplitude in linear unit} \\ N: \text{ standardization factor}$$




In this menu, you can set the standardization factor (default = 1). The scaling that is used for a spectrum (linear or in dB) is defined in the Display Setup (see Chapter 4).

The dB scaling is not available for time signals, overall values and TrendingSpectra. It can also not be applied to frequency-selective band alarms.



Deleting files

 Files that are no longer needed can be deleted in this menu. Select the data type and press the F key to open the file selection list.



Data transfer

The following data is transferred between VIBXPERT and the PC either via a direct connection or a network connection:

- Measurement tasks to VIBXPERT (route)
- Measurement results to the PC (route, multimode, templates)
- Machine templates to VIBXPERT
- Software (update)
- Printer drivers to VIBXPERT
- Data backup to the PC
- Data restore to VIBXPERT
- PDF and screenshots to the PC


Measurement tasks, results and machine templates are transferred using the OMNITREND PC software. All other data are exchanged via the 'VIBXPERT utility' tool found on the PRÜFTECHNIK CD and that must be installed locally on the PC. Also, PDF files can be saved to a USB pen drive, so they can be opened and printed from a PC.

Exchanging data between the measuring device and a PC requires either a direct connection or a network connection.

Direct connection to PC


- **SERIAL CONNECTION:** Connect the PC cable VIB 5.430-2 to the digital port (yellow) and serial port of the computer.
- **USB CONNECTION:** Connect the USB cable VIB 5.330SUBS to the communication port (green) and USB port of the computer.

Serial and USB

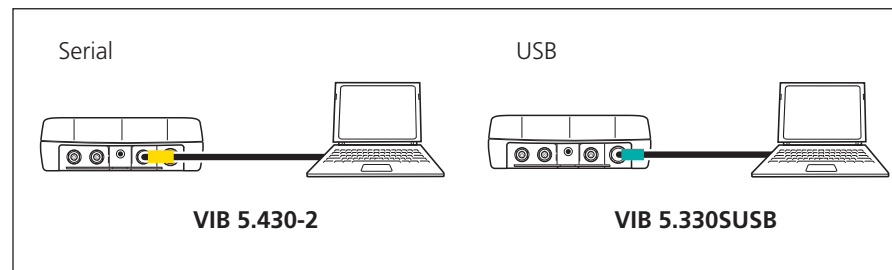

- **PATCH CONNECTION:** Connect the Ethernet cable VIB 5.331 to the communication port (green) and network card of the computer.
- **PATCH CONNECTION VIA HUB:** Connect the Ethernet cable VIB 5.331 to the communication port (green). Connect a standard patch cable to the network card of the computer. Connect both cables to a hub.

Patch (RJ 45)

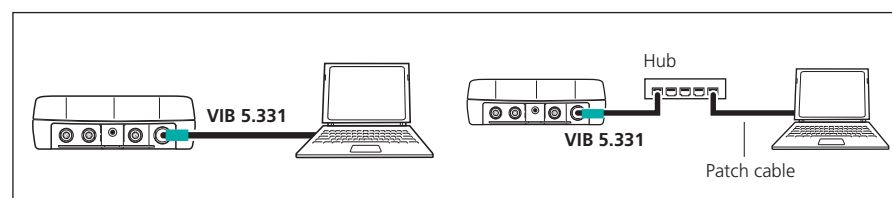


Network connection

Data transfer via an Ethernet network requires the following components and information:

- Network connection
- Ethernet cable for VIBXPERT (VIB 5.331).
- PC with network interface card connected to the network/hub
- IP address and subnet mask of the PC in the network

NETWORK CONNECTION (LAN): Connect the Ethernet cable VIB 5.331 to the communication port (green) and network socket.

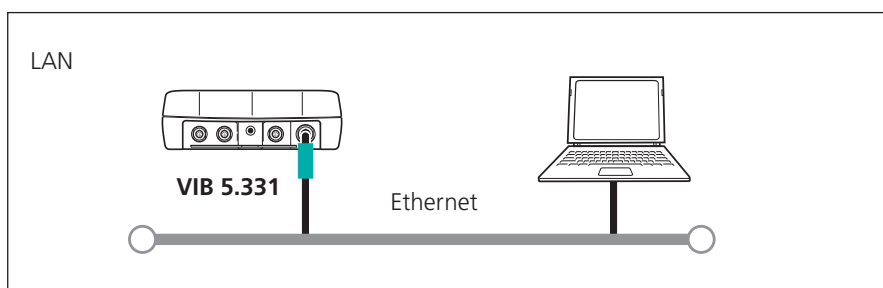


Network (LAN)

USB pen drive


To save PDF files to a USB pen drive, you need the following accessories:

- Connecting adapter for USB pen drives (VIB 5.330-MEM)
- USB pen drive for VIBXPERT II (VIB 5.330-USB)

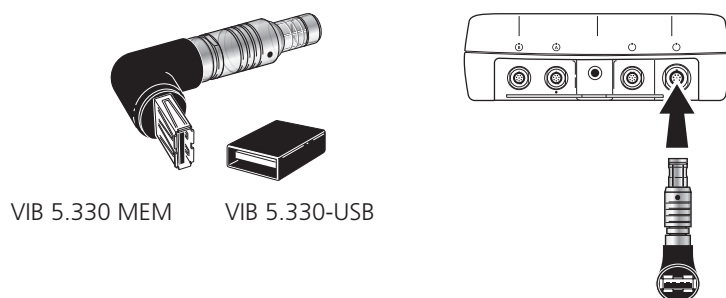

In the file manager the USB flash drive is shown as an additional directory next to 'Results' and 'PDF'. You can move saved PDF files to the USB pen drive with the menu options 'Cut' and 'Insert'.

 
Setting up the network communication



- Connect VIBXPRT to the network (see previous page).
- Switch on VIBXPRT.
- Click on 'Device Setup' in the start screen, and then on 'Ethernet':
- Enter a valid IP address for VIBXPRT:
Take the first three numbers of your PC's IP address and change the last number only (see also the following instructions). Make sure that the IP address for VIBXPRT is not already allocated in the network. Contact your system administrator if you work in a company network.
- In the 'Subnetmask' field, enter the address of the subnetwork where the PC is located.
- If necessary, enter the address of the gateway in the 'Standardgateway' field. If no gateway is used, set the field to '0.0.0.0'.
- To accept the settings, press MENU and click on 'OK'.

Left:
Open menu for
network communication

Right:
TCP/IP settings for
network communication

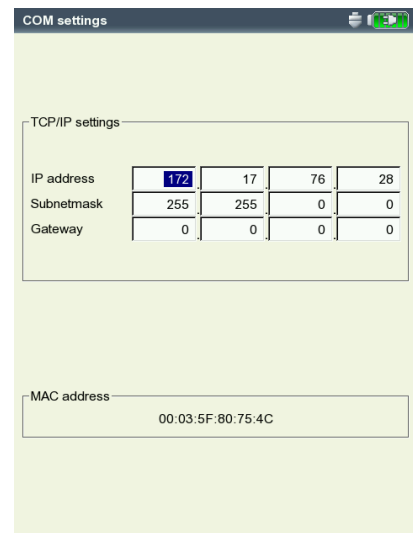


IP address of the local PC in the network

If the IP address and the subnet mask of the PC are not known, ask your network administrator or find it yourself on the PC:

Open the DOS box on your PC:

- Click on “Start” and then on “Execute”.
- Enter “cmd” (under Windows 2000 / XP).
- Enter “ipconfig -all” in the DOS box.

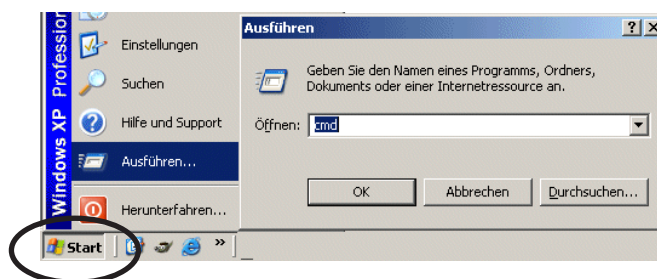

Windows START menu

```

C:\WINNT\System32\cmd.exe
C:\>ipconfig -all
Windows 2000-IP-Konfiguration
    Hostname . . . . . : pc_achter
    Primäres DNS-Suffix . . . . . : 
    Knotentyp . . . . . : Hybridadapter
    IP-Routing aktiviert . . . . . : Nein
    WINS-Proxy aktiviert . . . . . : Nein
    DNS-Suffixsuchliste . . . . . : pruftechnik.com

Ethernetadapter "LAN-Verbindung":
    Verbindungsspezifisches DNS-Suffix: pruftechnik.com
    Beschreibung . . . . . : 3Com EtherLink XL 10/100 PCI f3r vol
    Istständige PC-Verwaltung-NIC (3C905C-TX)
    Physikalische Adresse . . . . . : 00-04-76-0C-4D-7B
    DHCP-aktiviert . . . . . : Ja
    AutoKonfiguration aktiviert . . . . . : Ja
    IP-Adresse . . . . . : 172.17.5.59
    Subnetzmaske . . . . . : 255.255.0.0
    Standardgateway . . . . . : 172.17.1.1
    DHCP-Server . . . . . : 172.17.1.61
    DNS-Server . . . . . : 192.168.10.1
    Primärer WINS-Server . . . . . : 172.17.1.40
    Sekundärer WINS-Server . . . . . : 172.17.1.3
    Lease erhalten . . . . . : Dienstag, 2. Dezember 2003 10:37:32
    Lease läuft ab . . . . . : Dienstag, 2. Dezember 2003 11:37:32

C:\>
  
```

DOS box


Example: The screen displays the IP address and the subnet mask of a PC in a network:

IP address: 172.17.5.59
Subnet mask: 255.255.0.0

Entering a fix IP address for the local PC

You must assign a fixed IP address to the computer if you connect the computer directly to the measurement device with a patch cable:

- From the START menu, select SETTINGS, choose NETWORK and DIAL-UP CONNECTIONS.
- Right-click on LOCAL AREA CONNECTION and select PROPERTIES.
- Select TCP/IP and click PROPERTIES.
- Select USE THE FOLLOWING IP ADDRESS.
- Enter the 'IP address' data for the local PC.

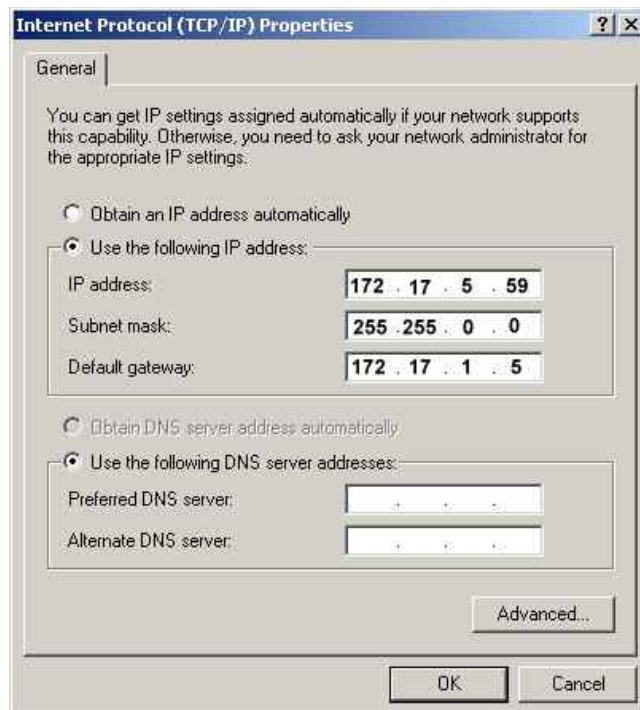

Update

The current device software for VIBXPART can be downloaded from the PRÜFTECHNIK homepage* in the Internet.

*<http://www.pruftechnik.com>

The update file is compressed in a ZIP archive that first has to be unpacked after it is downloaded to your PC. It is recommended to load the software update onto the device via Ethernet or USB because the serial connection is slower.

Before an update ...

... backup the measurement data in VIBXPART to the OMNITREND database.

... connect the VIBXPART to the mains supply. Otherwise, the update procedure will not start.




Attention!

- Install the 'VIBXPART update tool' on the PC. The program is available on the PRÜFTECHNIK Condition Monitoring CD.
- Connect VIBXPART to the network / the PC.
- Switch on VIBXPART.
- Start the 'VIBXPART update tool'* on the PC and click on <Next> to call up 'Step 2':




VIBXPART
UpdateTool


* Alternatively, the VIBXPART Update tool can also be started using the 'VIBXPART utility' tool (see p. 6-5ff.)

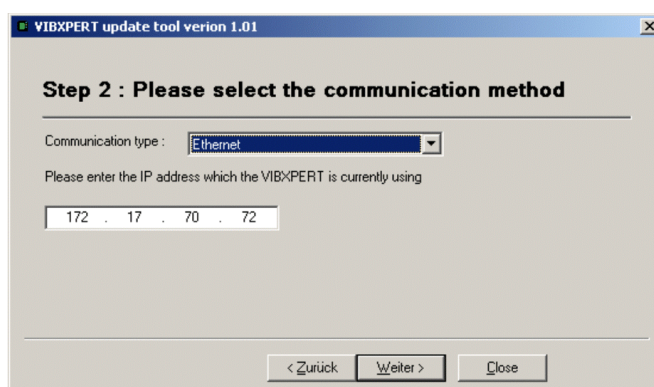

- Set the 'Communication type' to 'Ethernet' (or 'USB').
- Enter the IP address of the VIBXPART.
- Click on <Next>:

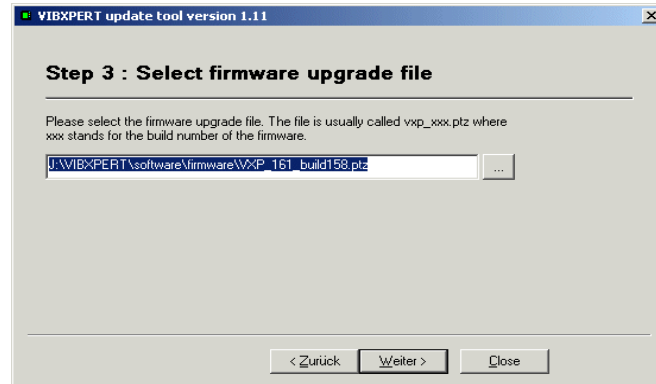


- In the next step ('3') select the update file on the PC. This file has already been downloaded as an archive file (*.zip) from the PRÜFTECHNIK homepage and unpacked to a temporary folder. The file name includes the version number (e.g. 'VXP2_300_build638.ptz') and the extension 'ptz'.
- Click on <Next>:

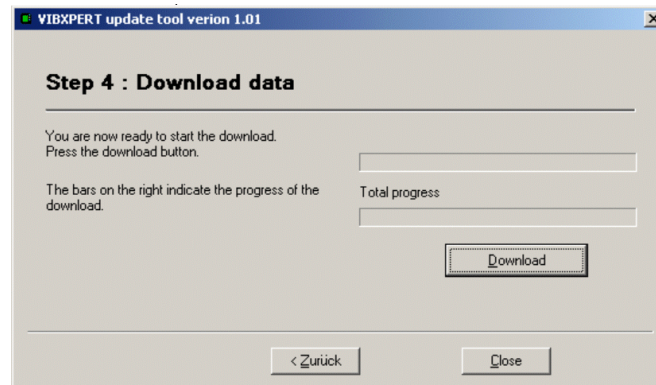

- In the next step ('4') click on <Download> to start the data transfer to VIBXPRT.
- After the data transfer has finished, click on <Close> to close the program.
- The device switches itself on and off repeatedly until the update is completed. This process generally takes a few minutes. Wait for the VIBXPRT start screen to appear.

The version number appears in the lower right corner of the start screen:

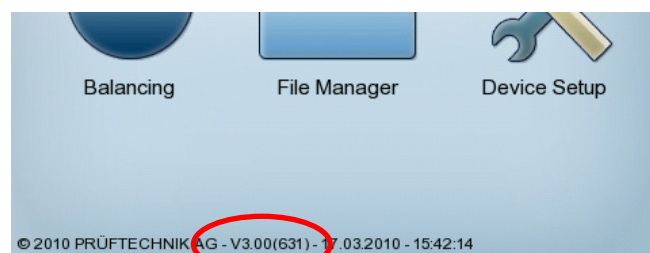

Chapter 3: Measurement

VIBXPERT can carry out measurements in the following operating modes:

Multimode:

VIBXPERT can be used as a multimeter to measure characteristic overall values or signals for the diagnosis of machine conditions. The results can be saved and read in for evaluation and archiving by the OMNITREND PC software.

Route and Machine templates:

As a data collector, VIBXPERT works through a route or machine template. A route is a compilation of measurement tasks that are measured at regular intervals. A machine template contains measurement tasks that are measured repeatedly on machines of the same type, such as during service interventions or acceptance measurements on-site at the machine manufacturer's. Routes and machine templates are created in the OMNITREND PC software; the results are read into the OMNITREND PC software for evaluation and archiving purposes.

Balancing:

VIBXPERT can be used for dynamic balancing* in one or two planes.

* 'Balancing' mode is described in the VIBXPERT 'Balancing' manual (LIT 53.202.EN).

Preparation

Before beginning a measurement, ensure that ...

- ... the battery is fully charged
- ... the device settings are set properly (date, units, ..)
- ... the required measurement tasks are created and stored in VIBXPERT.
- ... the required sensors and cables are laid out and in good condition; the RPM sensor requires a support to perform RPM measurements!
- ... permanently mounted measurement locations are in good condition. If necessary, clean them and repair any damage.
- ... recesses for hand-held probes are prepared.

*Measurement quantity:

Vibration acceleration,
 Vibration velocity
 Vibration displacement as overall value,
 time signal or spectrum respectively
 Shock pulse,
 Temperature,
 RPM,
 ...


What is a measurement task?

To carry out a measurement, VIBXPERT requires information on the type of measurement quantity*, the sensor being used and, if necessary, data for the evaluation of the result. Information as to whether the RPM must be recorded with each measurement is also required. This data set is designated as a 'measurement task' and forms the basis for each measurement with VIBXPERT.

To simplify the preparation of a 'multimode' measurement and to save the user from having to enter the required data, VIBXPERT already contains a comprehensive collection of predefined knowledge-based measurement tasks. The user is only allowed to change the transducer and to alter the measurement channel in these measurement tasks. If extensive changes to the measurement parameters are required, it is better to create a new measurement task.

In the 'Route' and 'Machine Template' operating modes, VIBXPERT receives the measurement tasks directly from the OMNITREND PC software. Only a few of the measurement parameters here can be changed (transducer, measurement channel, RPM entry).


The following overview shows the structure of a measurement task in VIBXPERT:

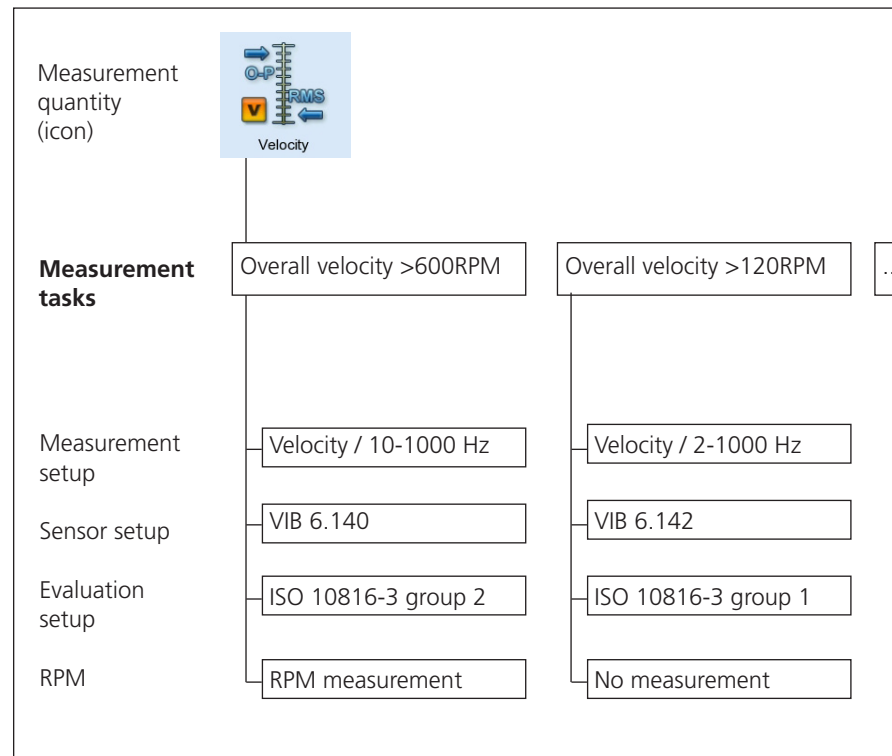

The measurement tasks are sorted according to measurement quantity* and assigned a measurement icon in the selection screen. If you are in the 'Multimode' operating mode for example, all measurement tasks of the 'Vibration velocity - overall value' measurement quantity appear under the icon shown above. The letters 'a', 'v', and 'd' in the icon stand for 'Acceleration', 'Velocity' and 'Displacement'.

Multimode: Measurement, Analysis, Diagnosis

To activate the 'Multimode' mode, click on the corresponding symbol in the start screen. The measurement tasks appear in the selection screen (see below). The measurement task for the selected icon is displayed below the icon field.

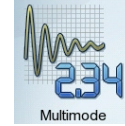

The measurement tasks are grouped into three tabs: Overall (characteristic) Values, Signals, Advanced (measurements). Certain measurement tasks only appear if the corresponding module is registered.

The current tab sheet is highlighted with a black frame. To change the tab sheet, press the '+/-' key or highlight the tab sheet with the navigation keys.



Typical workflow of a measurement

This section shows you how to carry out a measurement in multimode mode if the preparations have already been made. A schematic of the workflow of a measurement is shown below.

The setting options that are available before, during and after a measurement are described in the following section. The evaluation of the results on the instrument* is described in Chapter 4.

* Multimode measurements can also be imported and evaluated in OMNITREND.

Starting a measurement:

- Highlight the measurement icon in the selection screen.
- Connect the sensor.
Sensor and measurement channel are displayed in the info field.

Standard sensor is active when the sensor icon at the top left is orange and the sensor type in the info field is marked red! The sensor setup is overwritten with the standard sensor.




Attention!


- Press 'Enter' to start the measurement.



Multimode selection screen for overall value measurements

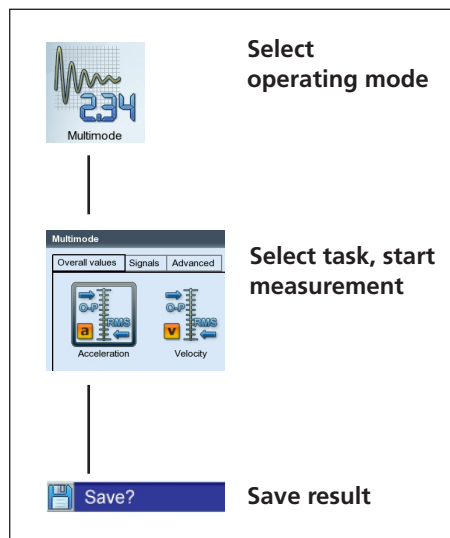

Default vibration sensor enabled

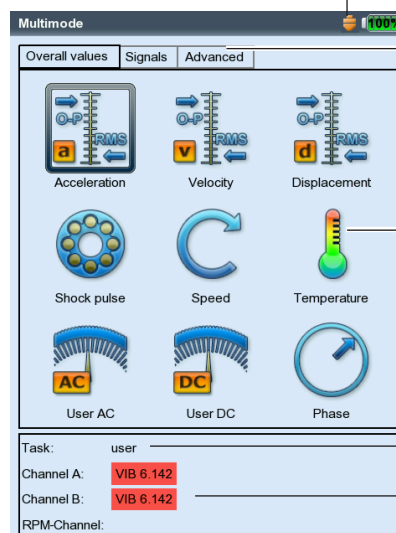

Tab

Measurement quantity (icon)

Info field

Measurement task

Sensor type: VIB 6.142 (here: default sensor)



Note

Before every measurement, VIBXPRT checks that the sensor and cables are correctly connected if sensor detection is activated in the device setup (p. 2-22). In measurements with trigger (phase, orbit,...) the trigger signal is monitored. If the trigger signal fails during measurement, the green LED flashes after the measurement. The measurement must then be repeated.

Continuous measurement (live mode)

In 'live mode', the signal is measured and displayed continuously. This lets you check the signal and the stability of the measurement. It is not available for time-limited measurements, such as the coastdown curve and impact test. The live mode is activated in the Display Setup (see p. 4-17). The actual data collection begins when you press 'Enter' again.

Enter

Alternatively you can activate the live mode by keeping the 'Enter' key pressed when the measurement starts. The actual data collection begins when you release the 'Enter' key.



Note

Measurement progress is indicated by a bar at the top edge of the screen. In the live mode, the 'Live' symbol appears in the title bar and the progress bar remains at 0% (see below).

Save result



After completing a measurement, the blue LED lights if no measurement failures have occurred and no limit value has been exceeded (P. 2-2).

- Press the MENU key and click on 'Save' (see below).
- Enter a file name (File manager and Text editor see P. 6-2ff).

Left:
Live mode =
continuous measurement

Right:
Save result

Progress bar Live mode enabled

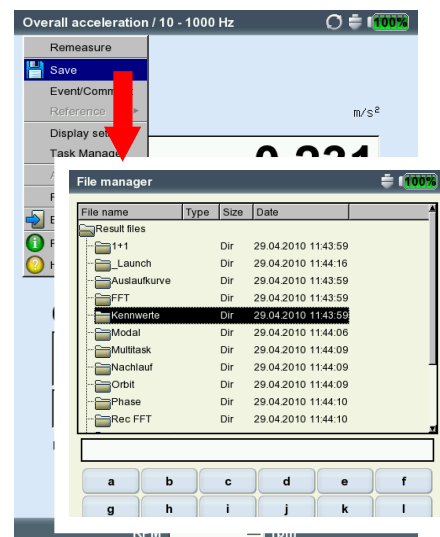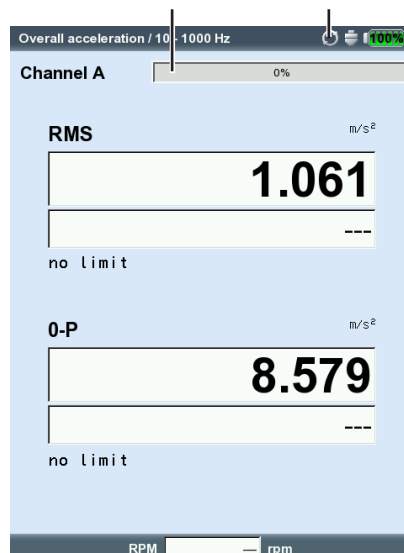


Measurement of a route

The 'Route' mode processes a specified number of measurement tasks which are carried out regularly according to a specific schedule with VIBXPRT. The measurement tasks for a route are compiled on the PC using the OMNITREND software.

Preliminary remarks

A route can be carried out in the specified sequence or in any order; it can also be interrupted at any time and can be started again at a later point in time. It is possible to skip individual elements in the route if an aggregate is not in operation, for example. The skipped measurement tasks are counted as processed. When the route has been processed, it can be transferred into the OMNITREND database for evaluation and in order to archive the results on the PC.

The following diagram shows the typical workflow of a route:

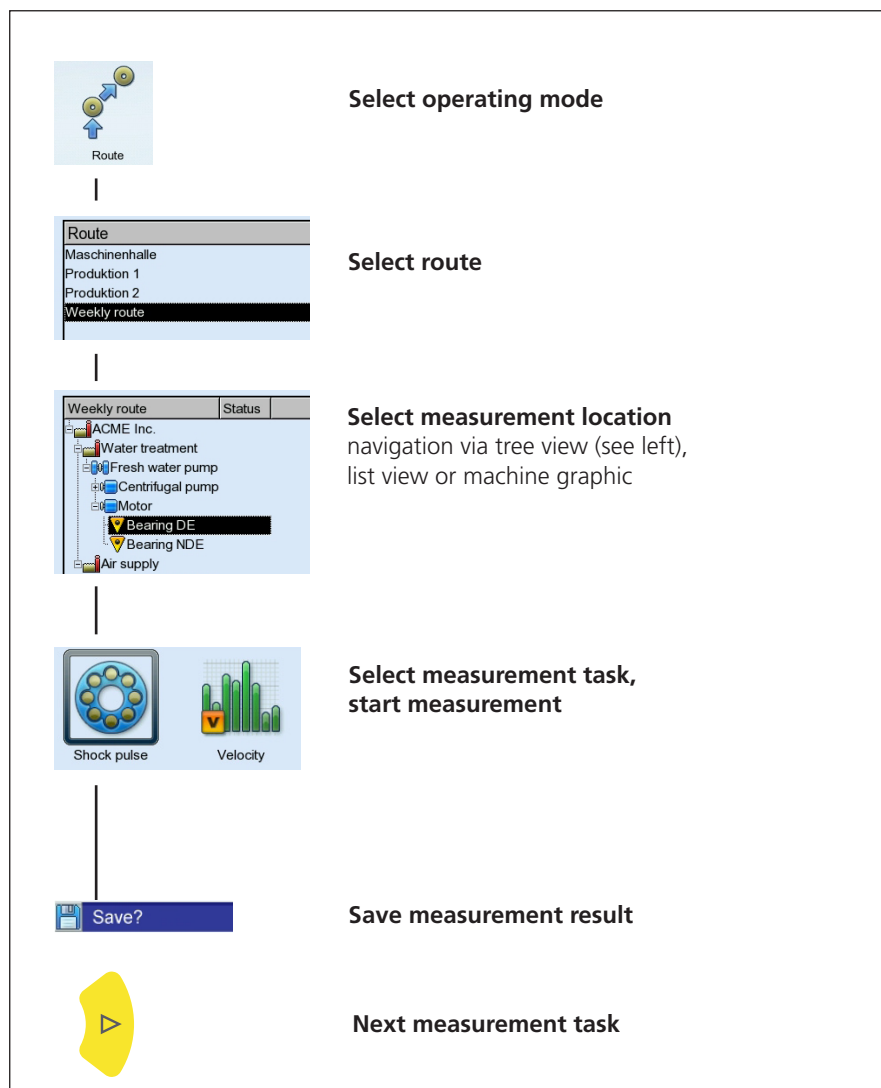

Sequence of a route measurement

*For more information, see also Chapter 5 'Measurement tasks'

As well as the standard measurement tasks*, the following route-specific measurement tasks can be included:

Adaptive measurement task

An adaptive measurement task automatically adapts the sequence of the route to the condition of the machines. If these run within the permissible range, the data collector only records overall values. This keeps the resulting volume of data and number of measurement tasks to a minimum.

If an overall value exceeds the selected warning or alarm level, additional diagnosis measurements are automatically performed. These additional measurement tasks (spectrum, overall values) are stored in the OMNITREND PC software for each machine.



Note

The threshold value which triggers the diagnosis measurement is defined in the OMNITREND software as an 'adaptive trigger'. If no 'adaptive trigger' is defined, the diagnosis measurement is triggered when the lowest threshold value is exceeded.



Visual inspection

A visual inspection task includes all types of data gathering that are based on defined conditions of a machine and that cannot be measured with electrical signals. For example, the degree of contamination of an aggregate, the belt tension on a drive or the fill level of a tank can all be ascertained without having to measure a signal. The possible conditions in OMNITREND are defined in the form of a 'visual inspection task' (e.g. 'Aggregate clean / slightly contaminated / heavily contaminated'). The machine condition is inspected in situ and the applicable option selected from a list.



Manual entry

This measurement task allows numerical measurement values that were acquired from another measurement device or read on a display instrument (e.g. flow rate, pressure,...) to be entered in VIBXPRT.

Notes about routes

A route can contain the following information:

- Alarm and warning thresholds
- Reference results that define the good machine condition.
- Historic measurement results
- Frequency marks
- Master data of the route (name, user, version, ...)

To display the master data, highlight the route in the route list (see below), press the MENU button and click on 'Info'.

Typical workflow of a route


This section explains how to process a route if all the preparations have already been made (see P. 3-1). The menu options that are available to you are described in one of the following sections. The evaluation of the results on the device* is described in Chapter 4.

* Route measurements are usually evaluated in OMNITREND.

Start Route

- Click on the 'Route' icon in the start screen.
All routes available in the data collector are displayed in the route list (see below). The right column ('Completed') specifies the number of measured locations / total measurement locations for each route.
The lower info field shows for the selected route the date and time when it was loaded into the data collector and when it was measured last.
- Click on the route you wish to measure.
The route is displayed either as a list or tree - depending on what display mode is set (see p. 2-15).
- Navigate to the measurement location where you would like make a measurement and click on it. The measurement task selection screen appears (s. next page).
- Select the measurement task (see below), and connect the sensor specified in the info field.
- Press 'Enter' to start the measurement.
- Select the next measurement task and start the measurement.

If all measurement tasks have been completed, the message 'Route is finished!' appears.

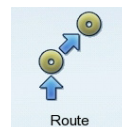

Route	Done
Maschinenhalle	0/11
Produktion 1	0/11
Produktion 2	0/11
Weekly route	0/8

Downloaded:	15.03.2010 10:52:28
Last measured:	Unmeasured

Route list



Info field



Aggregates und machines in the tree view (left) and in the machine graphic view mode (right).

Notes about the tree view:

- If the 'Graphic Route' option is activated (p. 2-14), you can select the measurement location using the machine graphic (see left).
- If the branch cannot be opened up to the measurement location level, press the MENU key and select 'Expand' -> 'Meas. points' (see below).

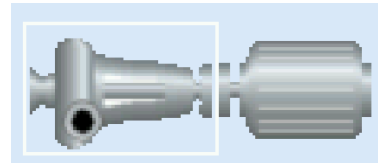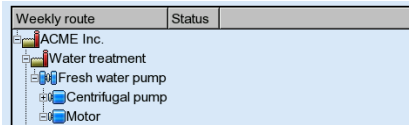

Centrifugal pump Motor

Notes about the list view:

- The list view only shows the measurement locations.
- The order of the measurement locations in the list view can vary from the order in the tree view. The list view indicates the order of the route. The tree view indicates the sequence in the measurement location database.



Standard sensor is active when the sensor icon at the top left is orange and the sensor type in the info field is marked red! The sensor setup is overwritten with the standard sensor. (p.3-3).

Reference measurements must be carried out first (e.g. RPM measurement for the normalization of a bearing measurement).





Various route options shorten the measurement times. Depending on which option is enabled in the Route Setup, the measurements can take place virtually automatically (see also p. 2-16).

Left:
Measurement tasks in the route

Right:
Route in tree view / list view

Reverse path to meas. location

Measurement channel and sensor

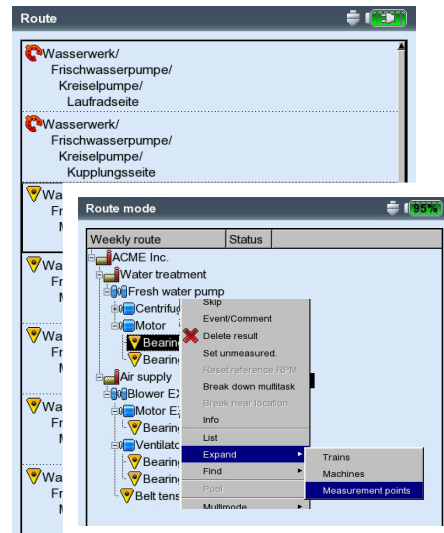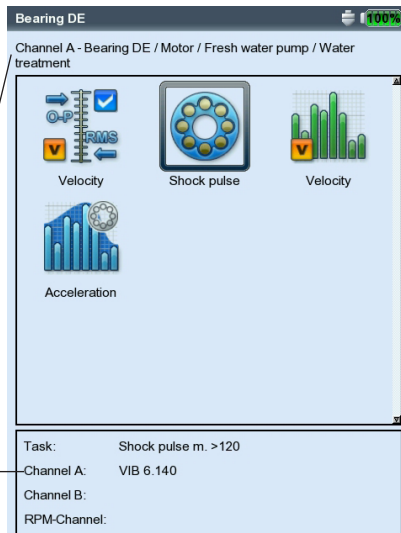

Icons

Measurement task



Measurement task completed / skipped




Adaptive task / Diagnostic task



Reference RPM



Result exceeds alarm, warning, prewarning threshold

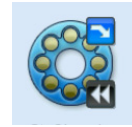

Task with status icons

Status in Tree view / List view



(empty) Partly/ not processed



Completely processed / partly processed and skipped / Skipped



contains Multimode result



contains Event / Comment



Near location (channel A)




Meas. location for triax sensor (X axis)



Result exceeds alarm, warning, prewarning threshold



line speed; the production line speed of the aggregate must be entered before starting the measurements.

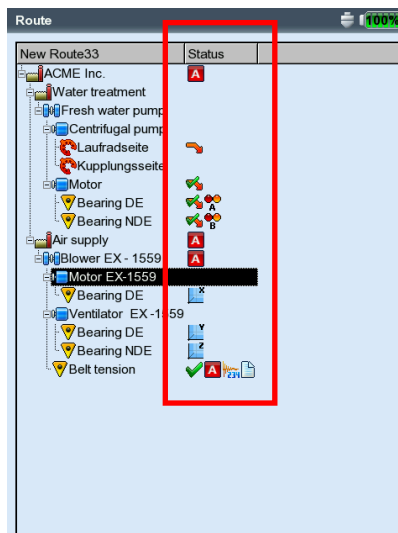

Status in Tree view

MENU

MENU functions in the tree / list view

- Press the MENU key in the tree / list view (see below):

SKIP / UNSKIP

If a machine is not in operation during a route, you can skip all measurement tasks planned at this machine. The measurement tasks that are associated with the highlighted route element and were not measured are left out. This procedure is reversible.

EVENT/COMMENT

Enter an event or comment (see p. 3-26).

DELETE RESULT

Delete the measurement result for the selected element and all sub-elements. This procedure cannot be reversed!

SET UNMEASURED

Change the status of the associated measurement task to 'not measured'. All existing results are retained.

RESET REFERENCE RPM

The reference rpm of the machine train or the production line speed is reset and can be measured again.

BREAK DOWN MULTITASK

All the multi-measurement tasks that are assigned to the highlighted element are broken down into the individual measurement tasks. This procedure is irreversible!

BREAK NEAR LOCATION

The optimized coordination of the measurement tasks for neighboring measurement locations is disabled. The measurements no longer take place simultaneously.



RESET MULTIPLEXER

If the connection to the multiplexer is interrupted during the measurement or between measurements, the addressing has to be reset manually (see p. 3-43).

Left:
**Menu functions
in the Tree view**

Right:
Info dialog

For mechanically coded
VIBCODE-locations, the code ring pat-
tern can be shown.

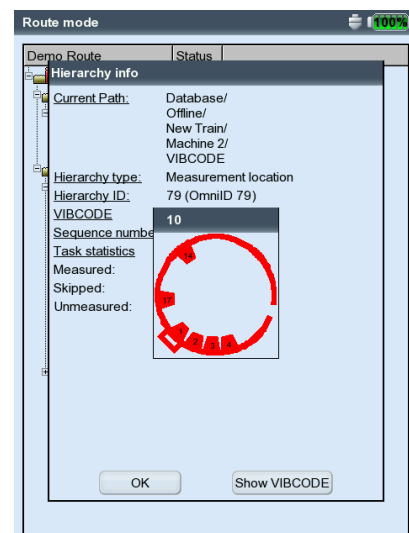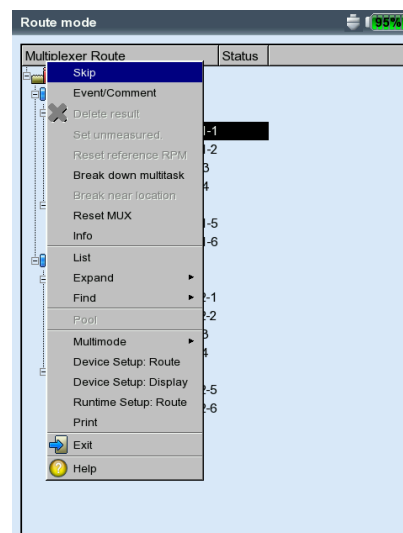

INFO

The following information is displayed for the highlighted element

- Path in the OMNITREND database
- Hierarchy type (e.g. train)
- ID (identification number in the database)
- Sequence number = order of the elements in the route list view
- Task statistics (measured, skipped, not measured)
- VIBCODE code number and code ring pattern ('Show VIBCODE').

LIST (TREE)

Toggle route display mode: List view / Tree view.

*EXPAND / (HIERARCHY)

If the hierarchies are not all displayed in the tree view, they can be displayed with this function.

* The 'Menu' function is only available in the Tree view

*FIND > CRITERIA

Search function; The route can be searched according to name or ID number of an element. Enter the search item in the text editor.

*POOL / ROUTE

Display optional measurement tasks to be measured as required / switch over to route mode.

MULTIMODE > START / RESULTS

Change to 'Multimode' mode to perform measurements which are not programmed in the route. After the measurement, press the ESC key to return to route mode. The 'Multimode' results are automatically allocated to the element in the route from which the operating mode was changed.

To display the results, select MULTIMODE > RESULTS and click on the saved measurement result.

*DEVICE SETUP - ROUTE:

Change the basic settings for route mode. The changes then also apply for all other subsequent route measurements (see page 2-14, 'Basic settings').

*DEVICE SETUP - DISPLAY:

Change the display settings (see page 2-13, 'Basic settings').

RUNTIME SETUP - ROUTE:

Change the following parameters for the active route:

- Standard sensor for vibration measurement; a change is only possible when this option is disabled in the Device Setup.
- Measurement channel = A, B or Auto; must be set to 'Auto' for 'Near locations' and triaxial sensors.
- RPM entry: Manual entry of the RPM value (yes/no).

PRINT

Print out measurement tasks and results (characteristic values only) (see p. 4-24).



MENU functions in the measurement task selection screen

- Press the MENU key in the task selection screen (see below):

SKIP/ UNSKIP

A measurement task can be skipped if it cannot be measured.

EVENT / COMMENT

Enter the event and, if necessary, a supplementary comment to explain the result. It is also possible to use this entry for skipped measurements (see P. 3-26).

BREAK DOWN MULTITASK

Break down multi-measurement task (see previous section).

DISPLAY DIAGNOSTIC TASK

Adaptive measurement tasks contain additional measurement tasks which are automatically carried out for diagnosis if a threshold value is exceeded. This function shows these additional diagnostic measurement tasks.

TASK MANAGER

To check the measurement settings before the measurement, call up the Task Manager here. The settings cannot be changed.

DISPLAY RESULT

The results of a task that has already been carried out can be displayed. Either the last result saved last or a trend appears (see also the 'Show result' option in the Route Setup, p. 2-15).


DELETE RESULT

Delete the measurement result for the selected measurement task. This procedure cannot be reversed!

SET UNMEASURED


Change the status of the measurement task to "unmeasured". Existing results are retained.

MENU functions
in the task selection screen

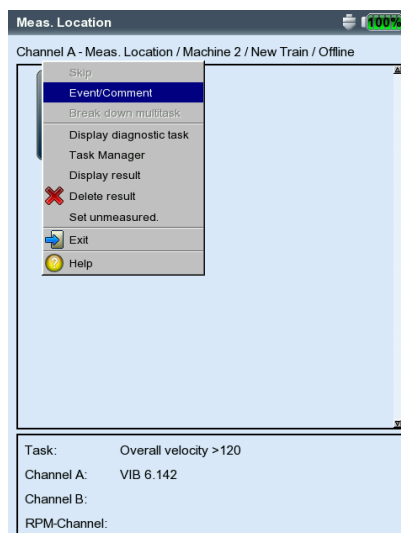


Measuring with a machine template

A 'Machine template' is used if it is necessary to carry out measurements on machines of the same type. The measurement locations are always at the same position and the measurement tasks are identical for each machine. Typical applications are service measurements or acceptance measurements (production tests) on-site at a machine manufacturer's. Machine templates are created with the aid of the OMNITREND PC software.

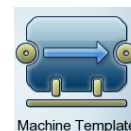

The following diagram shows the typical workflow of a measurement:

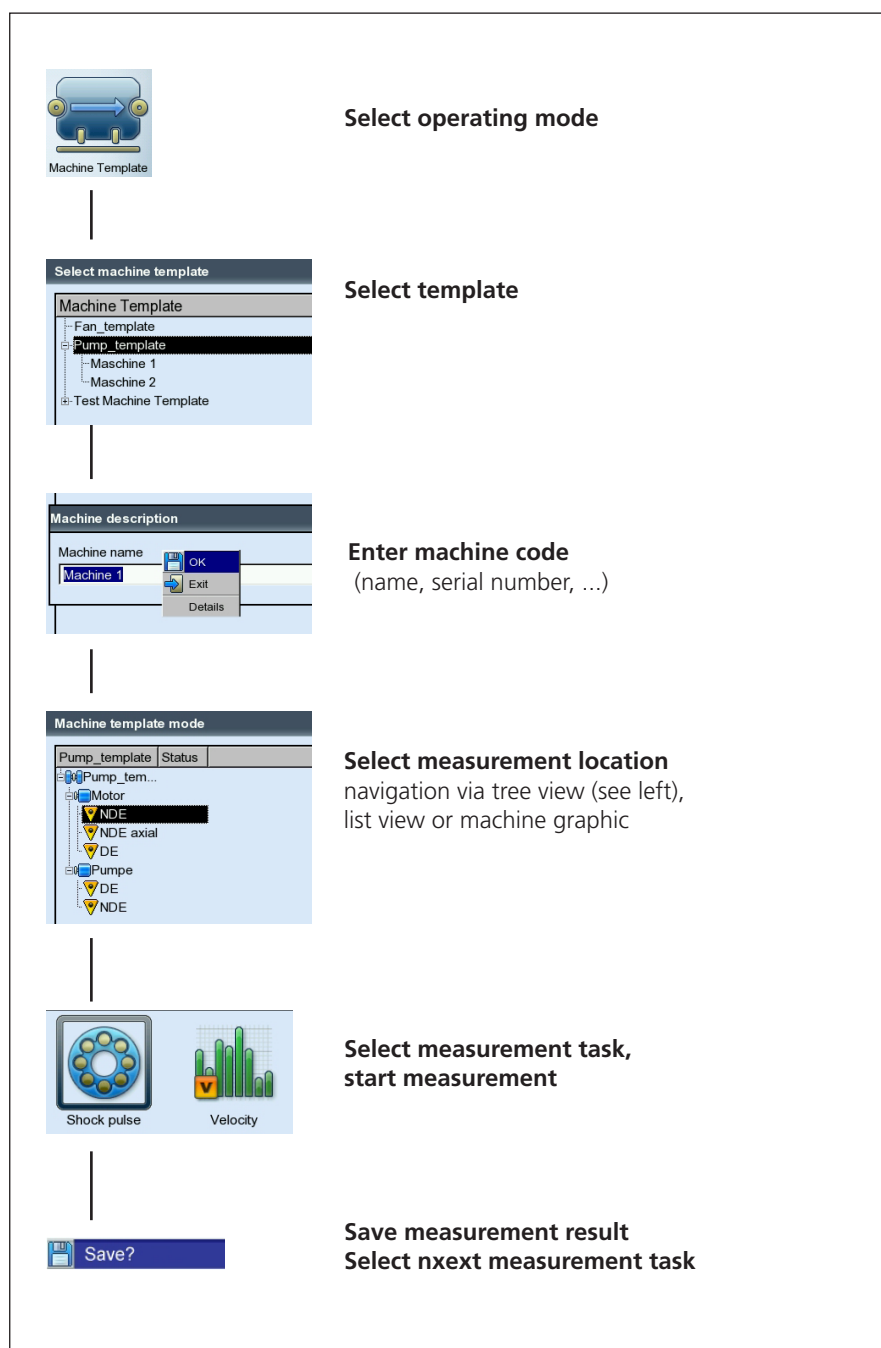

Measurement - Machine template

Preliminary remarks

In principle, a machine template is set up like a route and resembles a route in operation and workflow (see previous section). The differences to a route are described in the following points:

Machine description

This must be identified with a name before the first measurement. Additional data for documentation purposes (such as serial number, model, customer, and tester) can also be entered.

Production test

During a production test, the automatic call up of the next measurement task is deactivated. In this way it is possible to carry out the same measurement task under different operating conditions within the scope of a production test. The remaining measurement tasks are called up manually.

To create a template for a production test, the 'Production test' option must be activated in the OMNITREND template editor (see below).


In the case of templates for production tests, the measurement location hierarchy on the machine is only shown in the tree view. A list view is not available. The number of measurements carried out for each measurement location and measurement task appears instead of the status information.

Number of measurements per task
(in this case: 1.0 = 3 meas. / 3 tasks)

Left:
Template for 'Production test'
and selection of the meas. task

Number of measurements
(here: 2 / 1 / 0)

Right:
'Production test' option
in the OMNITREND template editor

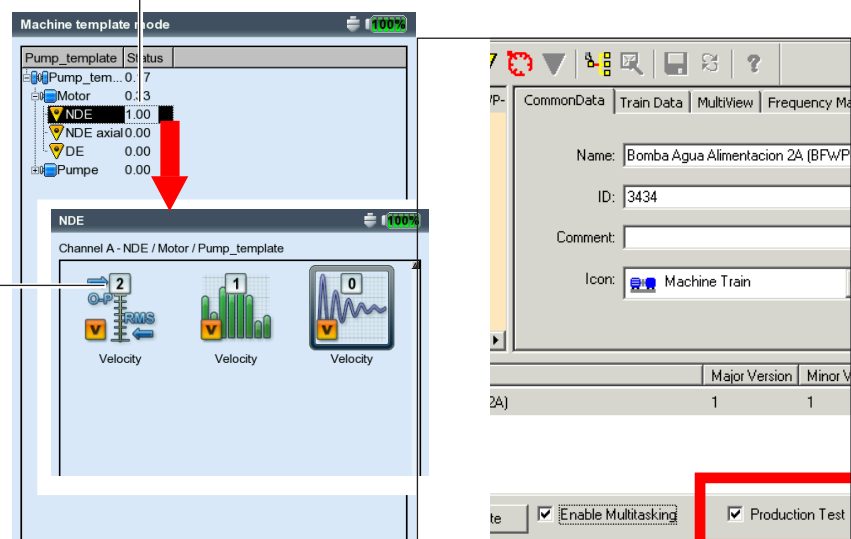

Start measurement

- Click on 'Machine template' in the start screen.
A list of the available machine templates appears (see below). Machines where measurements have already been carried out appear subordinate to the associated template. The number of the measured measurement location and the total number of measurement locations is indicated in the right column ('Finished') for each machine.
The info field for the highlighted machine at the bottom shows when the corresponding template was loaded into the data collector and when the last measurement was carried out.





To continue the measurement on a machine, click on the corresponding subordinate machine.



Note

- Click on the template that you want to use for the measurement. The 'Machine description' dialog appears where a name for the new machine is specified.
- If you do not want to enter any further information, press the MENU key and click on 'OK' to accept the name.
- Otherwise press the MENU key, click on 'Details' (see below) and, if necessary, enter the necessary data as follows:
 - Position the cursor in the corresponding text field and press 'Enter' to open the text editor.
 - After entering the data, press the MENU key and click on OK.

You can change the machine description at any time.

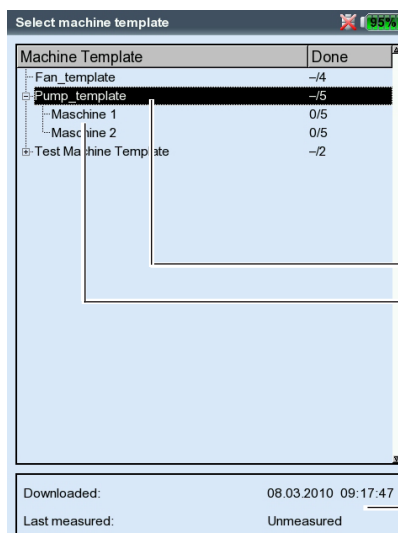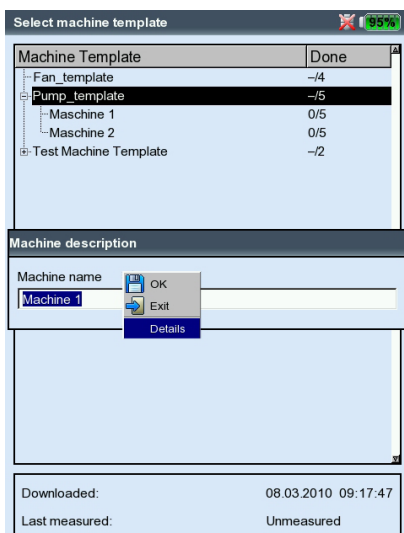

Left:
Enter machine details

Right:
Machine template list

Template
Machine

Info field

Measurement - Machine template

* not in the case of templates for production tests

The template then appears, which – like a route – is displayed as a tree structure or in the form of a list* (see section ‘Route’). The following steps are identical to those in the ‘Route’ section:

- Click on the measurement location.
- Select the measurement task, and connect the sensor specified in the info field.
- Click on the measurement task to start the measurement.
- Select the next measurement task and start the measurement.

Once all measurement tasks have been completed, the following message appears: 'All measurements on the machine carried out!'

Options before, during and after a measurement

In addition to the information given in the previous sections, the options for the measurement are described here.

Aborting a measurement

- Press the ESC key during the measurement.

ESC

Repeating a measurement

- In the results screen, press 'Enter', or ...
- Press the MENU key in the results screen and click on 'Remeasure'.

Enter

Saving a result

Route / Machine template:

- After the measurement confirm the 'Save?' prompt. If the 'Automatic save' option is activated, the result is automatically saved (see P 2-18).

For measurement tasks that have already been measured, the current result can be appended to the result file or can overwrite the latest data in the result file.

Multimode:

- Press the MENU key after a measurement and click on 'Save' (see P 3-4). In the case of a trending file, the result is appended to the existing data set (select 'Append', see P 3-29).

MENU



Changing the measurement channel

Multimode:

- Highlight the measurement type in the selection screen.
- Press the MENU key, and click on 'Task manager'.
- Click on the 'Measurement Channel' field to activate it (see below) and then select the measurement channel (A, B , A/B*).
- To save the change, press the MENU key and click on 'OK'.

* **Channel A/B:**

The overall value, spectrum and time signal can be measured on each of the two channels simultaneously if the 2-channel module is registered.

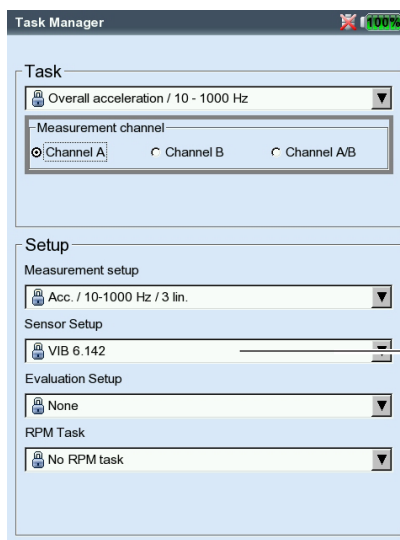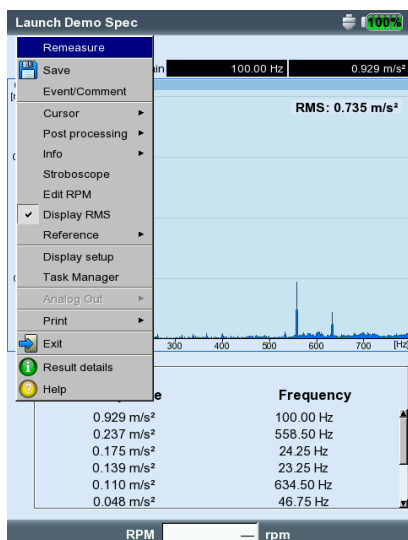

Left:

Repeat measurement

Right:

Change meas. channel / sensor
in the task manager

Sensor

Changing the measurement channel

Route/machine template:

- In the tree/list view, press the MENU key and click on 'Runtime Setup: Route' (see below).
- Select the measurement channel (A, B, Auto = the channel set in OMNITREND). 'Auto' is required when the route uses the 'Near location' or 'Triax sensor' function.

Changing the sensor

Multimode:

- Highlight the measurement type in the selection screen.
- Press the MENU key, and click on 'Task manager'.
- In the 'Sensor Setup' field click in the pulldown menu and select the required sensor (P. 3-17).
- To save the change, press the MENU key and click on 'OK'.

Route/machine template:

- In the tree/list view, press the MENU key and click on 'Runtime Setup: Route' (see below).
- Activate the 'Use default sensor' option.
- Select the sensor that is to be used for all vibration measurements on the route/in the machine template.



Note

Do not activate when the route uses the 'Near location' or 'Triax sensor' function!



A standard sensor can be set up for all routes in the 'Route' device setup. (p. 2-17).

Entering the RPM manually

- Route/machine template:
 - In the tree/list view, press the MENU button and click on 'Runtime Setup: Route' (see below).
 - Activate the 'Manual RPM input' option.

Left:
Select Runtime Setup
(Route)

Right:
Change measurement channel
(Route)

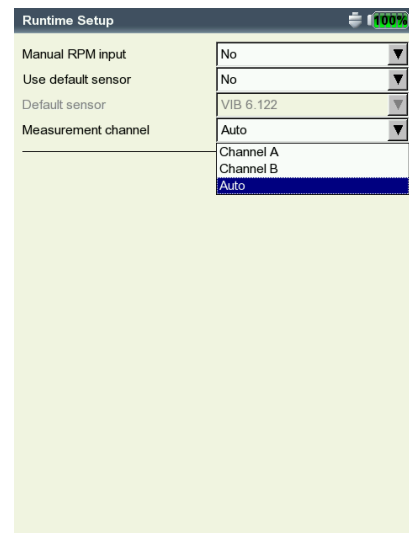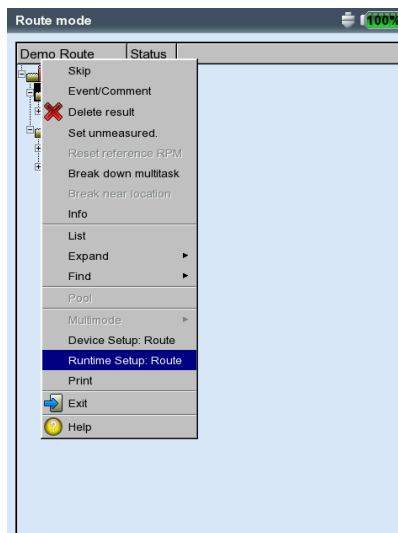

Use this option when you do not have an RPM sensor on the route and need to perform measurements that require the RPM (e.g. roller bearing condition, order-based spectra). If the measurement task already has information on the RPM, this option is ignored.

Changing the measurement task (M)

- Highlight the measurement type in the selection screen.
- Press the F key. A list appears with all the measurement tasks set up for this measurement type.
- Click on the required measurement task (see below).

Setting up a new measurement task (M)

VIBXPERT has a large selection of frequently used measurement tasks* that can be extended by user-defined measurement tasks if necessary. To configure a new measurement task, proceed as follows:

- Highlight the measurement type in the selection screen.
- Press the MENU key and click on 'Task Manager'. The Task Manager appears and can be used to set up the new measurement task (see P. 3-2).
- Click on the 'Measurement task' pulldown menu.
- Press the MENU key and click on 'New'. The text editor appears.
- Enter a name for the new measurement task.
- Change the measurement channel if necessary.
- Select the setups for measurement (see below), sensor**, evaluation or RPM in the 'Setup' field of the pulldown menu. If the matching entry cannot be found, a new setup must be created (see next section).
- Then press the MENU key and click on 'OK'.

M = in Multimode only





* Preconfigured measurement tasks/setups are marked with a lock and cannot be edited (except for transducer & channel).



Open the 'Task Manager'

**Initially only the 'available transducers' appear in the transducer setup (see P. 2-19). To display all transducers, click on the bottom list entry '...more transducers'

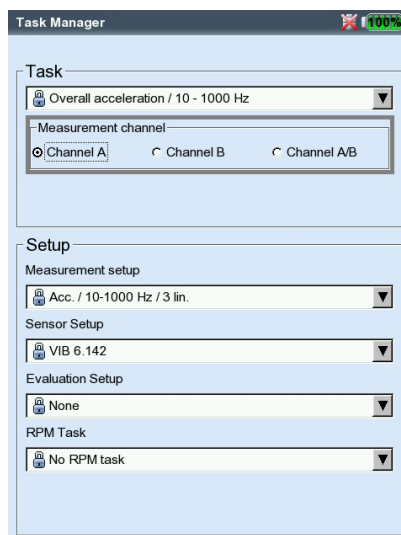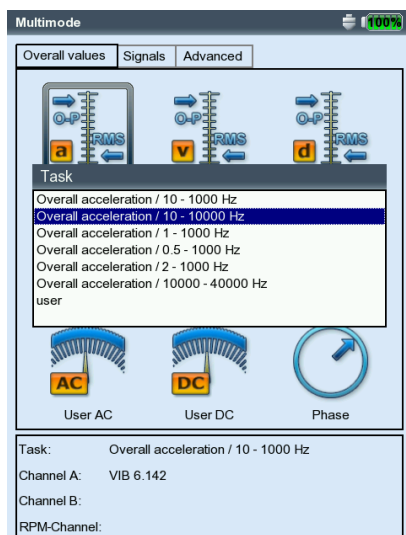

Left:
Changing the measurement task

Right:
Task Manager

Setups for measurement, sensor, evaluation and RPM measurement

M = in Multimode only

Creating a new setup (M)

You can only create a new setup for the measurement, evaluation or rpm for user-defined measurement tasks. You can also create a new sensor setup for measurement tasks preset at the factory.

How to create a new setup:

- Open the 'Task Manager' (see below and previous page).
- Select a user-defined measurement task.
- Click on the pulldown menu where the new setup should be created.
- Press the MENU key and click on 'New' (see below).
- Enter a name in the text editor.
- Then set up the Setup parameters:
 - Press the MENU key.
 - Click on 'Edit'.
 - Change the parameters as required: see sections A to D on the following pages.
- To save, press the MENU key and click on 'OK'.

How to review the setup parameters:



- Open the 'Task Manager'
- Select the setup in the respective pulldown menu.
- Press the MENU key, and click on 'Show' or 'Edit'.

In which measurement task was the setup already used?

- Open the 'Measurement Task Manager'.
- Select the required setup.
- Press the MENU key and click on 'Show' or 'Edit'.
- Press the MENU key and click on 'Usage'.

Left:
Open the Task Manager

Right:
Create a new setup

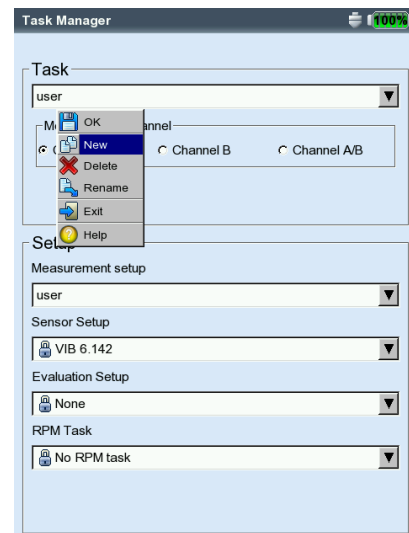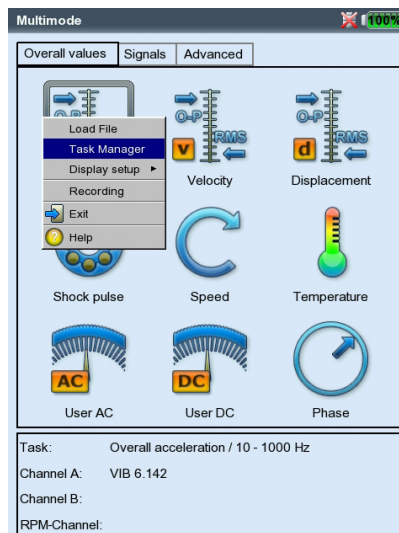

A1: Meas. setup parameters in the 'Overall values' & 'Advanced' tab

MEASUREMENT QUANTITY: Fixed; selection is carried out via the measurement icon. Exception: The measurement quantity can be changed for the 'Orbit', 'Phase' and 'Coastdown' measurement tasks.

SAMPLE FREQUENCY (TIMEWAVE RECORDER): The sample frequency for the time signal defines the maximum upper frequency and influences the maximum measurement time.

MEASUREMENT TIME: Duration of an individual measurement; this depends on the lower frequency.

LOWER/UPPER FREQUENCY: Frequency range of the vibration measurement. The DC component of the signal can be recorded for the 'Vibration displacement' and 'User-defined' measurement tasks (lower frequency = DC, see p. 5-30).

AVERAGE TYPE / NO. OF MEASUREMENTS:

Without averaging: Each single measurement is displayed.

Linear averaging: Single measurements are added and divided by the number of averages.

Exponential averaging: The measurements are averaged exponentially. The final individual measurements are more heavily weighted.

Peak hold: Highest measurement value is displayed.

OVERLAP: Percentage by which consecutive measurements overlap; If the overlap is 0%, the total measurement time is: number of averages x measurement time; the higher the overlap, the shorter the total measurement time. For the runup / coastdown curve, the number of usable measurements can be increased by selecting a higher overlap.



TIME SYNCHRONOUS AVERAGING (PHASE, ORBIT): In this type of averaging, the time signals of each individual rotation are averaged to reduce non-synchronous components in the signal. The number of time synchronous averages is either RPM-dependent (Auto), user-defined or unrestricted:

'Auto': Number of averages is a function of the rotational speed*.

'Manual': Number of averages can be entered (max. 254).

'Unrestricted' (only in meas. setup for balancing): Each individual measurement is averaged with the preceding individual measurement. The longer the measurement takes, the more stable the final result. This averaging type is used for balancing runs. The measurement must be stopped using the 'Enter' key.

During a phase measurement VIBXPRT calculates a phase vector (amplitude and angle) from the time synchronous averaged signal. This procedure is repeated several times in order to increase the stability of the phase vector. The parameters for the phase averaging correspond to the settings under "Average type / Number of measurements" (see above).

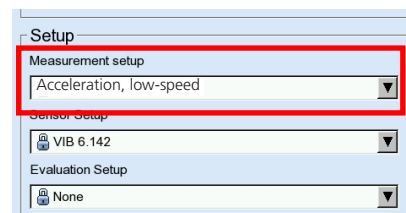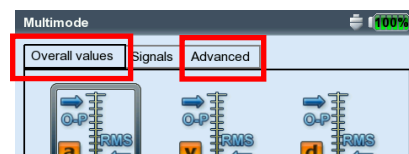

* For example, time synchronous number of averages = 3, if speed \geq 120 rpm.

ORDER (WITH PHASE, ORBIT, COASTDOWN MEASUREMENT)

Order filter for the harmonic vibration components of the signal. For example, only the signal components of the 1st harmonic are filtered out and displayed by the first order filter. A half order is used for detecting oil whirls in machines with journal bearings.

PULSE PER REV. (WITH RPM MEASUREMENT): Number of measurement marks on the shaft or coupling.

MEASUREMENT RANGE (ALL VIBRATION MEASUREMENTS): The measurement range for the analog channel (A/B) can be automatically matched to the input signal ('Auto') or set to fixed*. When set to '[Value] / Auto-Up', the measurement range is automatically increased when the upper limit is exceeded.

LOW PASS FILTER (PHASE, AMPLITUDE COAST-DOWN - PHASE): To suppress high frequency noise signals, a low pass filter (1 kHz) can be activated (Yes). In a coastdown measurement the low pass filters (1 kHz / 10 kHz) are set automatically as a function of the start and stop speeds. With 'No', the signal is processed without a low pass filter.

WINDOW / NUMBER OF LINES (IMPACT TEST): The standard window function for the impact test with an impulse hammer is the rectangular window; all other parameters are described in section A2.

NEGATIVE AVERAGING (IMPACT TEST): Enables an impact test while the machine is running (1 channel and 2 channels with impulse hammer). The signals from the running machine are filtered out.

FRF CALCULATION (2-CH IMPACT TEST): Calculation procedure for the transfer function - (Frequency Response Function = FRF).

TRIGGER TYPE / LEVEL / START

(SHOCK PULSE, VIBRATION OVERALL VALUE, USER AC, IMPACT TEST)

Level: The measurement starts as soon as the signal has exceeded the selected trigger level (in % of the max. meas. range). Signal recording can be started before or after the trigger event via the Trigger start time.

*'Fixed range', e.g. for a runup / coast-down curve or impact test.
Tip: Carry out a test measurement in order to determine the maximum amplitude.

Measurement setup for

- Runup/coastdown analysis (left)
- Orbit (right)

Setup Manager: Measurement

Measurement setup

user

Meas. quantity: Acceleration

Measurement time: 1.000 s

Lower frequency: 10.00 Hz

Upper frequency: 1.00 kHz

Average type: Linear

No. of measurements: 3

Overlap: 0.0 %

Measurement range: Auto

Trigger type: Without

Trigger level: 5 %

Trigger start: 0 ms

Setup Manager: Measurement

Measurement setup

Spectrum Coastdown Vel. 1500-300 rpm user

Meas. quantity: Velocity

Δf: 1.0000 Hz

Lower frequency: 2.00 Hz

Upper frequency: 800.00 Hz

Number of lines: 800

Window type: Hanning

Overlap: 60.0 %

Measurement range: Auto

Start RPM: 1500 rpm

Stop RPM: 300 rpm

RPM deviation: 0 rpm

START / STOP RPM (RUNUP / COASTDOWN): Rotational speed at which the measurement should start or stop.

RPM DEVIATION (RUNUP/COASTDOWN): The current, averaged measurement value is not saved until the rpm has changed by the value set here (see p. 5-11).

RPM RANGE (PHASE - CROSS CHANNEL): Maximum RPM range for calculating the phase correlation.

SENSOR ANGLE (ORBIT): The angle between the two sensors can be freely selected between 5° and 175°.

DISPLAYED TURNS (ORBIT): The time waveform can be displayed over multiple rotations* to check the phase stability. When the phase is stable, the keyphaser mark in the orbit remains constant.

A2. Measurement tasks in the 'Signals' tab

MEASUREMENT QUANTITY: see section A1 - 'Overall values' (prev. page).

FILTER TYPE (ENVELOPE): Software / Hardware; envelope calculation using a software algorithm or via a hardware module.

HP/LP FILTER (ENVELOPE)

36-36 kHz; 1-40/ 20/ 10/ 5/ 2,5 kHz (hardware filter)

0.5 / 2.5 / 5 / 10 / 20 / 40 kHz (lowpass (LP) software filter)




 
Highpass (HP) software filter from 100Hz to 100 kHz, freely adjustable

DEMODULATION FACTOR (ENVELOPE): Ratio of the highpass frequency prior to demodulation to the lowpass frequency after demodulation.

LOWER / UPPER FREQUENCY (F_{MIN} / F_{MAX}): Lowest and highest frequency which can appear in the signal. The lower frequency setting of 0.5 Hz or 1 Hz only applies for spectra and overall value measurements. For the 'Displacement' and 'User-defined' measurement quantities, the DC component in the signal can be recorded (lower frequency = DC).

For envelope spectra only the 'upper frequency' (f_{max}) is specified.

* up to max. number of averages

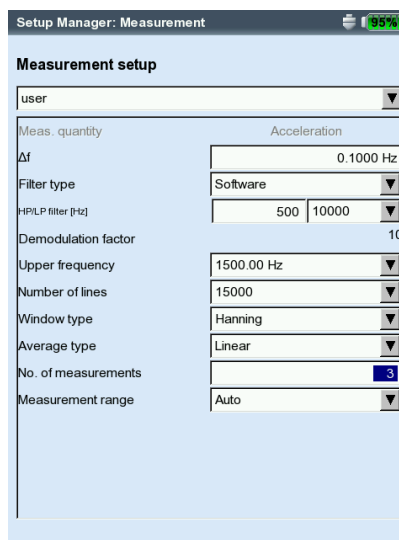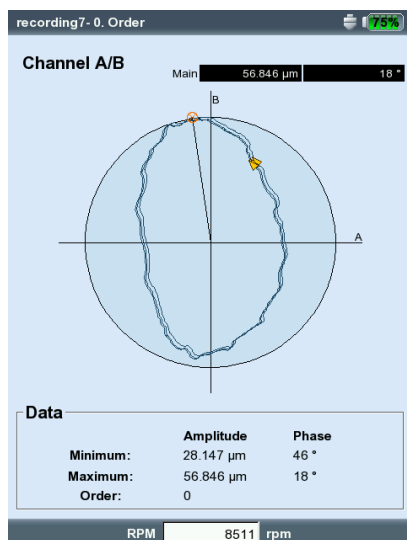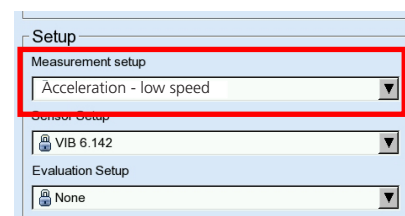

Left:
Keyphaser mark in the orbit remains stable over multiple rotations.

Right:
Setup for envelope spectrum

SAMPLE FREQUENCY (TIMEWAVEFORM): The sample frequency for the time signal defines the upper frequency.

MEASUREMENT TIME (TIMEWAVEFORM): The length of the time window depends on the sample frequency. The maximum measurement time is 640 s.

NUMBER OF LINES (SPECTRUM, CEPSTRUM): Number of lines displayed. Together with the 'upper frequency', this parameter specifies the resolution of the spectrum (Δf).

WINDOW (SPECTRUM, CEPSTRUM): The measurement of periodic signals generates time data sets with periodic gaps as a result of the finite observation period. Thus, the frequency lines appear wider in the corresponding spectrum. The window functions suppress these 'side lobes'.



Note

Window features:

Hanning: Standard for FFT. Frequency precise, but amplitude errors (<15%); for the analysis of continuous processes with high frequency resolution and lowest possible break-off effect.

Rectangular: Frequency errors, but amplitude is precise; suitable for the analysis of individual pulses, particularly if the pulse is at the beginning of the time window.

Kaiser: As with Hanning, but lower amplitude errors (<12%)

Flat-Top: Lower frequency accuracy than Hanning, amplitude more precise. For precision amplitude analysis of continuous processes.

Hamming: Frequency errors as in Rectangular; amplitude errors (18%) less than in Rectangular, but higher than in Hanning.

Bartlett: Next to Rectangular, this is the simplest window (triangle); lower amplitude and frequency accuracy.

Blackman: As for Hanning, but with higher frequency accuracy; amplitude errors as in Kaiser (12%); next to Kaiser, the second best alternative for nearly all applications.

AVERAGE TYPE/ NO. OF MEASUREMENTS (SPECTRUM, TIMEWAVEFORM, CEPSTRUM)

Without: During the measurement each measurement is displayed. The 'Number of averages' specifies how many single measurements are carried out. The last measurement is evaluated.

Linear: The individual spectra are added and divided by the number of averages. This averaging type emphasizes recurring stationary sections in the spectrum.

Peak-hold: Highest measurement value is displayed. This type of averaging emphasizes peaks that occur stochastically.

Exponential: Individual measurements are exponentially averaged (the last spectrum is given the highest weighting).

Time-synchronous: The individual measurements are averaged on a RPM synchronous basis. Reference transducer required.

OVERLAP (SPECTRUM, CEPSTRUM): See section A1, P. 3-21.

MEASUREMENT RANGE: See section A1, P. 3-22.

TRIGGER TYPE/ LEVEL/ START (SPECTRUM, CEPSTRUM, TIMEWAVEFORM) P. 3-22.

B. Setup parameters for sensors

The sensor parameters to be set up are described on P. 2-20 If you have defined a default sensor for vibration measurements (see p. 2-22), the 'Sensor Setup' menu is deactivated.

C. Evaluation parameters for overall value / time waveform meas.

For characteristic overall value measurement tasks, which are measured according to ISO 10816-3, the corresponding thresholds are stored in fixed evaluation setups. For all other measurement tasks, create a user-defined evaluation setup.

- Activate the checkbox in front of the overall value.
- Select the limit value (see below).
- If necessary, change the names of the limit values.

To change the tab, press the '+/-' key or highlight this with the navigation keys.

Enter a description for the evaluation setup:



- Press the MENU button and click on 'Description'. A text field (initially empty) appears.
- Press the MENU button and click on 'Edit'.
- Enter the descriptive text in the text editor.
- After terminating the text input and closing the text editor, press the MENU button and click on 'Save'.

D. Parameters for RPM measurement



The RPM should always only be recorded if RPM-synchronous signals appear in the spectrum, characteristic frequency needs to be updated, or the frequency axis is scaled in orders (order-based analysis).

In addition to the measurement, you can enter the speed by hand (not for phase measurement and balancing). If you want to enter the RPM by hand before a measurement*, proceed as follows:

- Select the 'RPM measurement' menu and press the MENU key.
- Click on 'Edit' to open the task manager for the RPM task.
- In the 'Sensor Setup' menu, set the transducer to: 'Manual entry'.

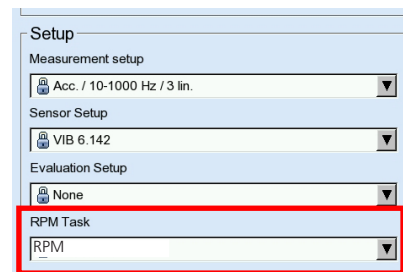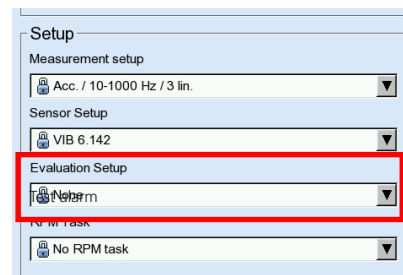

*Instructions on how to enter the RPM by hand after a measurement (spectrum only) can be found in the next chapter (see p. 4-11).

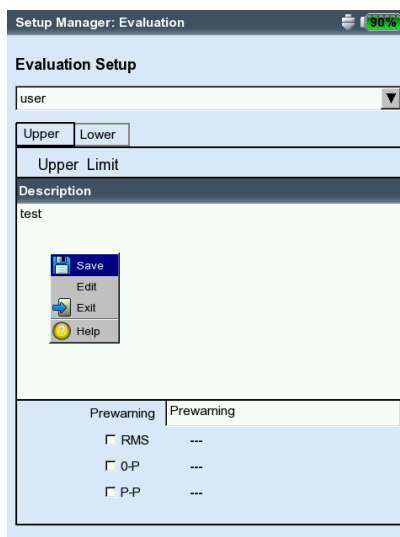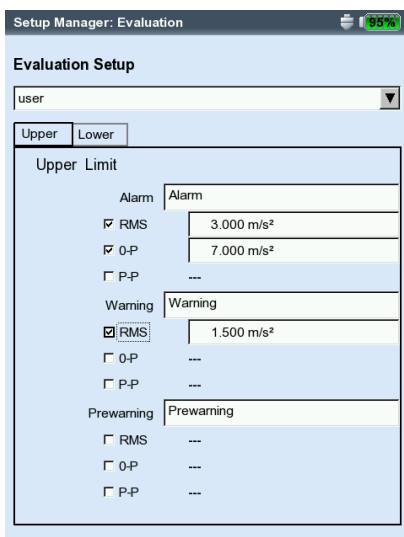

Left:
Evaluation parameters for overall values

Right:
Evaluation parameters description

* Import user-defined events via OMNI-TREND.

Entering an Event/Comment

You can record information relating to data collection using pre-defined events* and freely editable comments. Up to 10 events can be assigned to every measurement result and every element in a route.

Assigning an event

Prerequisite: The result screen or tree/list view of a route is displayed.

- Press the MENU key and click on 'Event/Comment' (see below). The event editor appears.
- Select the relevant event or events in sequence. The selection is listed in the lower event window.

Entering a comment

- In the event editor press the MENU key again and click on "Enter comment" (see below).
- Enter the comment and close the text editor. The comment is displayed below the event window.

Saving

- To save, press the MENU button and click on 'OK'.
A comment icon appears in the result screen next to the channel name. An event/comment icon appears in the tree/list view next to the route element (see p. 3-9).





Note

You can edit, delete and add events in the route later on. Events in the 'Multimode' cannot be edited or deleted.

Left:
Enter comment

Right:
Open Event Editor

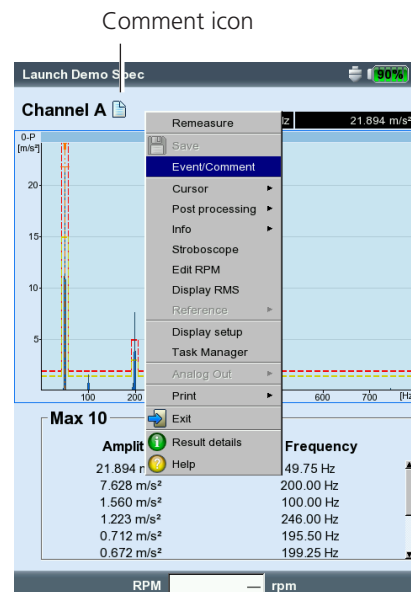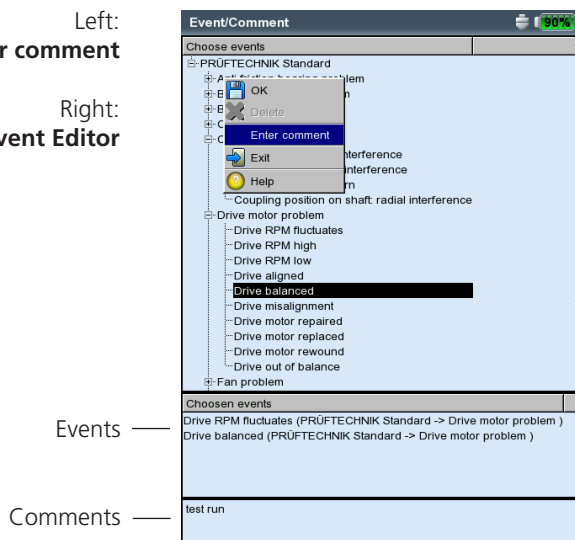

To delete an event/ comment in the route

- Press the F key in the event editor to open the bottom event or comment window.
- Select the event or comment to be deleted.
- Press the MENU key and click on 'Delete'.


F

Signal sensitivity on analog output/headphones

The analog output is activated and configured in the device setup (see p. 2-28). To adjust the sensitivity of the analog output, proceed as follows:

- Press the MENU key in the measurement screen.
- Select 'Analog Out' / '<Sensitivity>' and set the desired sensitivity.

For 2-channel measurements, you can also select the channel whose signal is to be output on the analog output (see below).

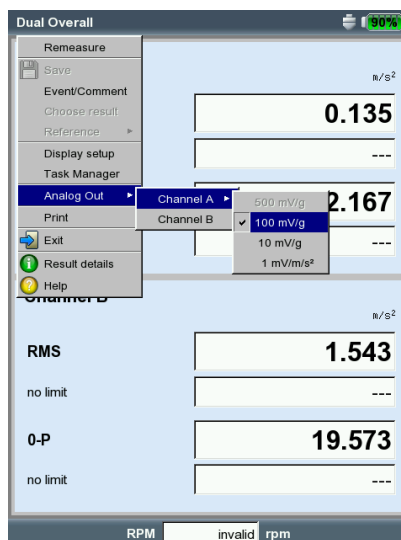**Analog signal output**


- Controlling signal sensitivity
- Selecting a measurement channel (2-channel measurement)

Trend

The standard procedure for monitoring machine conditions is the regular recording of characteristic overall values over a longer period of time. The trend of the machine condition can be traced back from the resulting trend curve and its probable development in the future can be predicted.

To obtain a meaningful trend, measurements must be carried out under always reproducible conditions - i.e. machine operating conditions, measurement location and sensors must be comparable or identical.

In 'Route' mode, you can access historical measurement data and reference data that you can compare to the current measurement data, if necessary.

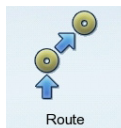

Trend in a route

- Open the relevant route.
- Select the measurement task for which at least one measurement has already been saved.
- Start the measurement.
After the measurement, confirm the prompt to save which appears. Then* the following message appears (see below):

Measurement tasks already measured!

APPEND: The current result is added to the saved data set and extends the trend curve (see below).



OVERWRITE: The current result overwrites the already saved measurement data.

- To display the trend curve, highlight the measurement task icon and press the MENU key.
- Click on 'Display Result'. The progression of the measurement values can be evaluated in the trend screen (see P. 4-3).
Prerequisite: The 'Show result' option in the Route device setup must be set to 'History' (P. 2-15).

* When AutoSave is activated, the message appears immediately after the measurement.

Left:
Append current result


Right:
Display trend curve

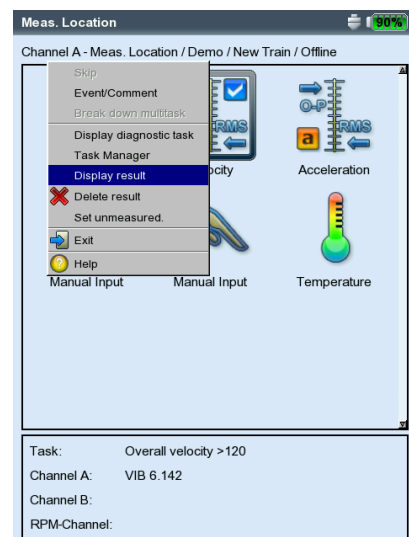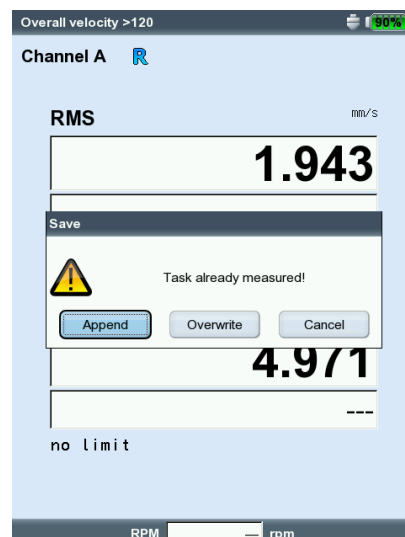

Trend in the 'Multimode'

To start a trend, first open the file in which the measurements that were already carried out are stored:

- Click on 'File manager' in the start screen.
- Click on the file that was saved as a trend measurement.
- To start the measurement, either press 'Enter' or press the MENU key and click on 'Remeasure'.
- After the measurement press the MENU button and click on 'Save'.
- In the following prompt, click on 'Append' to add the current result to the saved data record (see below).

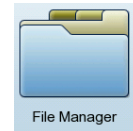



To create a new measurement file, select 'New'. This is a simple method of adopting the settings of an existing file for a new measurement.

To overwrite the data of the saved file, select 'Overwrite'.

Measurement data that cannot be displayed as a trend

For measurements such as orbit, impact test, and 1+1 measurement, the results are added to the data set but a trend display is not possible. The individual results can be called up as follows:

- Open the 'File manager'.
- Click on the file with the measurement data.
- Press on the MENU key. Click on 'Choose result'.
- Select the desired result in the list (see below).

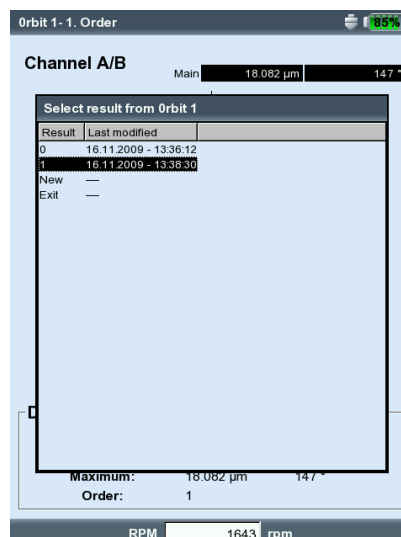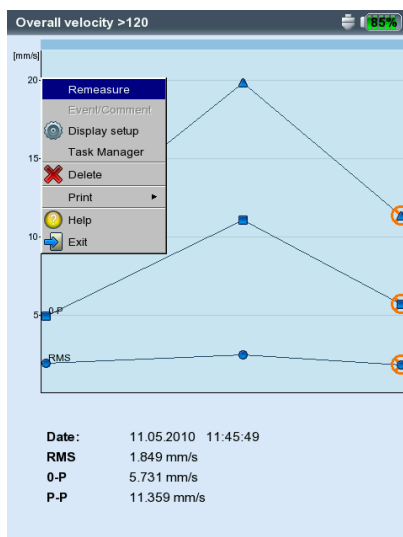

Left:
Starting a trend

Right:
Individual results are listed, if a trend display is not possible.

Comparing the current measurement with historical data/ reference data

The following requirements must be met to be able to use this feature:

- Historical data for the respective measurement task exist in the OMNITREND database.
- A data set has been declared as a reference in the OMNITREND database.
- The data sets were loaded in VIBXPERT with the route.
- The display mode for route results is set to 'Standard' (see also Device setup for route, p. 2-15).

To compare the current measurement with the reference data, proceed as follows:

* If the measurement is stored automatically, the program subsequently jumps to the measurement task screen.

Open the current measurement result as follows:

- Highlight the measurement task icon.
- Press the MENU key, and click on 'Display Result' (see previous page).

- After the measurement is completed*, press the MENU key in the measurement screen.

- Select 'Reference' and click on 'Compare with reference' (see below).

When overall values are being measured, a value table appears; for signal measurements, the data are displayed in a waterfall diagram.

In a TrendingSpectrum, the display depends on which panel of the results screen is activated: the upper panel containing the spectrum (-> waterfall) or the lower panel containing the band alarm overall values (-> trend) (see p. 4-10).


To compare the current measurement with the historical data, proceed as follows:

- After the measurement is completed*, press the MENU key in the measurement screen.

- Select 'Reference' and click on 'Show history'.

When overall values are measured, a trend appears; for signal measurements, the data are displayed in a waterfall diagram.

R: Reference data exist
Left:
Calling up reference data
Right:
Compare current data with
reference & historical data
(characteristic values)

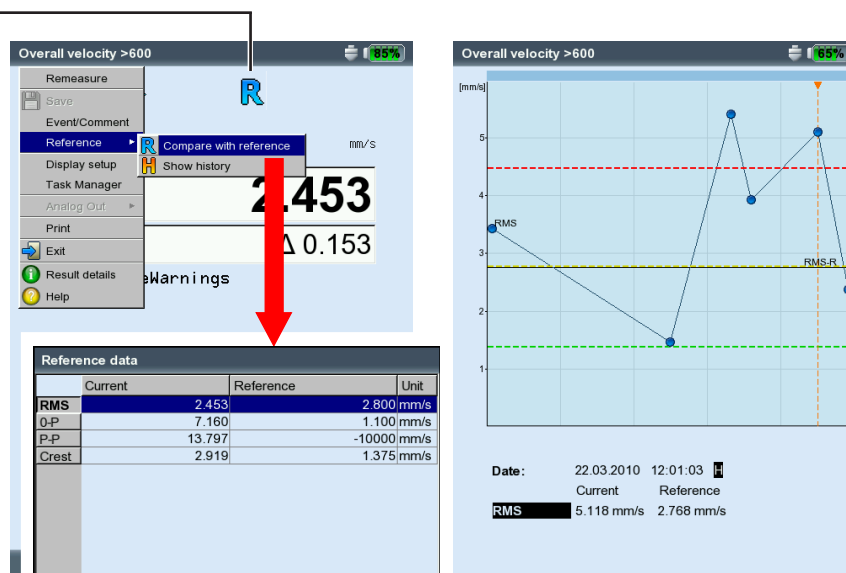


Prewarning if measurement values deviate excessively

In the 'Route' mode, VIBXPert recognizes by how much the current measurement value differs from the last recorded historical measurement value. If this deviation is large, the green LED on the device lights up and the symbol R! appears in the results screen.




For this prewarning to appear, the following requirements must be met:


- The maximum permissible deviation of the measurement values is set in the OMNITREND software (here: 20%).

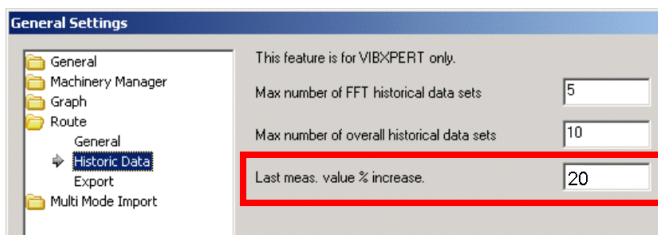

- The '% deviation' and 'Historical data' functions are activated in the OMNITREND Route Editor.

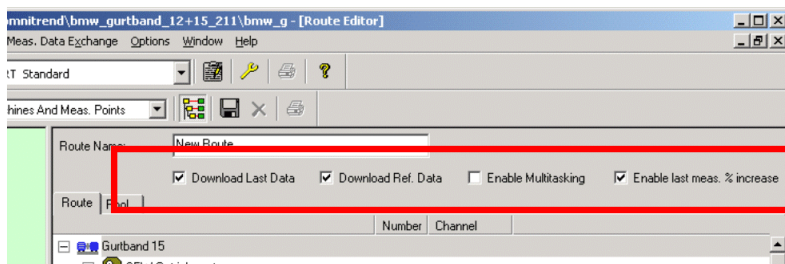

- The settings and data sets have been loaded into VIBXPert with the route.
- The display mode for route results is set to 'Standard' (see also Device setup for route, p. 2-15).

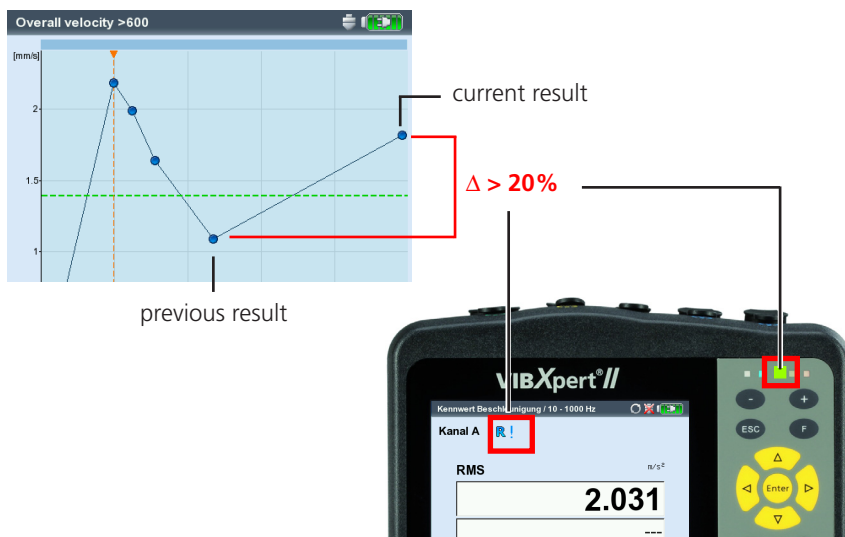

Example:



If the current result deviates from the previous result by more than 20%, the green LED lights up.

Near location (Route)


Data collection on a route progresses more rapidly when measurement tasks at near measurement locations are performed simultaneously. For this purpose, VIBXPRT and OMNITREND provide the 'Near location' function:

Description

- The measurement channels are assigned and the two measurement locations are spatially allocated when the route is established in OMNITREND:

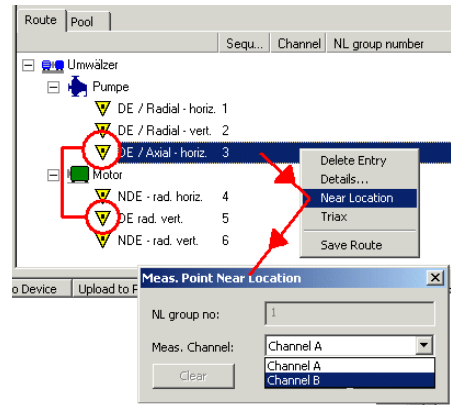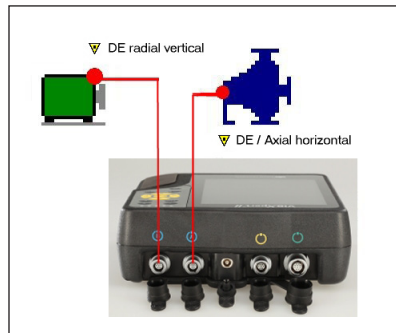


Near location

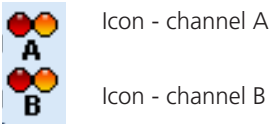


- In the tree/list view, near measurement locations are labeled with an icon that also indicates the measurement channel for the measurement locations. When a near measurement location is selected, the associated measurement location is automatically highlighted (see below).
- VIBXPRT always groups two fitting measurement tasks to one 1+1 measurement according to certain rules. Measurement tasks that do not fit this pattern are measured individually in sequence (see below).

Left:
Near location
in the tree view

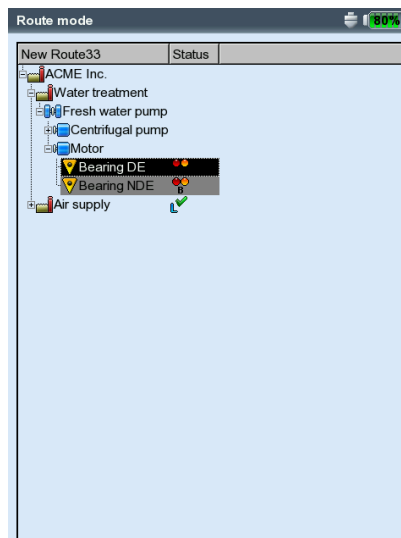

Right:
Fitting measurement tasks are grouped to one 1+1 measurement

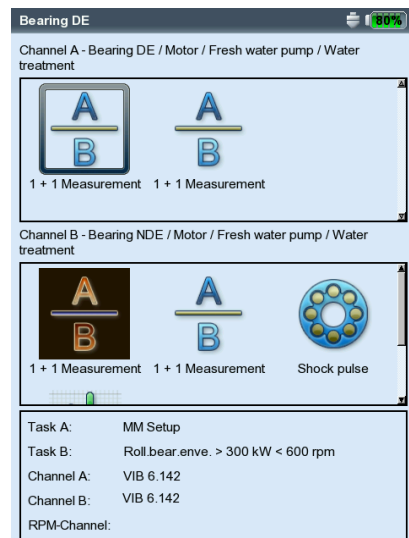

Restrictions

- The grouping of measurement tasks to a 1+1 measurement is only possible if firmware module '2 channels' (VIB 5.381) has been registered in the device.
- For 'Near locations', the "Multitask" measurement task is disabled.
- In the route runtime setup, a standard sensor should not be set up and the measurement channel must be set to 'Auto' (p. 3-18).
- Because a trend display is not possible for 1+1 measurements, the last measured result always appears when a result is loaded via the measurement task selection.

Options during the route

Skipping a measurement location/measurement task (see p. 3-10):

- If you skip over a measurement task, only the grouped measurement task within the 1+1 measurement is skipped.
- If you skip a measurement location, the near location is skipped as well - including all associated measurement tasks.

Disabling the spatial sequence:


'Near location' can be disabled in the route:

This procedure affects the selected route element and the appropriate tasks. This procedure cannot be reversed!



Attention!

- In the tree/list view, select a route element and press the MENU key.
- Click on 'Break near location' (see below).
All lower level measurement tasks are then performed like normally configured one-channel measurements.

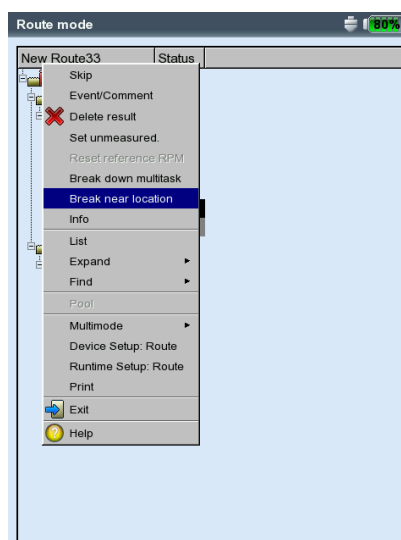


Disabling near location(s)

Triaxial sensor (Route)


A triaxial sensor simultaneously records machine vibrations in three axes (X/Y/Z). VIBXPRT supports the use of a triax sensor in the route as follows:

- The three axes of the sensor are mapped in the database with the aid of three measurement locations. The assignment is created in the OMNITREND software.
- In OMNITREND, a sensor of type 'ICP' must be assigned to the measurement tasks.
- Because VIBXPRT only has two measurement channels, a special cable adapter (VIB 5.336) is required that groups the second and third signal line (Y/Z) on channel B.
- The measurement tasks for the X and Y directions are grouped by VIBXPRT into a 1+1 measurement and simultaneously recorded in channels A and B. VIBXPRT then records the measurements in the Z axis.

Triaxial sensor
Wiring diagram

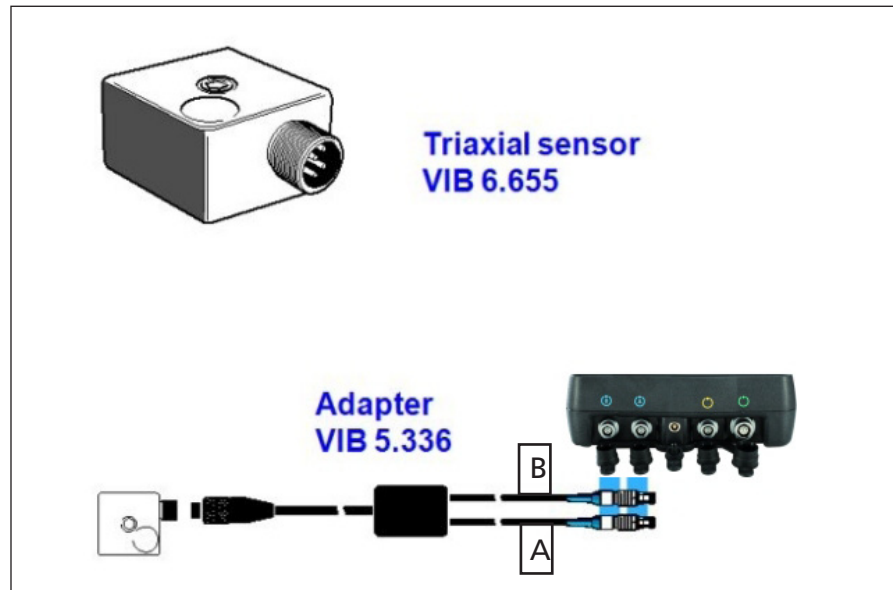

One measurement location for every measurement direction

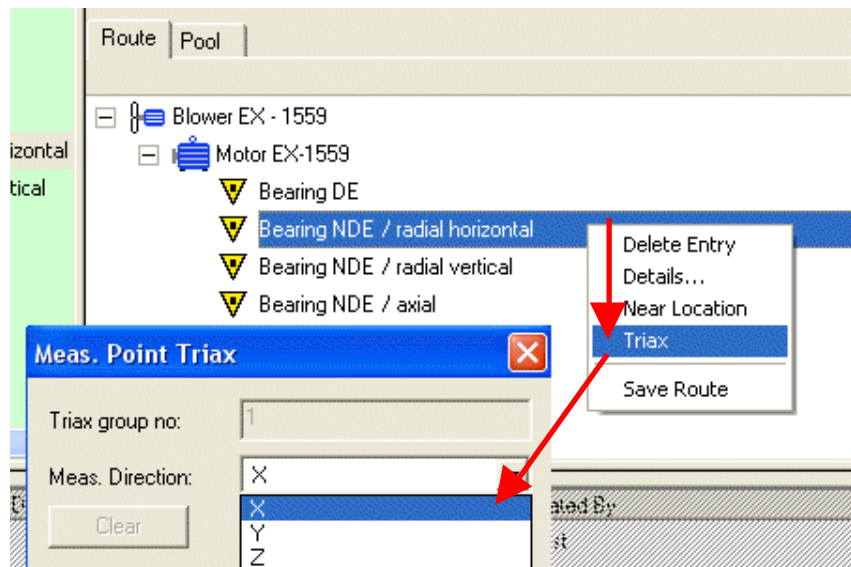

Requirements

For measurements with a triaxial sensor to run without problems, the following requirements must be met:

- In the route device setup for the measurement (see p. 2-17), the 'Use triax sensor' option is enabled (see below).
- In the route runtime setup, a standard sensor should not be set up and the measurement channel must be set to 'Auto' (p. 3-18).
- The '2 channels' firmware module (VIB 5.381) must be registered.

Starting a measurement with a triaxial sensor



- Mount the triaxial sensor on the machine.
For evaluation later on, note down the relationship of the sensor axes to the measurement direction on the machine (e.g. X = radial horizontal, Y = radial vertical, Z = axial).
- Connect the triaxial sensor to the measurement device according to the following diagram (see also previous page).
- Open the route and select the triaxial measurement location.
In the tree/list view, triax locations are identified by an icon that indicates the sensor axes. The other two associated measurement locations are automatically highlighted (s. below).
- Click on the measurement location to display the tasks.
The measurement tasks for the X and Y directions are, where possible*, grouped to a 1+1 measurement and are measured simultaneously on channels A and B. The measurement task for the Z direction is measured separately on channel B.
- Click on the measurement task to start the measurement in the X and Y directions. After the measurement in X and Y directions, the measurement location for the Z-direction is shown.
- Click again to start the measurement in the Z direction.

Triaxial measurement location

Icon for sensor axes X, Y, Z



* For example, spectra with a 131 kHz frequency range cannot be grouped to a 1+1 measurement.

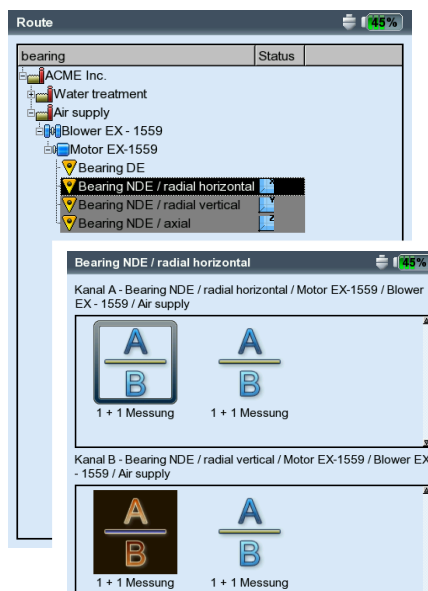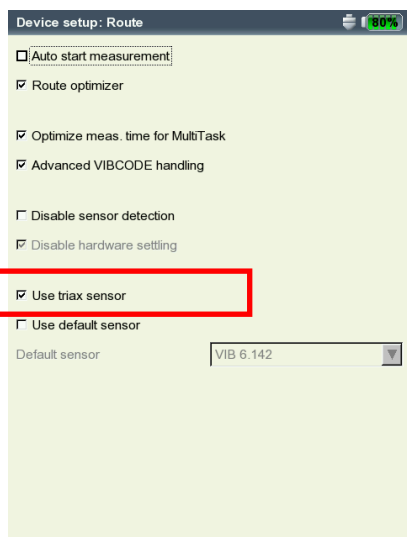

Left:
Enabling the triaxial sensor option in the route device setup

Right:
Triaxial sensor locations in the tree view

Triaxial sensor tasks are performed as 1+1 measurement (X and Y axes only)

* Firmware module 'Recording' (VIB 5.385) must be registered.

Recording

With the 'Recording'* function, you can perform measurements dependent on time or rotational speed. For example, this method can be used to record measurement values under certain operating conditions (= rpm range) or at fixed time intervals.

Availability and restrictions

Recording is available in 'Multimode' for every measurement, with the following exceptions:

- COASTDOWN CURVE
- IMPACT TEST
- TIME WAVEFORM RECORDER
- PHASE - CROSS CHANNEL


Restrictions also apply to the following measurements:

- SPECTRUM: Averaging is not possible for rpm-controlled recordings.
- TIME WAVEFORM: The 'time synchronous' averaging type is not permissible.
- MULTI MEASUREMENT TASKS: rpm-controlled recording is not possible.
- SHOCK PULSE MEASUREMENT (ROLLER BEARING CONDITION): rpm-controlled recording is only possible without normalization.

Configuration

- Click on 'Multimode' in the start screen.
- Select the measurement for which you want to set up recording.
- Press the MENU key and click on 'Recording' (see below).

Opening the recording configuration window

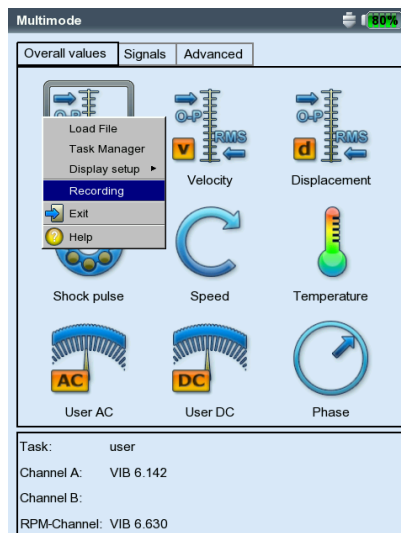

The configuration screen appears (see below).

Start conditions

IMMEDIATELY: The recording starts immediately (MENU -> Start).

START IN: The measurement recording begins after a set period (0 s ... 23:59:59 h).

START AT: The measurement recording begins at the set time (time, date) or when the set rpm is reached (0 ... 1000 Hz); rising or falling edge can be selected. For an rpm-controlled measurement, the task must contain an rpm measurement.

DELAY: Specifies the time/rpm change between two measurements.

Stop conditions

COUNTER: The measurement is ended when the entered number of results has been measured (1 ... 10000).

RUN FOR: The measurement recording runs for the specified time (0 s ... 23:59:59 h).

STOP AT: The measurement stops at the specified time or when the set rpm is reached (0 ... 1000 Hz); the rising or falling edge can be selected.

MANUAL: The measurement stops when the memory card is full or when the ESC key is pressed.

Further settings

SWITCH OFF BACKLIGHT: To save power when operating the device during recording, the display illumination can be switched off permanently. This option is independent of the settings in the device setup (P. 2-13).

TRIGGER: This option is only available if the measurement is triggered via the signal level (see 'Trigger', p. 3-22).

'Single': The trigger condition is only considered before the first measurement.

'Multi': Only start each measurement when the trigger condition has been met.

TARGET FILE: The results and the configuration settings are saved in a file. It is not possible to add multiple recording files.

The start, stop and delay conditions can be independently controlled according to time or rpm. For example, recording can be set to start at a certain time, but the next measurements only take place after a certain change in the rpm.

Recording configuration

The number of results depends on the available memory space

Testing the rpm sensor

To test the function and the positioning of the rpm sensor, a test measurement can be performed prior to the measurement recording:

- Press the MENU key and click on 'Test speed'.
- To return to the configuration screen after the test measurement, press the ESC button.

Displaying the characteristic overall values

During the measurement recording, a dialog window appears in the measurement screen with an overview of the configuration settings. Optionally, you can also display an Overall value overview (see below):

- Press the MENU key in the configuration screen and click on 'Overall overview' (see below).
- Activate the overall values to be displayed, and select, if necessary, an additional parameter (maximum, minimum, max./min.). Up to nine values can be displayed at the same time.

F

To hide the dialog window and display the concealed areas of the measurement screen, press the F key.

Starting the measurement recording

- Press the MENU key in the configuration screen and click on 'Start'.



The measurement screen appears. A dialog is displayed in the foreground that contains the most important information on the recording: start conditions, stop conditions, trigger variable (time or rpm), number of measurement values already recorded (see below).

A sensor test is always performed prior to recording. Exception: the start condition is set to 'Immediately'.

Left:
Measurement value recording
Display of the recording configuration
and overall value overview (optional)

Right:
Overall value overview
Configuration

Maximum number of values: 9
(here: 8 values are displayed)

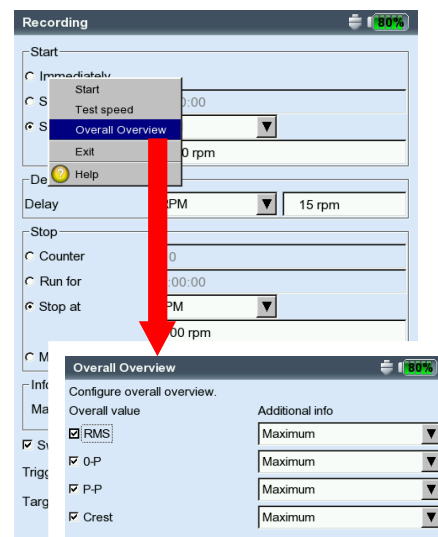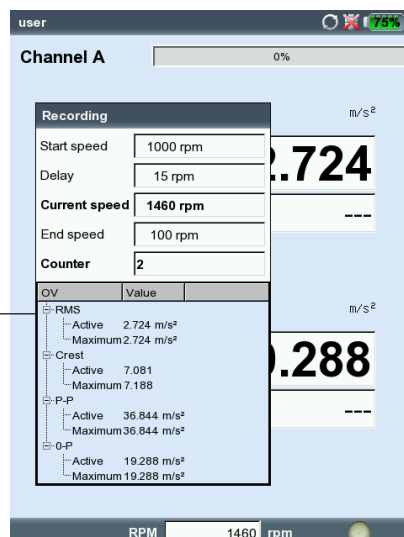

Ending the measurement recording

The measurement recording is ended when

- the stop condition is fulfilled
- the ESC button is pressed
- the memory card is full
- the maximum number of results is reached (65535).

Special cases

The recording function is used in a wide range of applications and is intuitive in use. However, the following special characteristics should be noted:

What happens if the device shuts down due to a fault?

If the battery should run out during measurement, the device saves the measurement data prior to the emergency shut-off. If a fault arises during measurement, the saved results are retained.

Shock pulse measurement

Before beginning recording, enter the normalization parameters. This normalization then applies to the entire measurement duration. Note: rpm-controlled recording is only possible without normalization.

Trending spectrum

 
To be able to record the measurement values in a trending spectrum, the recording function is also available in the 'Machine template' mode. Recording is configured and started as described in the previous section.

Special characteristics:

- The trending spectrum is integrated in a machine template (OMNI-TREND software).
- In addition to the trending spectrum, the machine template can contain all measurement types permissible for the recording.
- Recording is only possible in the template without a 'Production test' (see also p. 3-14).
- After the recording, all actions that are triggered automatically are disabled in the template (e.g. starting the next task).
- The recording configuration is not saved with the result.
- Multiple datasets can be added to a file.

Time waveform recorder

* Dep. on the sample rate and memory capacity; a 2 GB memory card and a sample rate of 512 Hz can record approx. 132 hours.



Time waveform recorder

The time waveform recorder can be used to record time waveforms over very long* times. In contrast, the maximum recording length for time waveforms using the recording function is approx. 640 seconds (at a 512 Hz scan rate).

The time waveform recorder can be found in 'Multimode' on the 'Advanced' tab.

- Check the measurement settings in the measurement task manager, especially the settings for the measurement time and scan rate.
- To start the recording, click on the icon shown on the right.
- Then enter the file name under which the result is to be saved.
- Signal recording then begins.

The measurement screen only shows the entire measurement time and when the measurement will be ended. The recording can be stopped at any time using the ESC button. You can save the measurement data that have already been recorded. If the battery runs out during recording, the device automatically saves the data.



Note

The data can be read into OMNITREND via Multimode import and then analyzed. Alternatively, they can be read out of the device using the 'VIBXPRT utility' service program and imported into a separate analysis software.


Evaluation on device

After the data have been recorded, you can choose to display the signal over one or multiple shaft rotations.

- Press the MENU key and click on 'Postprocessing / Timesynchronous average'.
- Enter the shaft rotational speed (see also p. 4-7).

Left:
Recorded time waveform
in circular plot and cartesian plot

Right:
Screen during recording

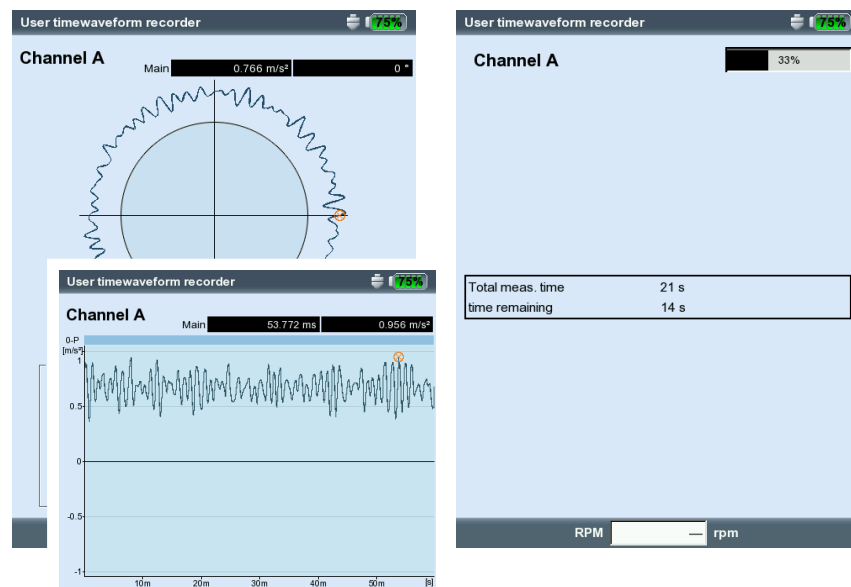

Data acquisition at the VIBRONET multiplexer

For automatic data acquisition at many measurement locations of the same type or hard-to-access measurement locations, VIBXPERT and OMNITREND feature the function 'Multiplexer measurement'. The respective measurement tasks are processed within a route or as a machine template.

The measurement locations are combined by the VIBRONET field multiplexer (VIB 8.306) on one string line and are measured consecutively.



Only vibration measurements with Current Linedrive accelerometers are possible.

Up to 6 multiplexers with a maximum of 54 measurement locations are possible on one string line.

To connect VIBXPERT to a multiplexer you need the following:

- Connecting cable, VIB 5.346
- BNC connecting adapter, VIB 5.346 MUX

For RPM-dependent measurements (e.g. phase), you have to install the sensor (VIB 6.631) at a suitable measurement location. RPM measurements via multiplexers are not possible.



Note

Connecting the VIBXPERT to the multiplexer

Install the BNC connecting adapter (VIB 5.346-MUX) on the 1st multiplexer in the string line as follows:

- Open the cover of the multiplexer.




Note


Do not touch strip conductors and components on the PCB! Electrostatic charges can damage or destroy them. Preferably you should use an ESD wrist strap.

- Loosen the screwed cable gland at the input (Stringline) and insert the BNC connecting adapter into the multiplexer as far as it will go.
- Connect the open end of the BNC connecting adapter to the 'MASTERline' terminal.
- Tighten the screwed cable gland on the multiplexer and close the cover.
- Connect the VIBXPERT to the multiplexer, using the connecting cable (VIB 5.346).
- After the measurement, attach the protective cap to the BNC jack.

1. Multiplexer

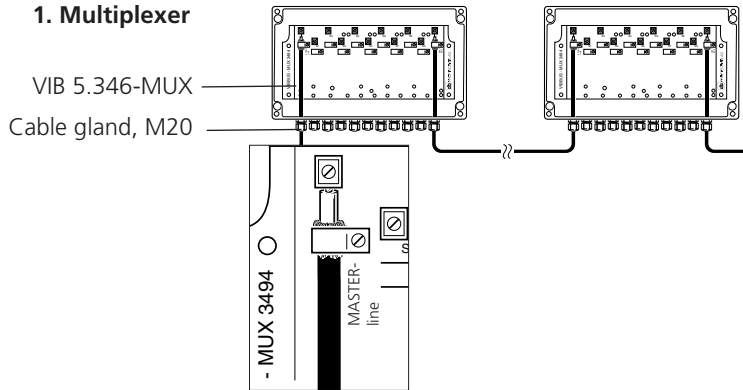

BNC adapter (VIB 5.346-MUX) installed

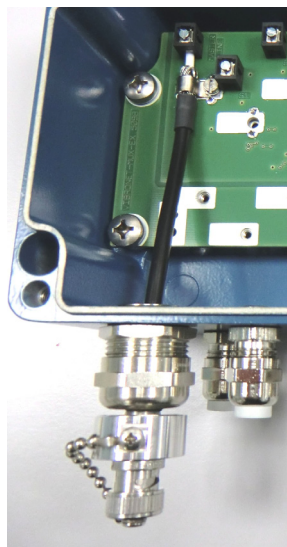


Clamping range cable gland

Protective cap

Automatic data acquisition

- Connect the VIBXPRT to the multiplexer (see previous section).
- Connect an RPM sensor to the VIBXPRT, if necessary.
- In the route setup (measurement), select the option 'Autostart MUX' (see p 2-16).
- Open the route* with the multiplexer measurement locations.
- Click the first measurement location on the first multiplexer in the string line. Note the label of the measurement locations:
- VIBXPRT starts the first measurement task at the first measure-

* for machine templates, the procedure on page 3-13 applies accordingly.

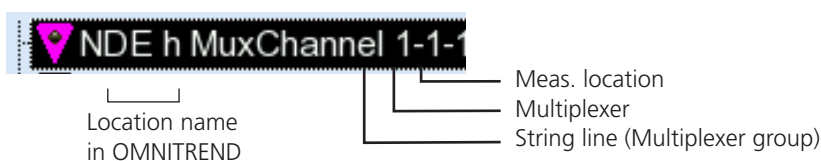

ment location and saves the result. This procedure continues automatically until the last measurement task in the string line. If a measurement task is already completed, the procedure stops there. You can conduct the respective measurement again or skip it in order to continue the data acquisition.

Manual data acquisition



- In the route setup (measurement), deactivate the option 'Autostart MUX'.

The measurement locations can be processed in any order. Start the measurements at each measurement location by pressing the button. The remainder of the procedure is the same as for automatic data acquisition.

If the connection to the multiplexer is accidentally interrupted during the measurement or between measurements, click 'Reset MUX' in the menu so that VIBXPRT can again correctly address the measurement locations.



Note

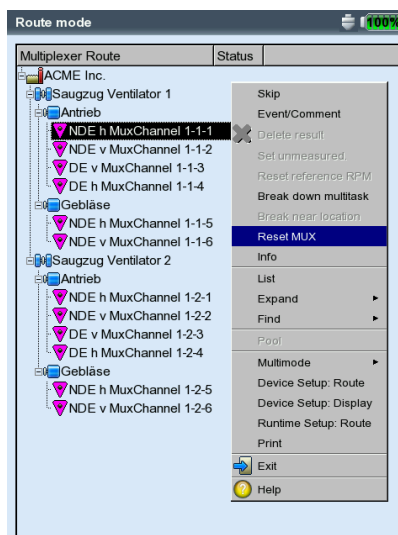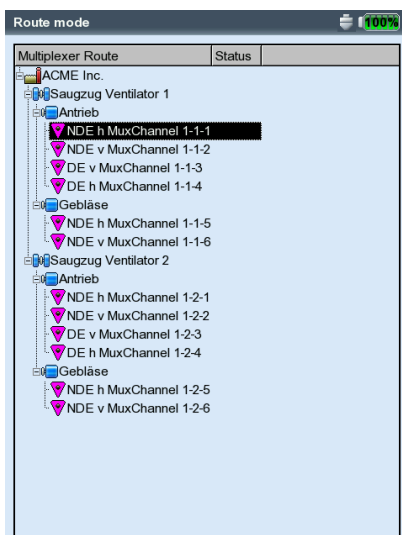

Left:
Route contains measurement locations on two multiplexers

Right:
Reset multiplexer

Diagnostic measurement at VIBRONET multiplexer

For machinery fault diagnosis you can conduct the following measurement tasks at a multiplexer measurement location:



- Vibration-based measurement types in Multimode
- Only with 'Current Linedrive' acceleration sensor
- 1- or 2-channel

2-channel measurement tasks, such as Orbit, are possible only with two string lines, since only one line is connected and can be processed for each measuring channel.

For RPM-dependent measurements, such as order spectrum or phase, use a suitable sensor (e.g. VIB 6.631), which you connect to the VIBXPERT RPM channel.

To connect VIBXPERT to a multiplexer you need the following:



- Connecting cable, VIB 5.346
- BNC connecting adapter, VIB 5.346 MUX

Diagnostic measurement

- Connect the VIBXPERT to the multiplexer (see p. 3-42).
- Connect an RPM sensor to the VIBXPERT, if necessary.
- In the startup screen, click 'Multimode' and mark the corresponding measurement task icon.
- Press the MENU button and click 'Execute on MUX'.
- Configure the measurement location address:
 - MUX ID = Number of the multiplexer in the line section
 - MUX Input = Number of the measuring channel on the multiplexer
- To start the measurement, click 'Measure'.

Left:
Start multiplexer measurement

Right:
Enter location ID

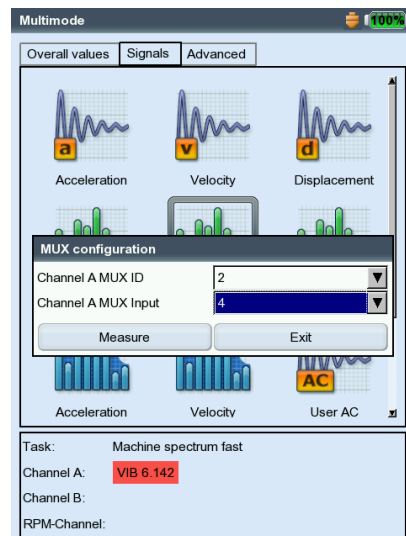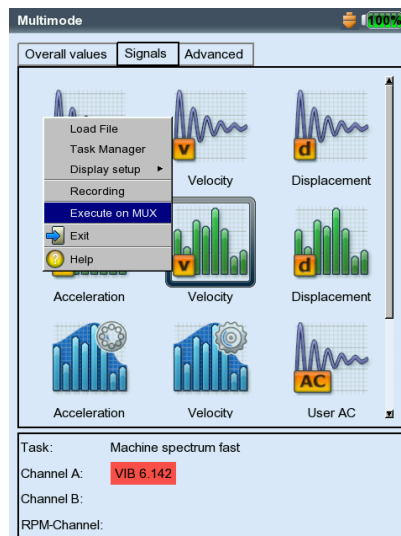

Chapter 4: Results

After each measurement, it is possible to save the results and to evaluate them on the device. Numerous functions that can be called up with the MENU key in the results screen are available for this purpose (see below).



Multimode

Results from the 'Multimode' operating mode can be found in the 'Results' directory in the File Manager (P 6-3).

Route/template


Results of a route or a machine template are usually stored automatically (p. 2-18) to speed up the data recording. The results only then remain in the display if ...

- ... the menu is opened within the selected waiting time,
- ... the 'AutoSave' option is deactivated,
- ... a stored result is opened.
- ... the measurement has exceeded a threshold value.

To open a result of a route / template measurement, proceed as follows:

- Open the route / template.
- Select the relevant measurement task.
- Press the MENU key and click on 'Display Result'.

The following sections show the options that your VIBXPRT provides for evaluating the results on the device.

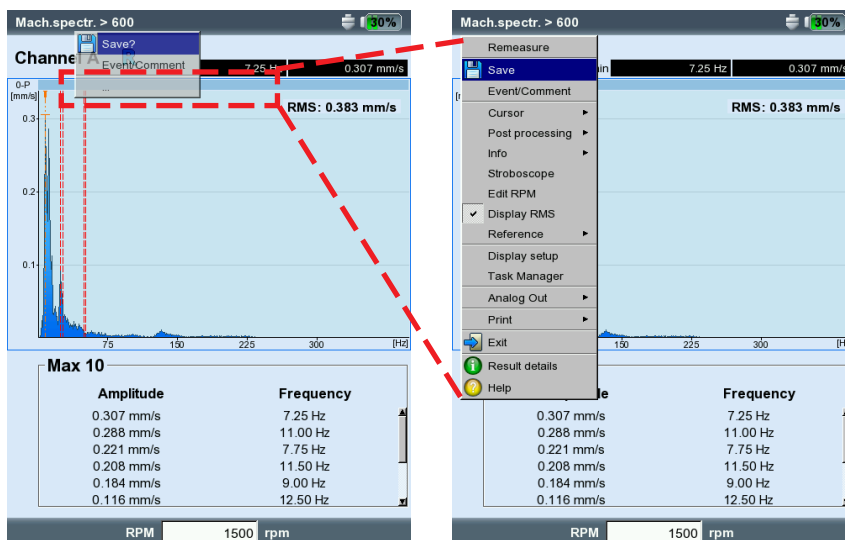

Results screen in the route
with concealed menu.
Click on '...' to open the full menu.

Evaluating results

Before a result is evaluated, make sure that the measurement is valid and no error message is present (see page 2-2).

Result details

The following information can be displayed:

- Measurement Task, Measurement Channel, Measurement Range,
 - Sensor Type, Date/Time, Status
 - Statistical Data (for overall values only)
- Press MENU and click on 'Result Details'.

Characteristic overall value - single values

Up to two overall values are simultaneously displayed in the result screen. The RPM appears in the lower area. If the threshold values are exceeded during the measurement, these appear in the field below the respective measurement value (see below). Also, the respective LED lights up next to the display (see pages 2-2). Thresholds can be displayed as an absolute value or as a difference to the measurement value.



For vibration parameters with more than two overall values*, press the navigation key up / down to display the other values (see 'Display Setup', page 4-17).

* e.g.: Vibration parameters with 6 overall values:


1. rms value
2. 0-p value
3. p-p value
4. 0-p calculated ($= \text{RMS} \times \sqrt{2}$)
5. p-p calculated ($= 0\text{-p} \times 2$)
6. Crest factor (s. P. 5-1)

Left:
Result screen for overall value

Right:
Resultdetails

RMS value
(no threshold value exceeded)

0-P value
(alarm exceeded by 1.387 mm/s)

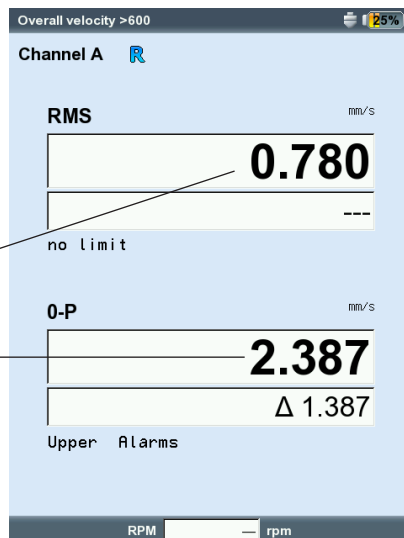

Result details	
Details	Values
Job	Velocity
Channel	A
Used range	75.000 m/s²
Date/Time	11.05.2010 16:50:51
Status	Alarm
Statistic	
RMS	
MEAS	0.780
MIN	0.000
MAX	0.000
Standard deviation	0.000
0-P	
MEAS	2.387
MIN	0.000
MAX	0.000
Standard deviation	0.000
P-P	
MEAS	4.360
MIN	0.000
MAX	0.000
Standard deviation	0.000
Crest	
MEAS	3.060
MIN	0.000
MAX	0.000
Standard deviation	0.000

Characteristic overall values - trending

If more than two measurements are saved in a file, the results for each overall value are displayed as a trend curve (see p. 3-28f).

Markers on the trend curve indicate each individual measurement. The measurement values at the cursor position, the date, the rpm if applicable, and assigned events and comments are specified below the diagram. Use the F key to display the individual results.

With the aid of the displayed threshold line (see p. 3-25), it is possible to determine if thresholds have been exceeded. If more than one overall value appears in the diagram, only the threshold for the highlighted value is displayed (in the below screen: upper alarm for RMS value). Press the navigation key up / down to mark the other overall values and display the respective threshold values.



Zoom

Press the '+' button repeatedly to magnify the area around the cursor. This process can be undone again with the 'Minus(-)' key.




The bars above a diagram show the displayed range relative to the entire display range.

Deleting individual measurements

If a spurious measurement has been included in the trend, delete this as follows:

- Highlight the measurement in the trend with the cursor.
- Press the MENU button.
- Click on 'Delete'.

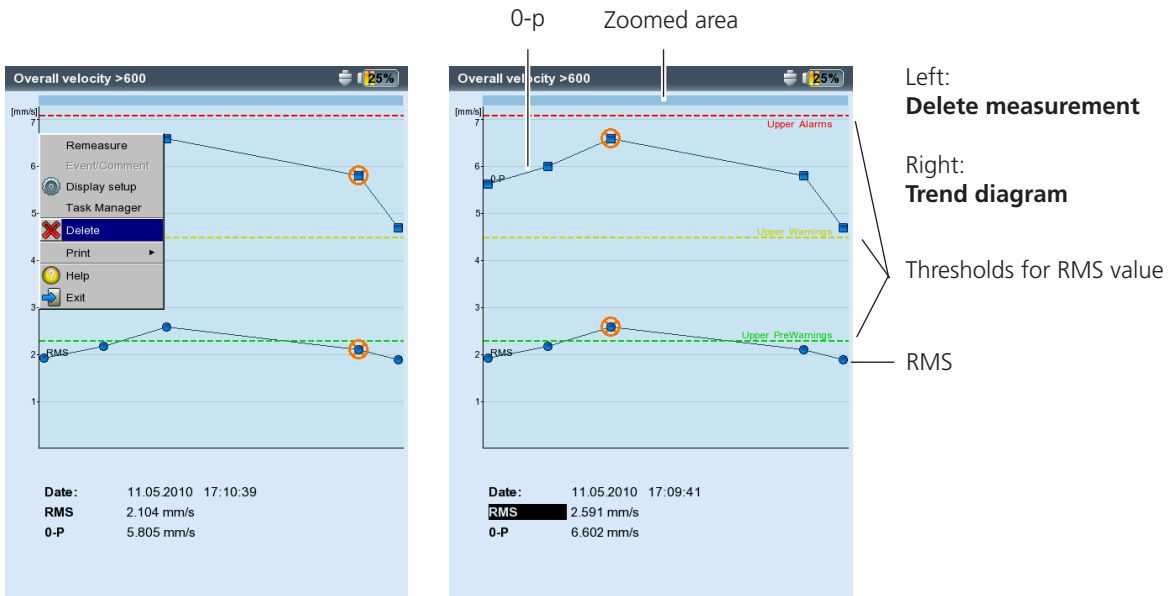



Time waveform

The measurement results are displayed as an XY diagram in the top section of the window (see the standard setting). The data field in the lower half lists the two highest amplitudes (positive & negative). If a threshold value is exceeded, the absolute value and the difference to the measurement value is displayed ('delta', see below).

The following functions are available for evaluation of the result:



Zoom the time (X) axis

- Press the '+' key to magnify the X axis. Depending on the zoom mode (page 4-18), the main cursor is used as the central point or the gap between the main and delta cursor is magnified. The '-' key is used to zoom out.



Scaling the amplitude (Y axis)

- Press the navigation key up to magnify the scaling of the Y axis and to make low amplitudes visible.
- To reduce the scaling again, press the navigation key down.

Rotational speed marker

The yellow rotational speed markers indicate the trigger pulses during signal measurement. In the circular plot, the speed markers also indicate the direction of rotation (see the next page).

Cursor

The cursor coordinates are displayed above the diagram.

- Press the MENU key and click on 'Cursor'.


NONE: Hide all cursors (Zoom / scaling not possible!)

MAIN: Show main cursor

Press the navigation keys right/left to move the cursor. The speed increases if you keep the navigation key pressed.



Result screen of a time waveform measurement

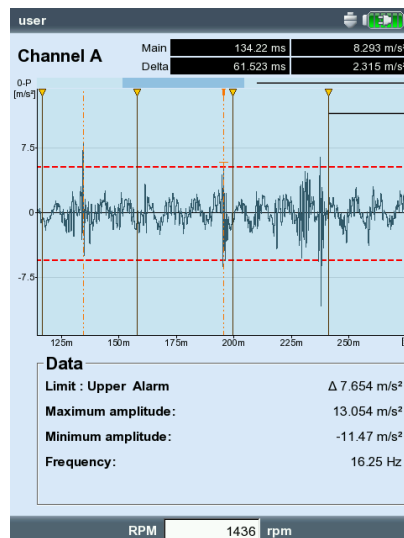

Cursor coordinates
Zoomed area
Speed marker
Threshold

DELTA: Show/hide delta cursor

Press 'Enter' to switch over between main and delta cursor. In this case the measurement can only be repeated via the MENU key (MENU - 'Remeasure')! The cursor coordinates indicate the distance to the main cursor. The data field specifies the frequency which corresponds to the distance between the main and delta cursor (see below).

SIDEBANDS: Show/hide sideband cursor

Select the number of sidebands. The spacing of the sidebands is set by moving the outer cursor*. The position of the entire group can be changed by moving the middle (main) cursor.

* press 'Enter' to switch between the main and the outer cursor.

Cartesian / circular plot

By default, the time waveform is displayed in a Cartesian plot (XY diagram). However, you can change the display to a circular plot. This is useful when the gear mesh in a gear stage is to be emphasized, for example. In this type of display, the measured time interval is projected on a circle, so that the start and end times are directly adjacent to one another. If the shaft rotates by 360° within the measured time interval, the circular diagram shows the signal for one complete rotation of the shaft.

- Press the F key to toggle the two diagram types (see below).



F

Signal post processing**Calculating the characteristic overall values from the signal**

The following overall values can be calculated:

- Maximum / minimum amplitude,
- Arithmetic mean, p-p value, RMS value, Crest factor.

- Press the MENU key in the result screen.
- Select 'Postprocessing' and click on 'Compute overall values'.

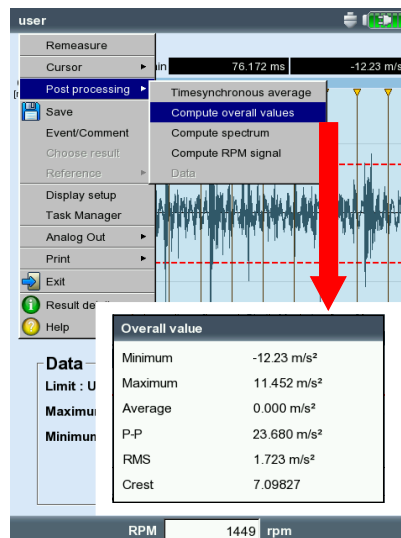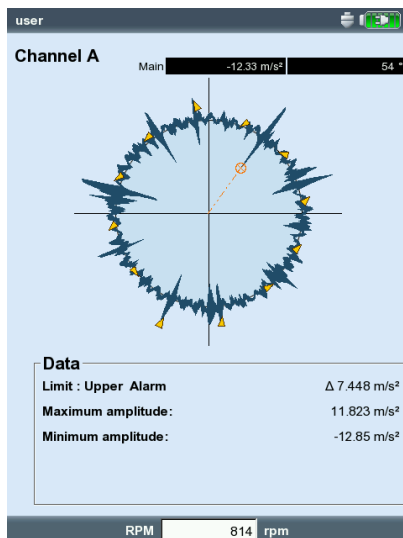

Left:
Time signal in circular plot

Right:
Signal postprocessing

Calculating the spectrum

Based on the time waveform, you can calculate a spectrum that you can save and measure again.

- Press the MENU key in the result screen.
 - Select 'Postprocessing' and click on 'Compute spectrum'.
 - Set the parameters in the lower window pane (see below):
- Input signal
ENTIRE SIGNAL: the entire signal is used to calculate the spectrum.
VISIBLE SIGNAL: the spectrum is based only on the visible signal.
Zoom the display if required*.
 - MAIN TO DELTA: Move the cursor to set the interval.
START AT MAIN: only the signal from the main cursor is being used.
 - Averaging mode: Single shot / Averaging
 - Window type: Select the appropriate window type (P. 3-24).
- Press the MENU key and click on OK.

F

* Press the F key to switch between the upper and the lower window pane.

The calculated spectrum can be saved and measured again. A transformation is only possible in the Cartesian display.



Displaying the rpm run

If the rpm is recorded alongside the time waveform, you can display the rpm run as follows:

- Press the MENU button in the result screen.
 - Select 'Postprocessing' and click on 'Compute rpm signal'.
- The rpm run appears in the lower window pane.

Left:
Calculating the spectrum
from the time waveform

Right:
RPM run during
signal measurement

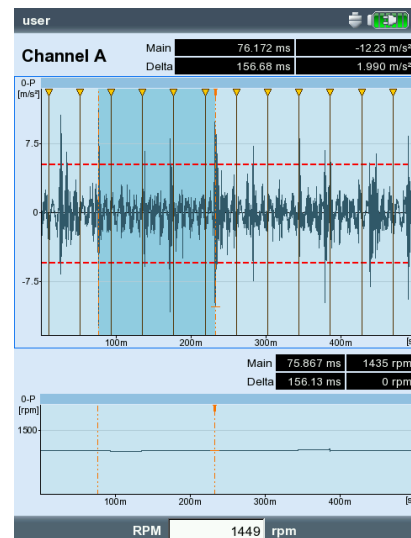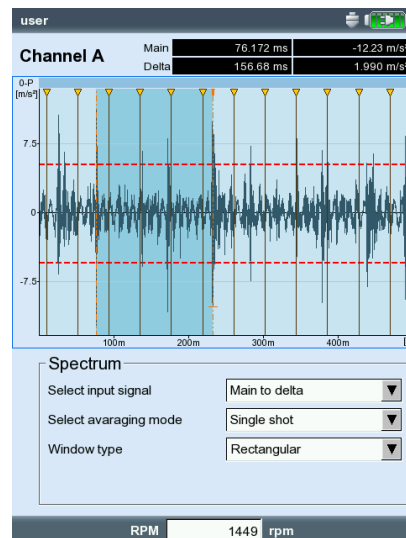

Time-synchronous average (Postprocessing)

If a trigger signal is recorded in addition to the time waveform, further information can be obtained.


For example, the time waveform can be determined synchronously with every rotation of the shaft. In this way, events in the signal that are synchronous with the RPM are emphasized and stochastic results are suppressed.

If the measurement locations are on a gearbox, the time waveform can be determined for one rotation using the transmission ratio of the gearbox.

- Press the MENU key.
- Select 'Postprocessing' and click on 'Timesynchronous average':
- If you measured the RPM simultaneously with a trigger sensor, activate the 'Use trigger mark' option and enter the number of 'Revolutions' per trigger pulse. Using the 'Start at trigger' option, you can synchronize the time signal using the trigger pulse.
- If there is no trigger signal, you can simulate it by using a manually entered RPM value ('Custom revolution'). In this case, the trigger options described above are deactivated. The RPM value (in Hz) corresponds to a block length in the time signal described by the relationship $f = 1/t$.
- In the 'Revolutions' field, you can compensate for any differences in RPM between the trigger measurement location and the signal measurement location (e.g. the translation ratio in the gearbox).

Close Postprocessing

- Press the MENU button in the result screen.
- Select 'Postprocessing' and click on 'Data'.

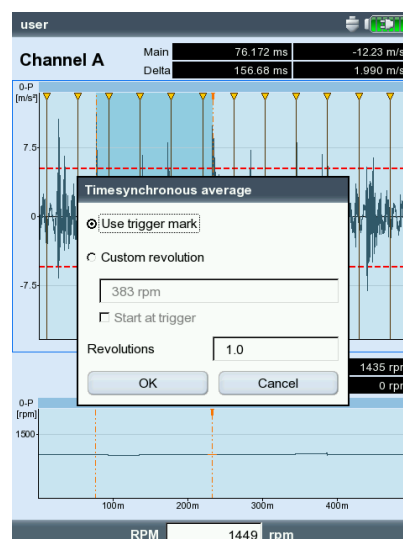


Time-synchronous average: Configuration

Results



Amplitude, Envelope, Order

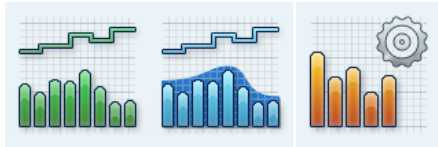

Trending, Trending envelope, Cepstrum

In-depth information is given in the section 'Measurement Tasks' (Ch. 5).

Spectrum, Cepstrum

The measurement result is displayed in the upper pane. The measured time waveform is displayed in the lower pane during the measurement. After the measurement, the following information can be displayed:

- Max 10 (10 highest amplitudes in the spectrum)
- Alarms
- Frequency marker (only in Route / Template mode)
- Trending values (only in TrendingSpectrum)
- Trending bars (only in TrendingSpectrum)
- Time waveform measured
- Position of the main cursor

- Press the MENU key and select the 'Info' option.
- Click on the desired piece of information:



Note



The data to be displayed by default after the measurement is set in the display setup (see p. 4-18).

The active window pane is highlighted by a frame. Press the F key to switch to the other window pane.



Info / Max 10

Lists the 10 highest amplitudes in the spectrum. Click on an entry to set the cursor to the corresponding line of the spectrum. You can sort the list for amplitude or frequency in ascending or descending sequence. To do so, click on the respective column title.

Left:
Spectrum & time waveform

Right:
Additional information

Upper window pane is active

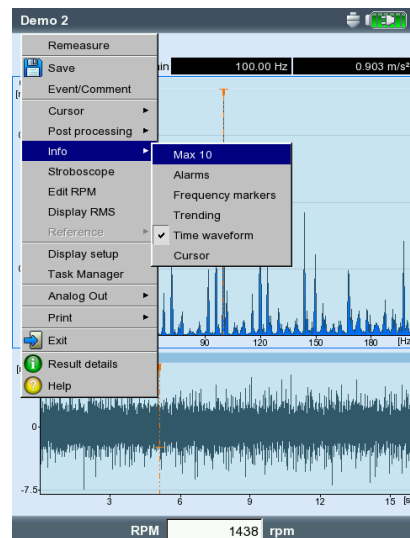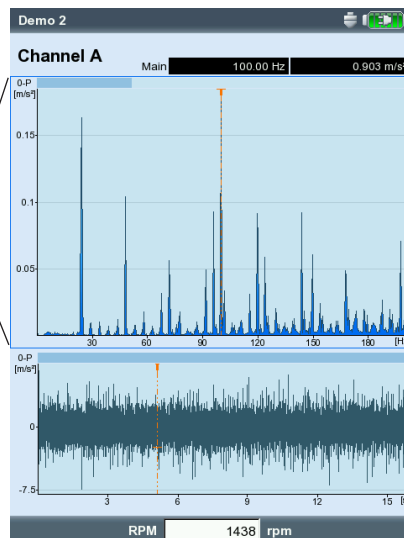


Info / Alarms

This function checks if a threshold value was exceeded. If so, one of the LEDs lights up.

To display the thresholds in the spectrum,...


- Press the F key to activate the lower window pane.
- Select the corresponding check box in the tree view.

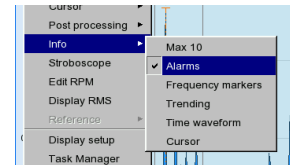

Info / Frequency marker

Frequency markers can be used to more easily identify the characteristic machine and component frequencies in a spectrum. Frequency markers are defined for each machine hierarchy level* in the OMNI-TREND software and loaded into VIBXPRT with a route / template.

- Press the F key to activate the lower window pane.
- To display the frequency markers of each single hierarchy level, press the MENU key and select from the list (see below). Frequency markers from lower hierarchies are added to higher hierarchies (meas. loc. -> machine -> machine train).
- Activate the corresponding check box in the tree view.

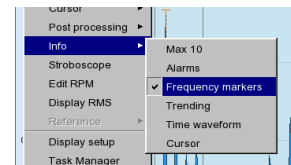

Machine hierarchy =
Train, Machine, Meas. location



For RPM-dependent frequency markers (e.g. Imbalance -1st harmonic), the machine RPM must be known - either by manual entry or by measurement.




Left:
Narrowband thresholds
(‘Band alarms’)

Right:
Frequency marker

VIBXPRT II 05.2012

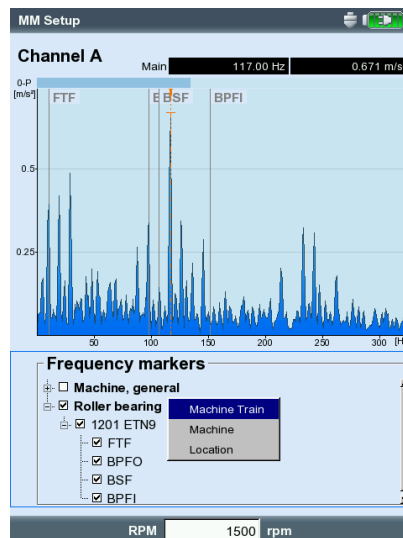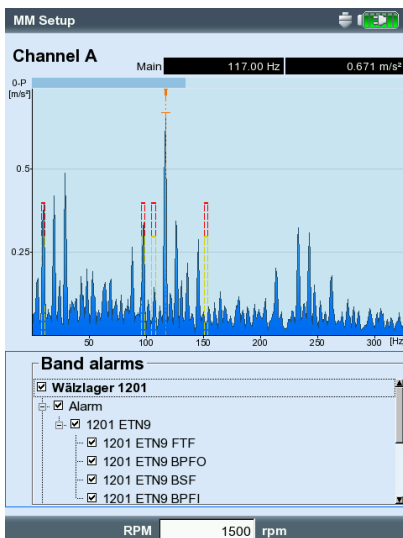

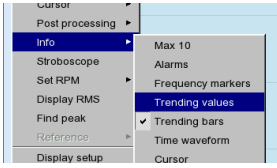

Info / Trending values (in the TrendingSpectrum only)

A TrendingSpectrum contains, in addition to the time waveform and the corresponding spectrum, up to 30 characteristic overall values. The overall values are formed using frequency bands that are set up in the OMNITREND PC software.

The following trending parameters are provided in the lower pane:


- Name and current trending value,
- Limits of the frequency band ('Start' / 'End'),
- Measurement type (e.g. 'True 0-peak'),
- Measurement quantity (e.g. 'Velocity') and, threshold values.

Comparing trending values with reference values:

- Activate the lower window pane using the F key.
- Press the MENU key and click on 'Compare with reference'.
A table appears that contains the trending values, the current measurement values and - if set up - the reference values.

Comparing trending values with historical values:

- In the lower window pane press the MENU key and click on 'History'. A diagram appears in which the historical and current measurement values are visible as a trend.

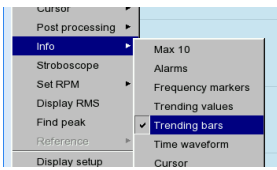

Info / Trending bars (in the Trending Spectrum only)

The bar display in the Trending Spectrum visualizes the position of the configured thresholds for the current reading (see next page).


Info / Time waveform

The signal can be shown in the lower pane for test purposes (see P. 4-8). The Zoom function is available for signal evaluation (see P. 4-4).


Info / Cursor

Enable the 'Cursor' option when working with the harmonic/subharmonic cursor or with the sideband cursor.

Left:
TrendingSpectrum
(Trending values are given in the lower window pane)

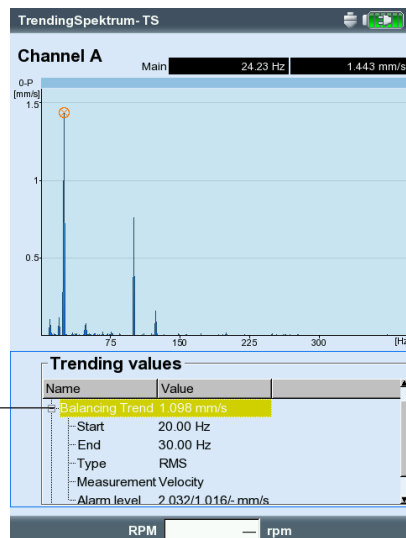

Right:
Comparing trending values
with Reference / Historic data

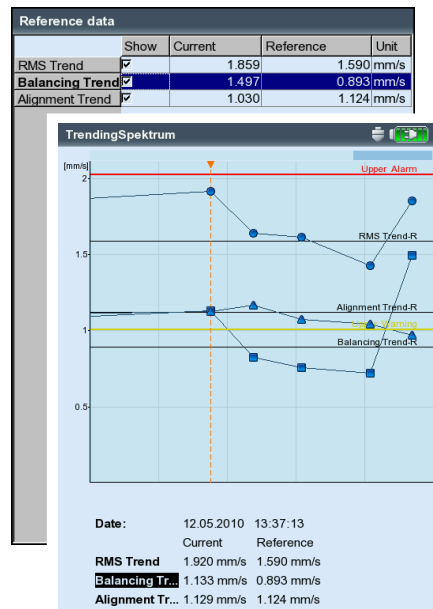

Trending value

The following functions can be called up directly in the MENU:

Stroboscope

Enable this feature if you want to control a strobe light with the frequency at the main cursor position. Move the cursor in the spectrum, to change the flash rate.

You can use a strobe light to visually slow the movement of an object, making it easier to analyze, check for proper procedures and find undesirable vibration sources. By visually ‘freezing’ the movement, you can precisely determine the rpm or the alternating frequency.



Note

To connect the strobe light to the yellow port, use the adapter available as an accessory (VIB 5.333).

Set RPM

After a measurement, you can either enter the machine RPM directly or read it in via the marked frequency in the spectrum. Press the MENU button, click ‘Set RPM’ and select the desired option.

Display RMS

Calculate the RMS value of the spectrum (see below).



Post processing

Each spectrum is initially calculated from the measured quantity*. Post-processing alters the measurement quantity in the spectrum (e.g. velocity into displacement). The ‘Alarms’ diagnosis function is only available if the spectrum is displayed in the original measurement quantity.

* velocity, displacement

Find peak

Calculation of the ‘probable’ frequency at the cursor position in case of a spectrum with insufficient resolution.

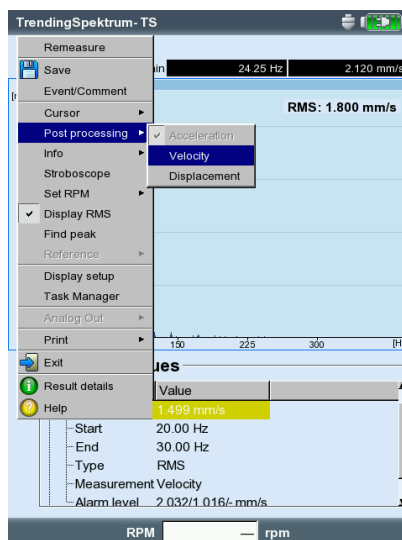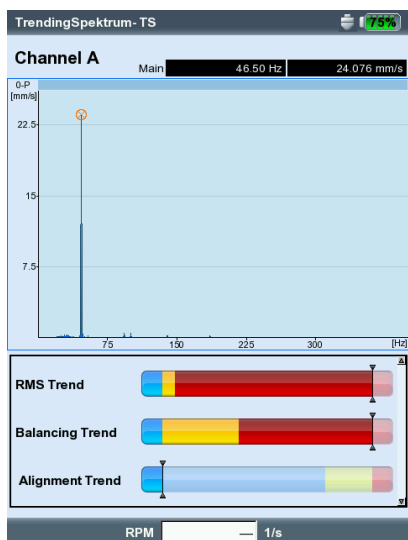

RMS value

Left: **Trending bars** (TrendingSpectrum)

Right: **Post processing** (select meas. quantity)

Reference (only in the route / machine template mode)

Here you can compare the current spectrum with a reference spectrum or a historical spectrum. The spectra are displayed in a 'water-fall' diagram (see also p. 4-13).

Zoom / Scaling See 'Time waveform', page 4-4.

Cursor

- Press the MENU key and click on 'Cursor' (see below)

NONE /MAIN / DELTA: See 'Time waveform', page 4-5.

HARMONICS: Show/hide harmonic cursor

The harmonic cursor is used to assign harmonics in the spectrum. The spacing of the individual cursors to one another corresponds to the basic frequency at the main cursor. To adjust this, the main or the delta cursor (highest displayed order) can be moved.

- Adjust the required number of the cursor.

SUBHARMONICS: Show/hide subharmonic cursor

The subharmonic cursor can be used to detect subharmonics in the spectrum. The spacing of the individual cursors to one another corresponds to a integer fraction (1/n) of the main cursor.

- Adjust the required number of the cursor.



Note

If the subharmonic cursor is activated, the delta cursor is not active.



SIDEBANDS: Show/hide sideband cursor

The sideband cursor can be used to identify modulations of a carrier frequency. The distance of the sidebands can be set by moving the outer cursor (press 'Enter' to change over, P. 4-5). Change the carrier frequency by moving the main cursor.

- Adjust the required number of the cursor.

Left:
Spectrum, Cursor menu


Right:
Spectrum, Harmonic cursor

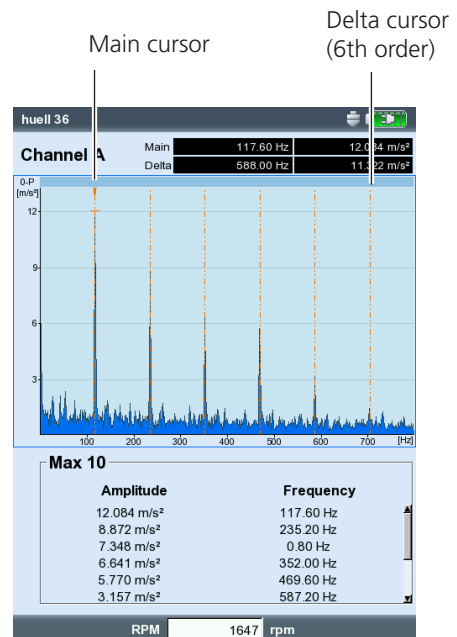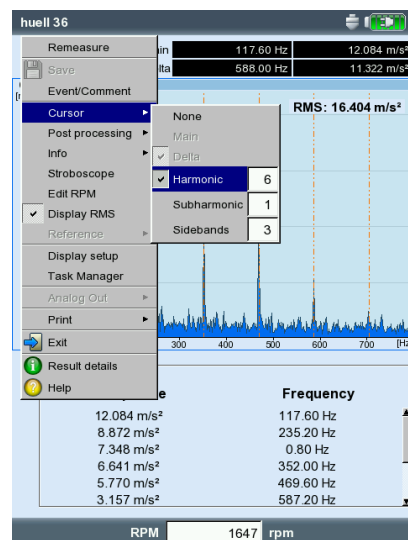


3D display of spectra: Waterfall diagram

If several spectra were recorded for one measurement task (max. 75), these appear in a 3-dimensional diagram - the waterfall diagram.

Navigation

 Navigate through the individual spectra.


 Move the cursor along the frequency axis.

Change view

To rotate the waterfall diagram change the display mode:

- Press the MENU key and click on 'Resize display field'. Use the navigation keys to do the following:

 tilt the diagram around the frequency axis.

 rotate the diagram around the amplitude axis.

This display mode is indicated by the icon shown right.





Cursor


Only the main and delta cursors are available for evaluation in the 3-D view. To activate the delta cursor, press the MENU key and click on 'Cursor > Delta' (see P. 4-5).


Zoom

The Zoom function can be used in the Waterfall diagram along the frequency axis (=X) as well as along the Z-axis. The amplitude axis (=Y) cannot be scaled in the 3-D view.

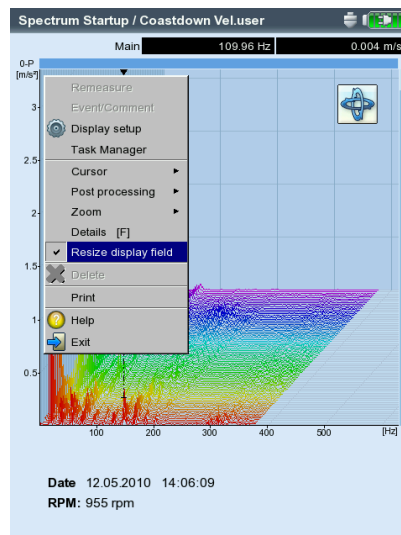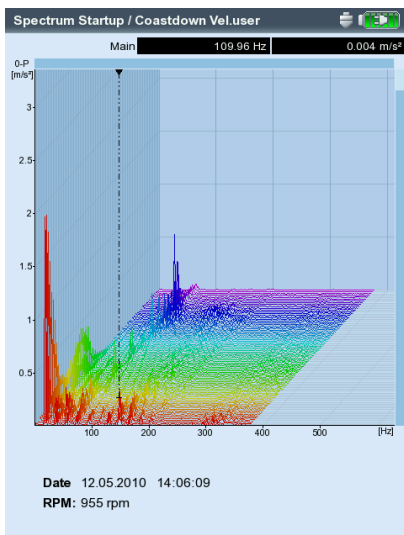

Left:
Waterfall diagram

Right:
Rotate / Tilt diagram:
Use the navigation keys in the  node

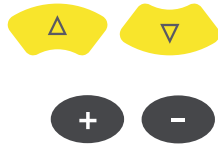

Which of the two axes (X or Z) can be zoomed is displayed by a flashing bar along the edge.

- If the right bar flashes, the Z-axis can be zoomed with the navigation keys.
- If the upper bar flashes, the X-axis can be zoomed with the + / - key.


To change the active axis, press the MENU key and click on 'Zoom > X-axis' or 'Zoom > Z-axis'.

Evaluating individual spectra (2D view)

For the evaluation of an individual spectrum, proceed as follows:

- Highlight the relevant spectrum with the cursor.
 - Press the F key to display the individual spectrum.
Alternative: Press the MENU key and click on 'Details'.
 - Call up the respective diagnosis functions with the MENU key.
- To return to the 3D view again, press the ESC key.

Zoom
Zoom in on the frequency (X) axis when the upper bar flashes

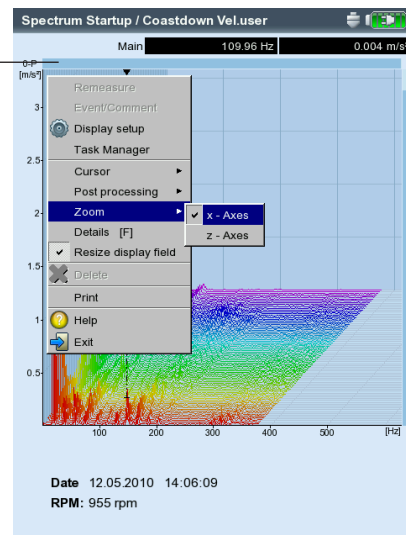

Sound spectrum: third-octave and octave level diagram

VIBXPRT makes the sound spectrum available for the display and evaluation of acoustic signals. The signal picked up by the microphone is broken down in the frequency domain into bands with a constant relative band width (octave bands or third-octave bands). To quantify the volume, VIBXPRT specifies the sound pressure level of each band as well as the overall sound level. Depending on the overall level, four evaluation filters (A, B, C, D) can be set to take into account the human perception of volume. Since the sound pressure level is a logarithmic quantity, a reference value is needed to calculate it. This value must be entered as well.

The sound spectrum can only be selected for amplitude spectra with the vibration acceleration, vibration velocity and vibration displacement quantities, as well as for user-defined quantities. Envelope spectra, order spectra and order-based spectra cannot be converted into sound spectra.





Note

Displaying the sound spectrum

To display an amplitude spectrum as a sound spectrum, proceed as follows:

- Open the Display Setup for the underlying amplitude spectrum:
 - In the Multimode selection screen:*
 - Mark the measurement quantity for the amplitude spectrum.
 - Press the MENU button and click on 'Display Setup/Measurement'.
 - In the measurement screen:*
 - Press the MENU button and click on 'Display Setup'.
- Select 'Third-octave bar' or 'Octave bar' for the graph type.
- Set the 'reference value' needed to calculate the sound pressure level (for example, for airborne sound $p_0 = 20 \mu\text{Pa} = 2 \times 10^{-5} \text{ Pa}$).

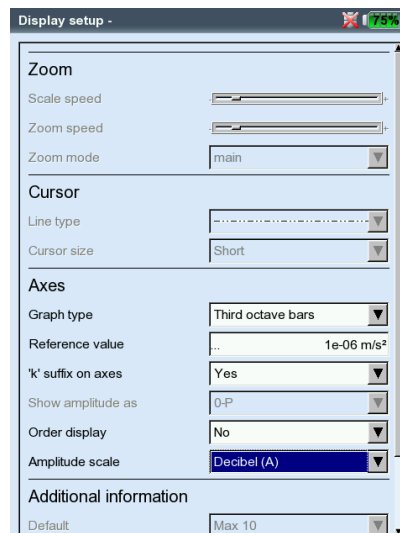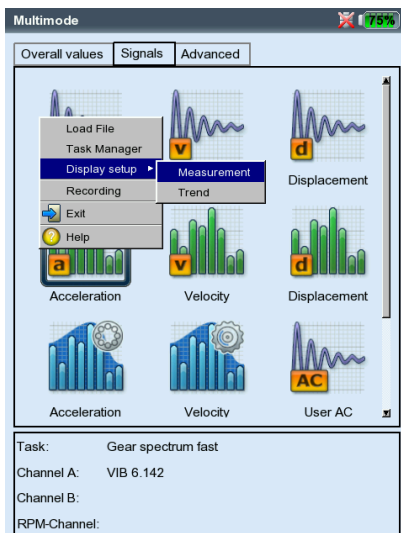

Left:
Open Display Setup (Multimode)

Right:
Sound spectrum settings
Graph type, reference value, amplitude scale

**Note**


The reference value unit corresponds to the measurement quantity set in the spectrum. The unit can only be changed for user-defined quantities.

- Set a suitable evaluation filter (decibels (A), (B), (C) or (D)). If you do not wish to evaluate the sound pressure level with a filter, set 'decibel'.
- Then press the MENU button and click on 'Save'.

The individual frequency bands (third-octaves, octaves) appear in the sound spectrum, as does the overall sound level in a logarithmic scale. The lower Info field specifies the sound pressure levels of the individual bands. The cursor and zoom functions are not available in this display.

Sound spectrum

Evaluated sound pressure level in dB (A)

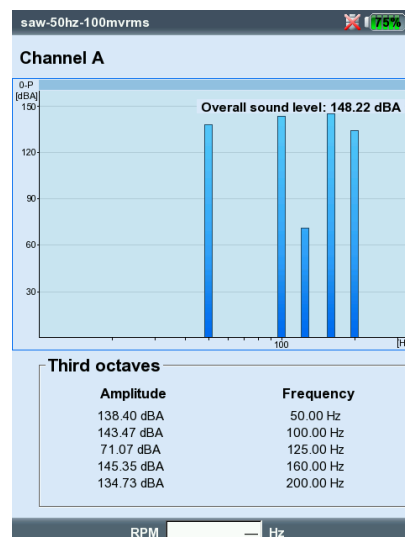

Configuring the result display (Display Setup)

In the Results display, after a measurement:

- Press the MENU key and click on 'Display Setup'.

In the selection field of the measurement tasks (Multimode):

- Highlight the measurement task symbol.
- Press the MENU key and highlight the 'Display Setup' entry.
- Press the navigation key right and click on 'Measurement' or 'Trend' respectively (s. below).

X. Continuous measurement ('live mode')

In 'Live mode', you can check the signal quality before beginning with data collection (see p. 3-4).

A1. Display Setup for measurement: Overall values

DISPLAY LIMIT AS...: The limit values can be displayed as an absolute value or as a difference ('Delta value') to the measurement value.

DISPLAY OVERALL PEAK VALUE: Select the characteristic vibration value that is to be displayed by default with the 'RMS value'. After the measurement, press the navigation key up repeatedly to display the overall values of the series that were not displayed. If the threshold value is exceeded, the RMS values and the overall value that exceeded the threshold value by the largest amount are displayed.

A2. Display-Setup for Trend: Overall values

MEAS. VALUE: Selection of *overall values*. The *line type* can be selected and the *labeling* can be shown for each trend curve.

SHOW...: *Limits, event markers, references* and the associated *labeling* can be displayed in the chart. The *line type* can be selected.




ZOOM: Speed or step size when zooming

LAYOUT: The values on the trend curve can be identified with *markers*.

A *grid* can be displayed for easier evaluation of the data and the cursor can be displayed as a cross (*short*) or line cursor (*long*).

Display Setup

for overall values with more than two quantities.

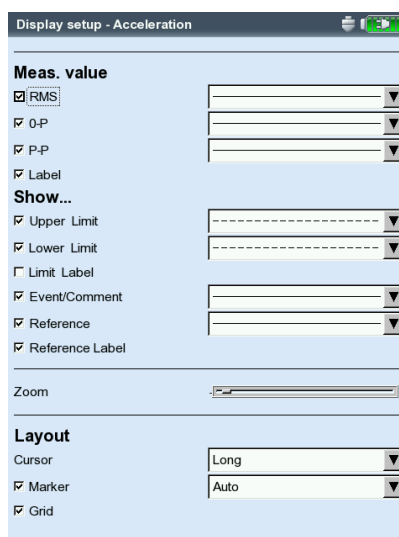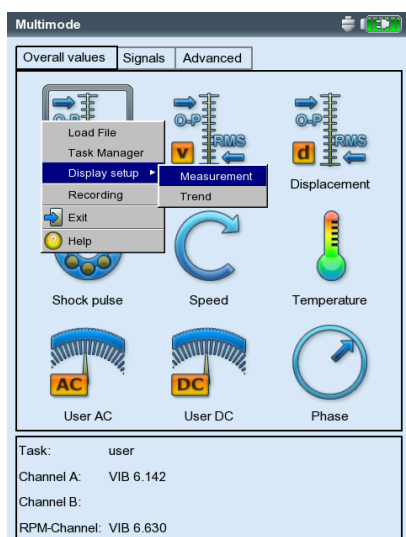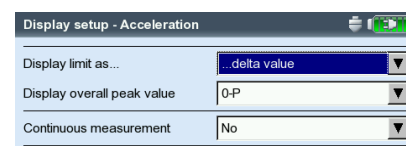

Left:
Opening the Display Setup
before a multimode measurement

Right:
Display Setup for Overall Trend

B1. Display Setup for measurement: Spectrum / Time waveform

ZOOM: Step size when zooming the *X and Y-axis*.

Zoom Mode: The zoom is made around the main cursor or the gap between the delta and main cursor.

CURSOR: Cross (*short*) or line cursor (*long*); *line type* for the line cursor

GRAPH TYPE: A spectrum can be displayed in a *curve diagram* ('continuous') or a *bar chart* ('poles'). 'Gradient' colors the area under the graph. For a sound spectrum select the 'octave' or the 'third octave' option. A time waveform can be displayed in Cartesian coordinates (*X-Y diagram*) or on a *circular plot*. When taking measurements with DC coupling, the DC component in the signal can be hidden (Option: 'AC only').

SUFFIX FOR 1/1000 OR 1000: Instead of '1/1000' or '1000', the X-axis can be labeled with the abbreviation 'm' (milli) or 'k' (kilo).

AMPLITUDE (SPECTRUM): Amplitudes in *RMS* or peak values (*0-peak, peak-peak*). RMS value of entire spectrum: see p. 4-11.

ORDER DISPLAY (SPECTRUM): Scaling of the X-axis in Hz (*No*) or orders (*Yes*). The shaft RPM must be known (measured or entered).

AMPLITUDE SCALING (SPECTRUM): linear or logarithmic (in decibels).

DEFAULT DISPLAY MODE (SPECTRUM): Information that appears in the lower pane by default (*Max 10, time waveform, band alarms, frequency marker, trending parameters, cursor coordinates*).

SPEED MARKER (TIME SIGNAL): Display of the trigger signals in the diagram. In the circular plot, the arrow indicates the direction of rotation.



CONTINUOUS MEASUREMENT (LIVE MODE): see section X on page 4-17.

B2. Display Setup for Trend: Spectrum (Waterfall diagram)

CURSOR & AMPLITUDE: s. section B1; in a waterfall diagram, a *grid* can be superimposed for easier evaluation of the data.

Left:
Display setup for time waveform

Right:
Display setup for spectrum

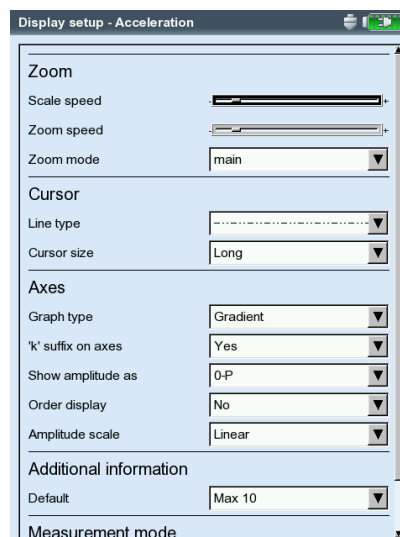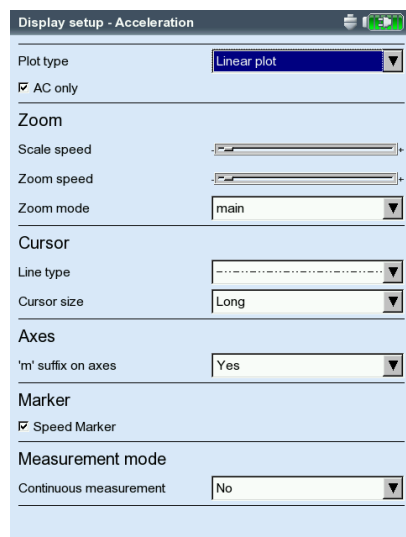

C1. Display Setup for measurement: Coastdown, Orbit, Phase

The following sections C to E only describe the parameters specific to the measurement type. Global display parameters, such as 'Zoom' and 'Cursor', can be found in sections A and B.

SHOW OVERALL (COASTDOWN - OVERALL VALUE): The results screen displays the RMS value and one of three peak values in dependence on the RPM. Select the peak value (0-peak, peak-peak, crest) which is to be displayed as standard.



PLOT TYPE (COASTDOWN - PHASE, ORBIT): The runup / coastdown curve can be displayed as a *Bode or Nyquist plot*. *Orbit* (polar representation) and *single signals* (Cartesian representation) can be selected for the shaft movement. The *AC only* option shows the AC component of the signal.

SHOW AMPLITUDE AS (COASTDOWN CURVE - PHASE VECTOR): Amplitudes can be displayed as an RMS value or a peak value (*0-p*).

CONTINUOUS PHASE (COASTDOWN - PHASE WITH BODE PLOT): The scale of the phase axis begins at 0° and ends at 360°. If the curve runs beyond the 360° mark during the measurement, it is continued unchanged at 0° (*No*). If you select the *Yes* option, the phase axis continues beyond 360° - beginning again at 0° - and the phase progression is continually displayed (see page 5-6).

SPEED MARKER (ORBIT): See section B1.

CONTINUOUS MEASUREMENT (LIVE MODE): see section X on page 4-17.

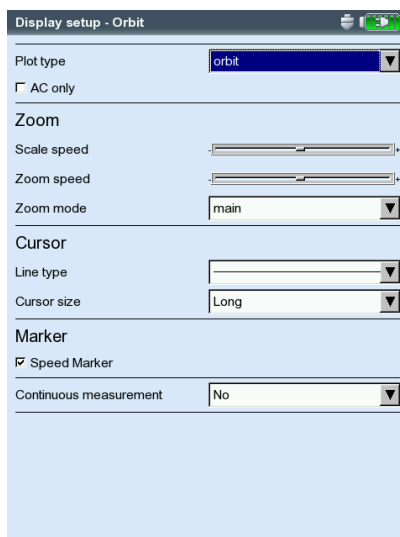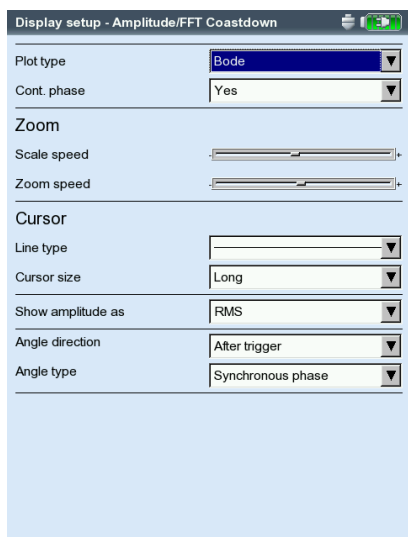

Left:
Display setup for Coastdown
(Phase-RPM)

Right:
Display setup for shaft vibration
(Orbit)

C2. Display setup for trend: phase

PHASE OVER...: When several phase measurements are saved in one file, the phase vectors can be shown depending on the time or rpm (see below).

F

Phase trend diagram

Use the F-key to open a menu in the results screen (see below) with the following options:

DETAILS: Show result of a single measurement

NYQUIST / BODE: Change diagram type

SHOW CHANNEL: Show channel A, channel B or both channels.

D. Display setup for measurement: 2-channel measurement (1+1)

SPECTRUM DISPLAY: If the measurement task contains a spectrum measurement, you can choose whether only the *spectrum*, or also the set *additional info* (max. 10, time waveform,.. see section B1) should be displayed.

DISPLAY SETUP CHANNEL A / B: Click on *Show* to display the display settings of the individual measurement tasks.

To edit the display settings of the individual measurement tasks, enable the required window pane in the result screen and call up the display setup via the MENU key (see diagram on page 5-24).



E. Display setup for measurement: impact test

BUMP DISPLAY: Choose whether the result of the impact test should be displayed as a *time waveform* or *spectrum*.

SELECT RESULT AFTER SAVE: The result selection dialog window opens automatically (*yes*) after a measurement is stored.

Left:
Phase trend
Phase vector as a function
of the rpm (see figure) or the time

Right:
2-channel display setup for
1+1 measurement
Impact test

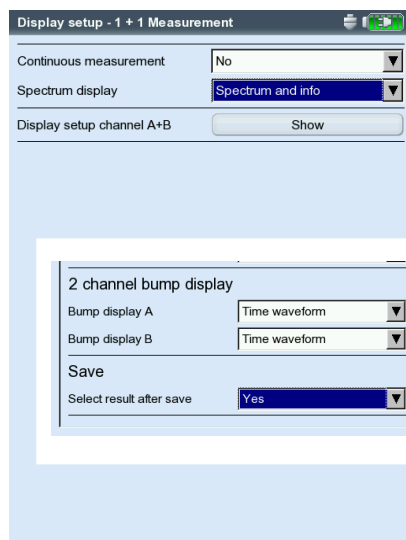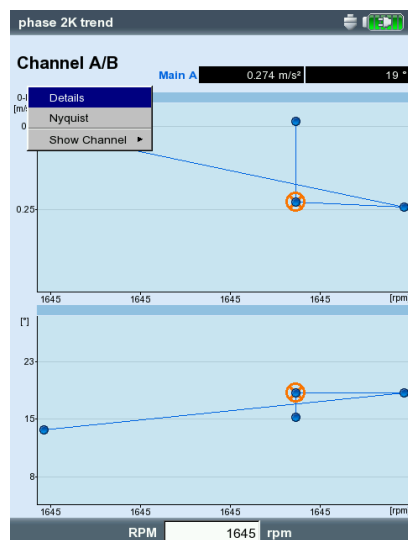

Printing out reports

The print function in VIBXPRT enables printouts of the following reports:

- Screenshots
- Measurement reports
- Route / template reports

To be able to print directly on a printer from VIBXPRT, you require:

- A printer with USB connection
- A VIBXPRT USB printer cable (VIB 5.330 MUSB, accessory)

Reports in PDF format can be transferred to a PC, where they can then be printed. The following options are available for this function:

- Data transfer via VIBXPRT Utility Program (p. 6-5f.).
- Load PDF file via USB adapter to USB pen drive (p. 4-25).

With the VIBXPRT Utility Excel Report Module (VIB 8.986), which is available at extra cost, you can export measurement data in MS Excel format for processing on a PC (S. 4-26).


Preparations for direct printing

- Connect VIBXPRT to the printer (see p. 2-27).
- Set up the printer in the VIBXPRT device setup (see p. 2-26).
- Print out the results (see the following sections)

Printing the content of a result screen

- In the result screen, press the MENU key.
- Click on 'Print', or select 'Print' / 'Screenshot' (see below left). The printer selection dialog window appears.
- Select the printer.
- Press the MENU key and click on 'Print' (see below right). If you select 'PDF' as the printer, enter a file name in the text editor. The printer icon appears at the top edge of the screen while the print job is being processed (see p. 2-27). The screen printout is scaled to half the page width and is positioned in the middle of the page.

Measurement reports

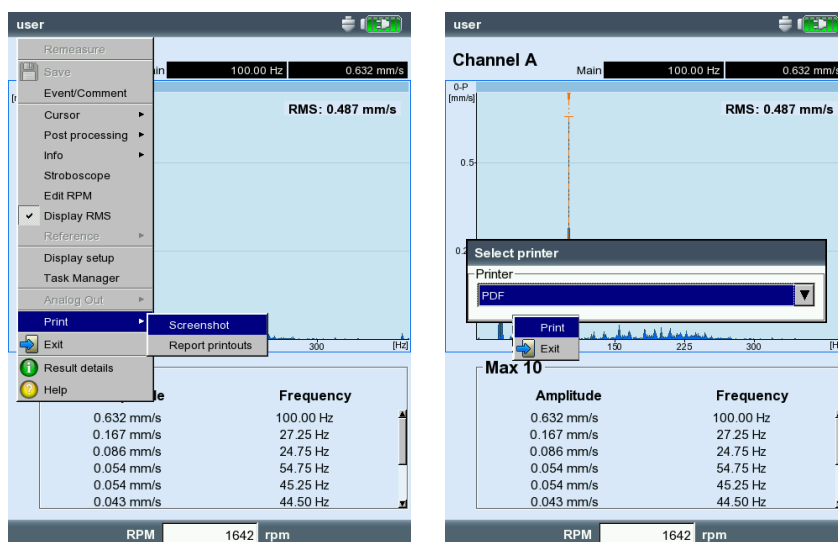

Left:
Print screenshot

Right:
Selecting the printer and start printing.

A measurement report is used to create detailed documentation on a measurement. The report contains the results, general information on the operator and additional measurement information. Measurement reports are available for the following measurements:

SPECTRUM, TIME WAVEFORM, OVERALL VALUES TREND, TRENDINGSPECTRUM, BALANCING.

Configuring the measurement report

Which information is contained in the measurement report is defined in the report configuration. Every measurement has a standard report configuration that is adequate for most cases. The standard configuration can be neither edited nor deleted. To create a new report configuration, proceed as follows:

- Press the MENU key in the result screen.
- Select 'Print' and click on 'Report printouts'.
The report configuration appears (see below).
- Select the 'Reports' field.
- Press the MENU key and click on 'New'.
- Enter a name in the text editor.
- In the 'Common settings' tab, select the entries that are to appear in the measurement report:

COMPANY: Company name that appears on the report. To change it, click on the text field. The changed company name is used in all report configurations.

LOGO: Company logo that is printed in the report. Transfer the new logo using the 'VIBXPRT utility' program (see p. 6-7). File format: PNG, image size: max. 186 pixels (longest side).

CUSTOMER: The customer information is stored globally and can be accessed by any report configuration. Select the customer from the menu, or create a new customer as follows:

- Open the customer selection menu and click on the lowest entry,

Left:
Report configuration
General information

Right:

Report configuration
Information on the spectrum specific to the measurement type

<Edit>. The customer list appears.

- Press the MENU key and click on 'New'.
- Enter the customer data in the text editor.

INSPECTOR/ASSET: Information on the inspector/asset. Click in the corresponding text field to edit the information.

RESULT FILE NAME: The result file name appears in the report.

REPORT EVENT: Report-specific event. Click in the text field to open the event editor and select the event.

RESULT EVENT: Here you can only set whether or not events should be printed.

SETUP INFO: Information on the measurement settings to be used. Three options are available for selection:



- *Standard*: The name of the measurement and sensor setup is printed.
- *Standard + evaluation*: Like *Standard*, plus evaluation setup or machine setup*.
- *Details*: Like *Standard + evaluation*, plus a screen printout of each setup.

- In the 'Measure info' tab, select the measurement type information that is to appear in the measurement report (compare example on previous page).

* only for balancing reports

Printing out the measurement report

- Select the printer and the report configuration ('Printer' or 'Reports' field).
 - Press the MENU key.
 - Click on 'Print' (see below).
- If you select 'PDF' as the printer, enter a file name.

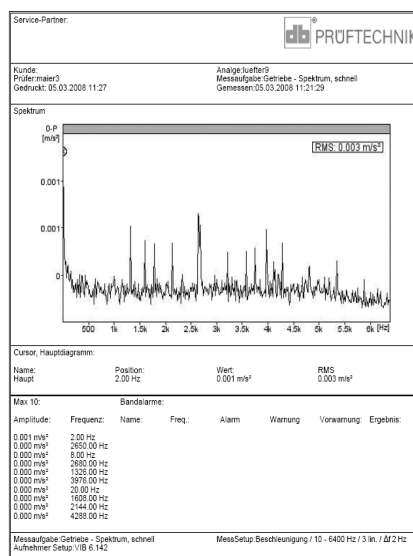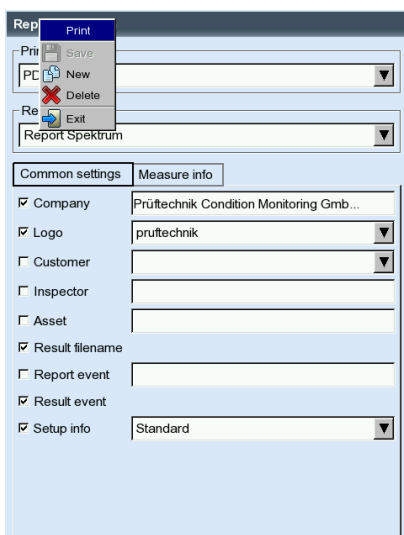

Left:
Printing out the
measurement report

Right:
Measurement report
for the spectrum

Printing out the report for route/machine template

You can print out the following measurements as reports to document the results in a route/machine template:

ALL OVERALL VALUES, TREND PARAMETERS FROM TRENDINGSPECTRUM,
VISUAL INSPECTION, ALL PHASE MEASUREMENTS

In addition to a table of results, the report contains general information and additional data on the measurement. Threshold values are automatically added if they are exceeded during measurement.

- Open the route/template.
- In the tree view, mark the entry for which you wish to create the report.
The results of all measurement locations located below this entry in the hierarchy are printed out.
- Press the MENU key and click on 'Print'. The report configuration appears.
- If necessary, change the report configuration.
The settings in the 'Common settings' tab are the same as the settings for the measurement reports (see previous page). The following detailed data can be set in the 'Measure info' tab.

UNMEASURED JOBS: Measurement tasks that have not been measured are included in the report.

RPM: The speed is printed out if available.

CAPTION: A legend is output as an appendix to the report.

OVERALL VALUE: Selection of the vibration values

TABLE ORIENTATION: Arrangement of the measurement tasks in the table (*horizontal/vertical*).

PAPER ORIENTATION: Paper orientation selectable between portrait or landscape.

Start the printout as described under 'Printing out the measurement report' (see previous page).

Configuration for route report Specific data

The screenshot shows a 'Report selection' dialog box with the following settings:

- Printer:** PDF
- Reports:** Route Report
- Common settings:**
 - Unmeasured jobs
 - RPM
 - Caption
 - Overall value:**
 - RMS
 - O-P
 - P-P
 - Crest
- Table orientation:** horizontal
- Paper orientation:** Portrait

Loading reports onto USB pen drive

Reports in PDF format can be transferred to a USB pen drive and then to a PC, where they can then be printed.


To do this, you need the following:

- VIBXPERT adapter for USB pen drive - VIB 5.330 MEM
- USB pen drive - VIB 5.330-USB

Connect the USB adapter to the communication channel (green jack). In the file manager, the USB pen drive is shown as a separate directory 'USB'.


To transfer the report:

- Mark the file.
- Press MENU and click 'Copy' or 'Move'.
- Mark the directory 'USB'.
- Press MENU and click 'Insert'.

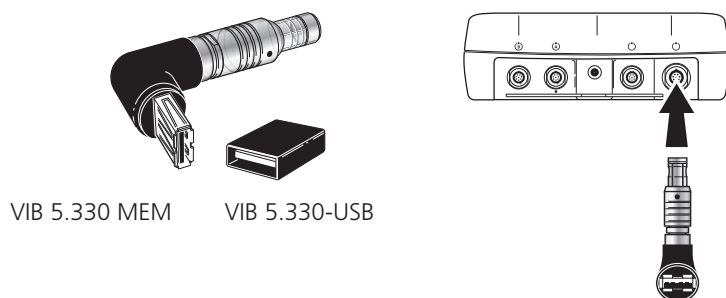




Exporting measurement data in MS Excel format

- Exportable measurement data:
Overall value, FFT spectrum, balancing result, time waveform, coast-down measurement (amplitude phase and overall value), 2-channel measurements
- Compatible version: MS Excel 2003, MS Excel 2007
- Connect VIBXPRT to the PC.
- Start the VIBXPRT Utility Program and register the report module (see p. 6-5f.).
- In the utility startup screen, click 'Transfer files' and then 'CSV Export'.
- Mark the measurement file and click 'Export *.xls'.

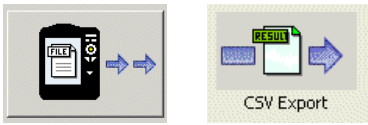

Below:
Measurement data in Excel format

The measurement data are then exported and the MS Excel program is started. The report templates contain macros, which normally are blocked by the program at first.

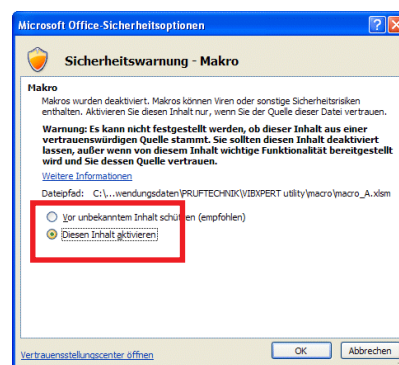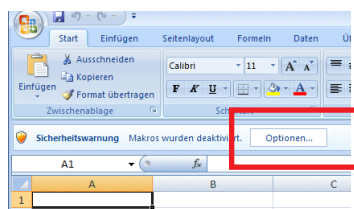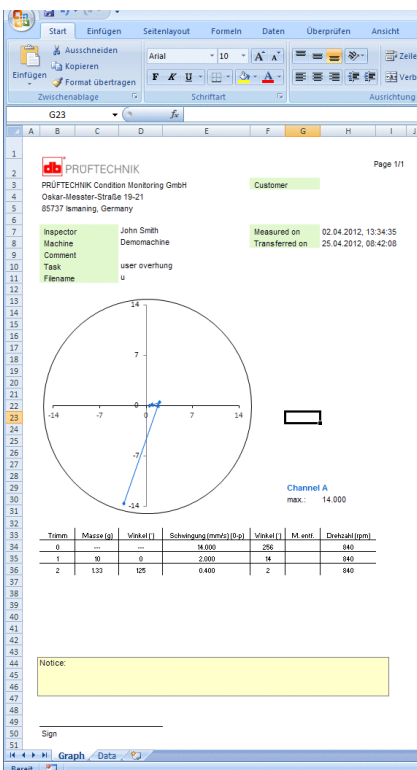

- In the security warning, click 'Options' and activate the option 'Activate this content'.

Excel then displays the measurement data on two worksheets:
1st worksheet: Displays the master data for the measurement and the measurement diagram.
2nd worksheet: Contains the readings in table form

The generated Excel files are based on templates, which can be adapted as necessary by a user with the corresponding skills.

Chapter 5: Measurement tasks

This chapter contains information on the individual measurement tasks and tips for carrying out a measurement.

The '2-Channel Measurements' module must be registered if you want to measure on both channels (see P 2-23, P 6-22).



Note

Characteristic overall vibration values

Characteristic overall vibration values are used for assessing machine, bearing and gear conditions. A good indicator of the vibration forces acting on a machine is the effective value (RMS) of the vibration velocity in the frequency range 10 - 1000 Hz or 2 - 1000 Hz. Yardsticks for the assessment of the permissible vibration levels are specified in the ISO 10816-3 norm (see below). These ranges are preprogrammed in VIBXPRT in the form of threshold values and can be called as the Assessment Setup.

As well as the effective value of the vibration, VIBXPRT records the highest signal amplitudes as peak values (0-peak, peak-peak) and calculates the crest factor from these.


What is the crest factor?

The 'Crest Factor' is the ratio of the highest amplitude to the effective value (RMS) of a vibration and is a measure of the intensity of the impacts in the form of a vibration. Among other things, the crest factor is deployed for wear diagnosis in roller bearings and gearing mechanisms as well as for cavitation. A harmonic vibration of amplitude '1' has 0.707 as its effective value and a crest factor of 1.41. If the crest factor is higher than 1.41, impacts with higher amplitudes are occurring.


Overall vibration values



acceleration

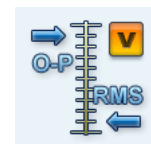

velocity

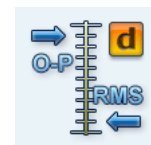

displacement

ISO 10816-3 for the assessment of machine vibrations

To assess the machine condition, the machine is first assigned a machine group with the aid of the lower axis. The range in which the measured effective value falls can be read from the axis at the side.

What you need to do:

Range A: Continue to measure at regular intervals.

Ranges B,C: Look for the cause of the vibration. Observe the machine closely. Schedule a power down.

Range D: Take immediate measures: Localize the cause, switch the machine off and remedy the problem.

D	rigid	soft	rigid	soft	11	0,43	
					7,1	0,28	
C	rigid	soft	rigid	soft	4,5	0,18	
					3,5	0,14	
B	rigid	soft	rigid	soft	2,8	0,11	
					2,3	0,09	
A	rigid	soft	rigid	soft	1,4	0,06	
					0,71	0,03	
					mm/s	inch/s	
					Foundation		
					med. sized mach. 15 kW<P≤300 kW	large machines 300 kW<P<50 MW	
					Motors 160≤H<315 mm	Motors 315 mm ≤ H	Machine type
					Group 2	Group 1	Group



The procedures used for bearing diagnosis (shock pulse, envelope curve, vibration acceleration) comply with the ISO norm, 10816-1 (Appendix E3 , E1).

Shock pulse measurement

Shock pulse signal levels are indicated as a combination of 'Carpet value' (background level, indicative of lubrication condition) and 'Maximum value' (transient peak level, indicative of damage), both expressed in logarithmic [dB] terms. Bearing condition is determined by comparing normalized signal levels and their difference with reference values.

These characteristic overall values are typically affected by various external factors (e.g. rolling velocity, i.e. bearing size and rpm, signal damping, lubrication). To evaluate the condition of the bearing objectively and to allow comparison between values measured on different bearings requires either a comparison measurement in the good condition or a normalization of the measured values.

Normalization

This process considers the following individual factors:

- Bearing size, RPM

These bearing-specific factors are combined in the so-called 'initial value' or the 'dBi value'. The dBi value is calculated from the rotational speed and the bore diameter of the bearing.

- Signal damping, lubrication, load, ...

These unspecific external influencing factors must be determined empirically within the framework of a 'normalization adjustment'. Together with the dBi value, the 'adjustment value' obtained in this way, or even the dBa value, results in the so-called 'adjusted initial value' (dBia value).

Consequently, the normalized shock pulse value (dBn) works out to:

$$\underline{dBn} = dBsv - dBi - dBa = \underline{dBsv} - \underline{dBia}$$

Normalization adjustment

Under ideal conditions (dBa=0), the normalized carpet value of a bearing in good condition equals 5 dBn. The 'true' dBa value equals the difference from the measured value, only with the initial value (dBi) normalized carpet value.

Example

Normalized measurement on a new bearing: 9 dBn.

The adjustment value is therefore:

$$9 \text{ dBn} - 5 \text{ dBn} = 4 \text{ dBa.}$$

Entering the normalization parameters

Before the shock pulse measurement starts, the normalization screen appears:

- Select the type of normalization:
 NO NORMALIZATION: Shock pulse value specified in dBsv.
 MANUAL: RPM is entered manually before the shock pulse measurement.
 EXTERNAL: RPM is measured with an RPM sensor before the shock pulse measurement.
- Enter the dBa value if it is known. Otherwise, carry out a normalization adaptation (set dBa to '0', see previous section).
- Enter the diameter of the bearing inner race.
- If the normalization type is set to 'manual', enter the RPM (see below).
- To start the shock pulse measurement, click on 'OK'.

Shock pulse >120 RPM

Channel A

Normalization mode Channel A

Select normalization mode

No normalization

manual

external

dBa 4 dB

Diameter 25.0 mm

RPM 1500 rpm

dBia 17 dB

OK Exit

RPM — rpm

Shock pulse - Normalization



* If shaft speed < 0,1 Hz (= 6 rpm), then change the 'Keyphaser - Timeout' setting in the Device setup (p. 2-23).



Laser / sensor

Laser trigger sensor (VIB 6.631)

(technical data: see the sensor catalog)

RPM measurements

The Laser-Trigger Sensor (VIB 6.631) is used for RPM measurement and as a trigger encoder. The sensor detects the signals optically, i.e. without contacting rotating machine parts during the measurement. Red laser light is emitted from the sensor head and strikes a measurement mark on the rotating shaft. The measurement mark can be light amplifying (e.g. reflective film VIB 3.306) or light attenuating (a black, high contrast line on a light-colored surface). Each time the sensor detects a difference in brightness, it sends an electric impulse. VIBXPERT calculates the shaft RPM* based on the repeat rate of the pulses.

Installation and adjustment

- Mount the laser trigger sensor on the machine with the trigger stand (VIB 6.632). The maximum distance to the shaft is 2 meters.
- Apply a suitable measurement marker to the stationary shaft (e.g. a reflective tape - VIB 3.306).
- Connect the laser trigger sensor to the measurement device using the trigger cable (VIB 5.432-2.9).
- To adjust the system, point the laser beam at the measurement marker while the machine is at a standstill.


Switch on laser for adjustment: In the case of coast-down measurements the laser automatically switches on prior to the measurement; during balancing the laser can be switched on manually; in all other cases, you must start an RPM measurement for adjustment.

The laser beam should be slightly inclined to the shaft surface and shaft axis. The maximum permissible angle deviation depends on the type of measurement marker.





Do not look into the laser beam! Risk of eye damage!
Do not open the housing!


Adjusting

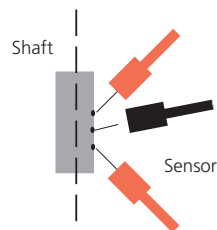

Acceptable angular deviation:
± 45° (Reflective mark)
± 15° (Contrast mark)

Signal response

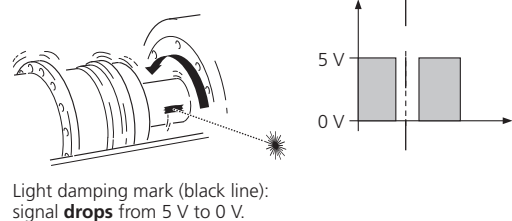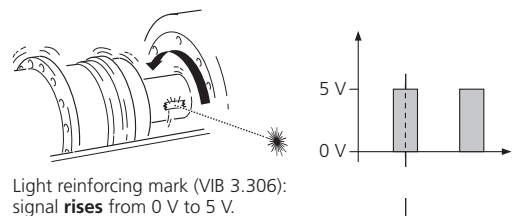

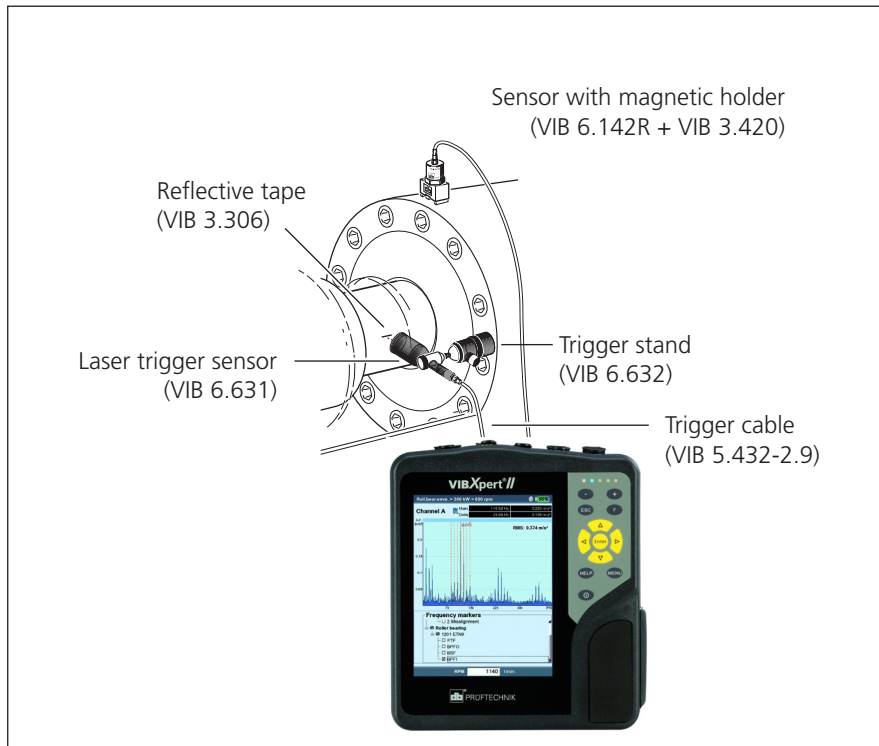


Typical installation for a vibration measurement with simultaneous recording of the rotational speed.

Temperature measurement

For temperature measurements thermocouple type K sensors such as the VIB 8.608 handheld probe or the VIB 8.607-1.5 sensor with magnetic holder can be used.

Tips for measuring


- Hold the sensor at the measurement location until the sensor has recorded the temperature of the measurement object.
- If the values vary, repeat the measurement or increase the number of averages in the measurement setup.
- VIBXPERT does not carry out any sensor detection on the measurement channel for temperature. If the results are not correct, check the connection and the sensor cable.

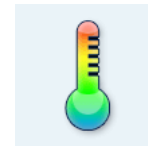

Measurement range:

VIB 8.608: -50°C to 500°C

VIB 8.607: -50°C to 240°C

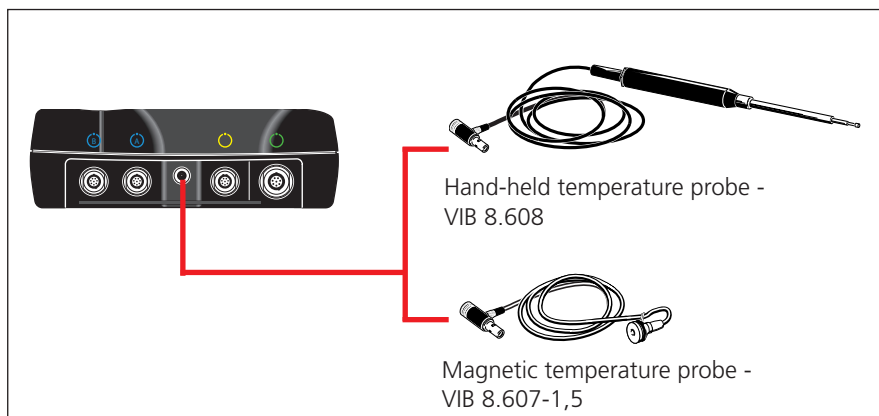

Temperature probes

(Type K thermocouple, technical data are given in the sensor catalog)

Runup / Cooldown

The runup and cooldown curves record the changes in the vibration behavior of the machine when it starts up or shuts down. This analysis function can be used to determine the resonance frequencies of a machine. The following types of measurement are available for this purpose:

- Phase vector (amplitude and angle), dependent on the RPM
- Spectrum, dependent on the RPM
- Overall value, dependent on the RPM

Runup

Measurement is started *before* the machine is switched on. VIBXPRT records the current RPM and automatically begins with measurement as soon as the selected start RPM is exceeded. Measurement is stopped when the stop RPM is reached.


Cooldown

Measurement is started *while* the machine is running at the operating RPM. VIBXPRT then begins to measure the RPM continuously. Once you have switched the machine off and it drops below the selected start RPM, VIBXPRT automatically starts recording the data. Measurement stops once the selected stop RPM is reached. Start and stop RPMs are defined in the measurement setup (see p. 3-22).

Runup / Cooldown
Phase, spectra (RPM)



Runup / Cooldown
Overall values (RPM)


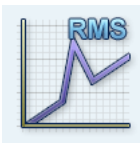


A. Selecting the measurement task

The measurement tasks for a runup / cooldown curve are located in the 'Advanced' tab. The measurement types 'Phase - RPM' and 'Spectra - RPM' are assigned a task icon; the 'Overall Value - RPM' measurement type has its own icon.

Left:
Selecting the
measurement task

Right:
Starting the measurement
Overall value - RPM

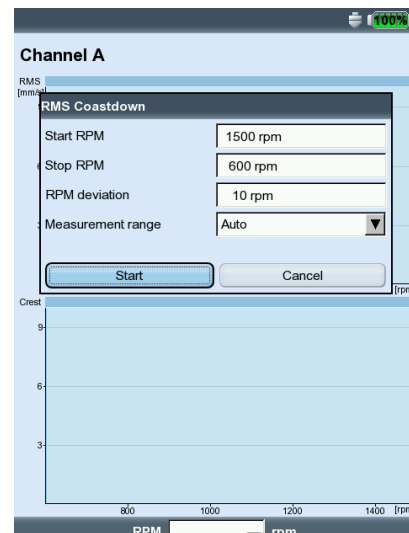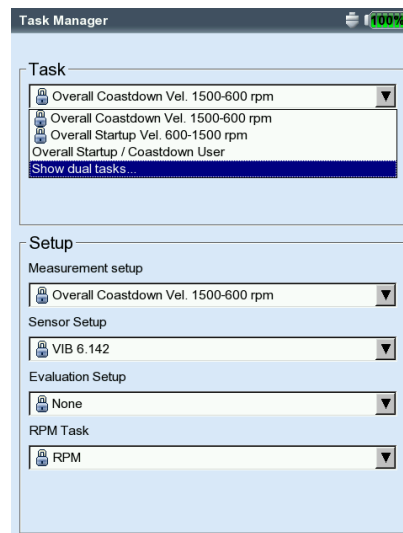

A.1 Selecting the measurement task via the measurement task icon:

- Highlight the respective icon in the 'Advanced' tab.
- Press the F key to display the stored measurement tasks
- Select the required measurement task using the identifier.
 - DUAL or 2-C: 2-channel measurements
 - SPEC or SPECTRUM: 'Spectrum RPM' measurement type
 - OVERALL VALUE: 'Overall Value - RPM' measurement type
 - STARTUP: Runup
 - COASTDOWN: Coastdown

F

A.2 Selecting the measurement task in the Task Manager:

- Highlight the respective icon in the 'Advanced' tab.
- Press the MENU key and click on 'Task Manager'.
- Click in the uppermost menu to display the stored measurement tasks. The 'Show Dual Tasks' or 'Show Single Tasks' menu entries display the available 2-channel or 1-channel tasks (see below)
- Select the required measurement task.

B. Starting the measurement



- Click on the measurement task icon.

A connected laser-trigger sensor is automatically switched on for adjustment.
Do not look into the laser beam! Risk of eye damage!




A dialog window appears in the measurement screen in which you can temporarily change the following setup parameters:

- START RPM, STOP RPM
- RPM DEVIATION
- MEASUREMENT RANGE.
- Click on 'Start' after the parameters have been set correctly.
During data collection, the relevant measurement data are displayed in a dialog window (see below).

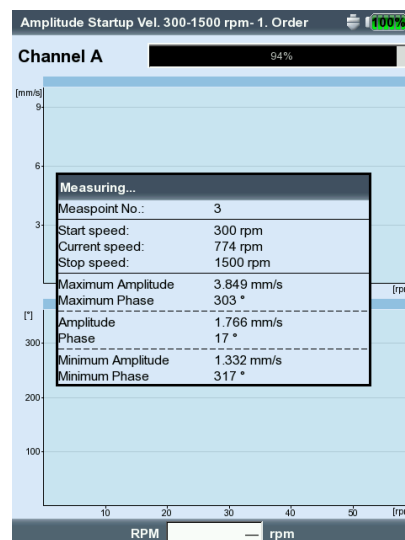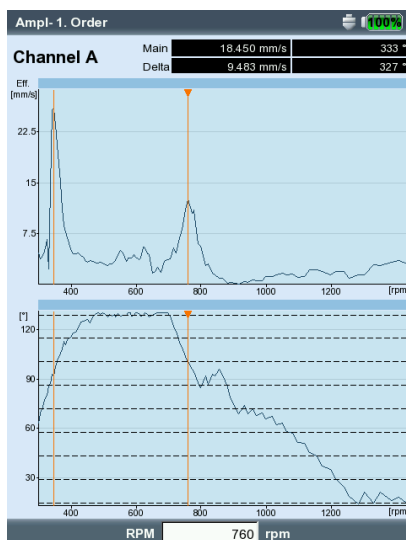

Left:
Runup / Coastdown
Phase - RPM (Bode plot)

Right:
Results screen during a coastdown measurement
Phase - RPM

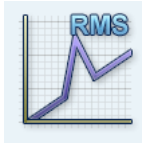

C. Supplementary information

C.1 'Overall Value - RPM' measurement type

This type of measurement records the progression of the characteristic overall vibration values relative to the RPM. Points of resonance are indicated by RPMs with increased vibration amplitudes.

The Results screen displays the path of the RMS value in the upper diagram; one of the three peak values (0-p, p-p, crest factor) can be displayed in the lower diagram:



- To do this, press the F key and select the respective characteristic value (see below).



C.2 'Spectrum - RPM' measurement type

This type of measurement records the spectra while the machine RPM is changing. In this way, the progression of the RPM-dependent vibration components in the spectrum can be tracked and the points of resonance can be identified.

To start the measurement, the following condition must be fulfilled:

$$f_{max.} \geq 4x n_{max.} \text{ (maximum rpm)}$$

The results screen always displays two consecutive spectra of the recorded series (see below). Use the '+/-' key to scroll forwards and backwards. The current number and the associated RPM for the spectrum are displayed at the top left of the diagram. To scroll in only one of the two diagrams, fix the display in the other diagram:



- Press the MENU key and click on 'Fix Diagram > below (or above)'.

A better overview is provided by displaying the spectra in a waterfall diagram (see also p. 4-13):




- Press the MENU button and click on 'Waterfall diagram'.

Runup / Coastdown:

Overall value - RPM
selecting peak value


Spectrum - RPM
Individual display

Spectrum - RPM
Waterfall diagram

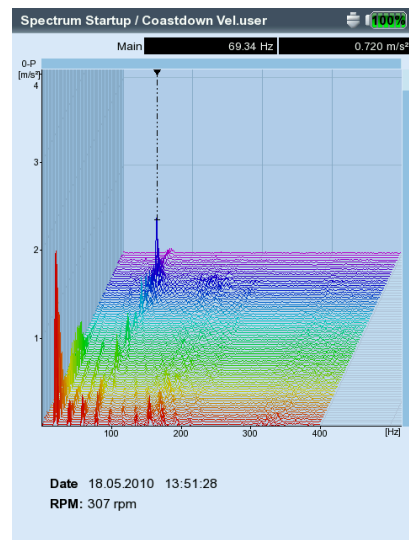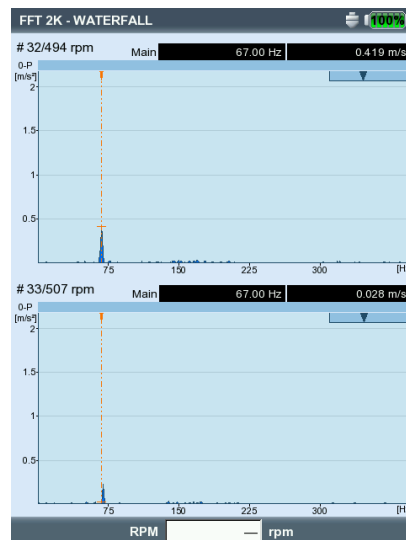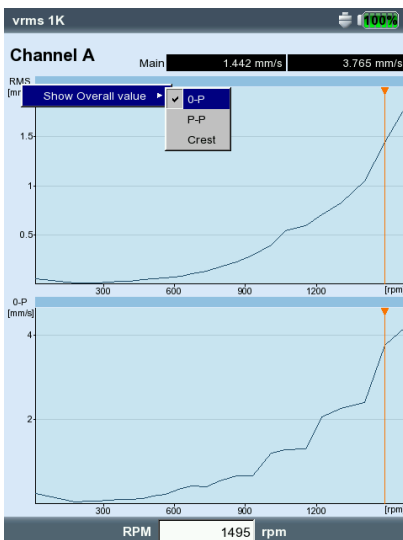

C.3 'Phase - RPM' measurement type

This type of measurement records the phase amplitude and the phase angle in dependence on the RPM. Points of resonance are indicated by RPMs with increased amplitude and a simultaneous jump in phase angle by (ideally) 180° . The results are displayed either in a Bode diagram or in a Nyquist diagram.

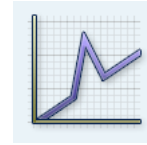

Bode diagram

The upper curve shows the amplitude progression and the phase is displayed in the lower screen. The Zoom function applies to both diagrams.

If the 'Continuous Phase' option in the display setup is enabled, a number of dotted horizontal lines may appear in the phase diagram under certain circumstances. These lines represent the ' $360^\circ - 0^\circ$ ' transition that can occur any number of times due to the constant continuation of the phase progression (see P. 4-19, 5-6)



Note

Nyquist diagram

This type of diagram displays the locus (amplitude and phase) of the curve in polar coordinates (see below).



Changing the type of diagram

Press the F key and select the type of diagram.

F

Averaging cancellation if rpm deviation > 10%

VIBXPRT records a time signal block per shaft rotation and combines multiple blocks to an average signal, depending on the averaging number. If the rotational speed varies by more than 10% during averaging, VIBXPRT aborts the averaging and uses the averaged signal to calculate the amplitude and the phase angle. These values are only saved if the rpm deviation set in the measurement setup is reached.

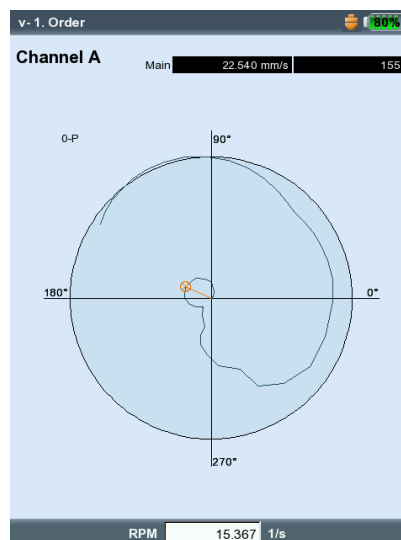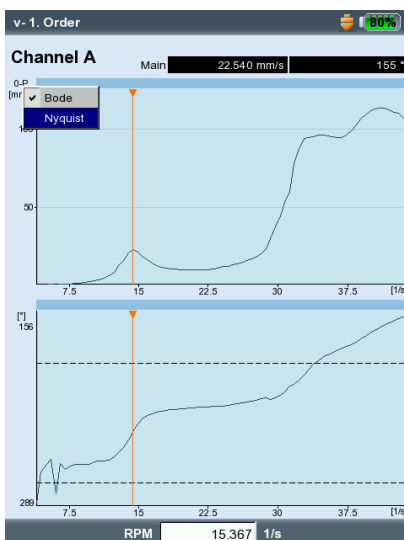

Runup / Coastdown:

Left:
Phase - RPM (Bode diagram)

Right:
Phase - RPM (Nyquist diagram)

C.4 Two-channel measurement

The following differences appear when displaying the results of two-channel measurements.

Spectrum - RPM

Just one spectrum per channel is displayed on the results screen. Scrolling with the '+'/'-' key acts on both channels.

In the waterfall diagram, you must select the channel whose spectrum is to be displayed.

Characteristic value - RPM / Phase - RPM

In two-channel measurements, it is possible to display the channels individually or together in one screen. Press the F key and select the option 'Display Channel -> A , B or A+B'.

'Channel A+B' display:

Channel A is shown in blue, channel B is shown in green.





Note

The delta cursor is not available for 2-channel measurements.

Runup / Coastdown - 2 channels

Left:
Select 'Channel A + B'

Right:
Nyquist diagram

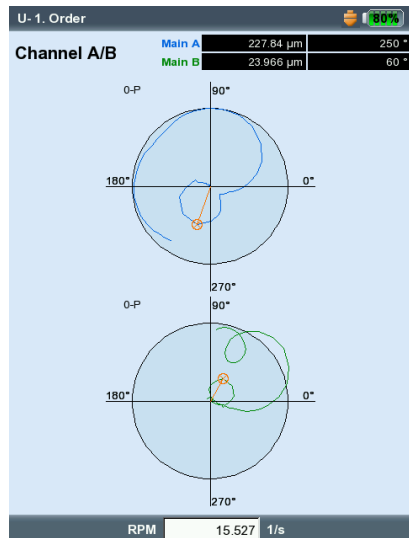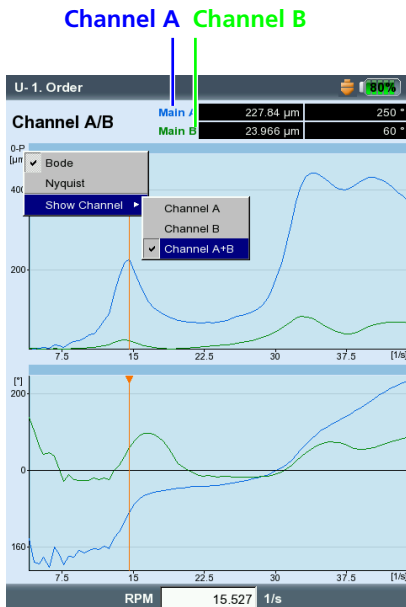

C.5 Measuring rate (number of measurement points)

An important criteria for the quality of the results is the number of measurement values saved. The more measurement values, the more meaningful the measurement. The decisive factor here is how quickly the machine reaches the operating RPM or how quickly it comes to a standstill. The greater the time required for this, the more measurement values VIBXPERT can record. If the time period is too short for a sufficient number of measurement values, the 'Overlap' parameter can be increased in the measurement setup in order to increase the measurement rate (see below and P. 3-21).

In machines the coast up and down very slowly, the number of saved measurement values can be very high without significantly improving the quality of the results. In this case, you can reduce the measuring rate - i.e. the number of saved measurement values per change in RPM - and save memory space at the same time. In the measurement setup, set the 'RPM deviation' parameter to a higher value - either in the measurement setup or immediately before beginning the measurement (see p. 5-6). In the example below, a measurement is saved whenever the RPM (rotational frequency*) changes by 1 Hz.



* 1Hz = 60 rpm.

The 'RPM deviation' parameter in the measurement setups set at the factory can also be changed.



Note

To display the number of measurement values saved, press the MENU key in the result screen and click on 'Result Details' (see below).

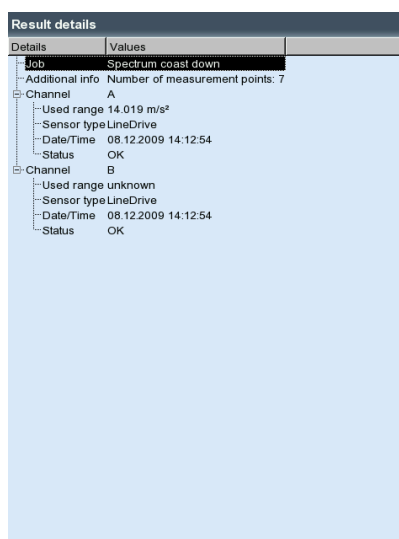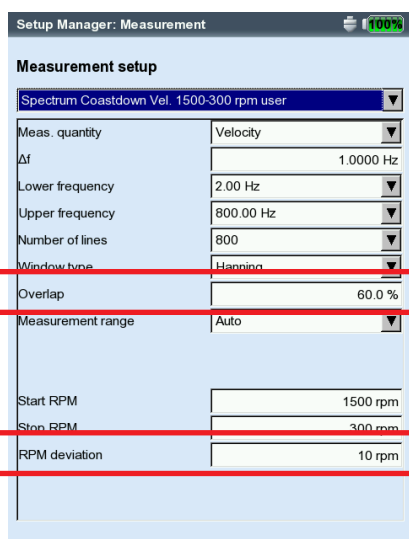

Left:

Runup / Coastdown - meas. setup
Setup parameters 'overlap', RPM deviation

Right:

Number of saved meas. values
in the 'Result details' screen

* The movement of the shaft axis at a **constant** rpm is recorded with an orbit plot (p. 5-16).

Shaft centerline plot

A shaft centerline plot records the movement of the shaft axis* in a journal bearing while the machine is running up or coasting down (e.g. turbine). Conclusions can be drawn from the shaft centerline plot on the fault conditions - such as oil whirl or oil whip in journal bearings.



Note


A description of the measurement procedure with VIBXPRT can be found in the Technical Information CM # 18 'Analysis of radial shaft movement in journal bearings' - available free on our website.



A shaft centerline plot can be set up via the following task:
2-CHANNEL COASTDOWN - PHASE, MEAS. QUANTITY: DISPLACEMENT

Parameters set up in the measurement task manager (see below)

- As the measurement task, select 'Dual Amp. Startup/Coastdown User' (see p. 5-7).
- As the measurement setup, select 'Dual Coast Down User'.
- Set the following parameters in the measurement setup:
 - MEASUREMENT QUANTITY = Vibration displacement
 - LOWER FREQUENCY = DC
- In the sensor setup, select the displacement sensors (e.g. VIB 6.640).

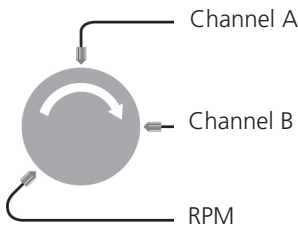




Requirements for correctly interpreting the results

- The sensors are installed at an angle of 90° to each other.
- The shaft always turns from sensor A to sensor B. The position of the sensor relative to the direction of rotation can be adjusted after measurement.
- The static shaft position can be displayed as an offset in the shaft centerline plot.

Shaft centerline plot
Setups in the task manager

Parameters in the meas. setup

Results display

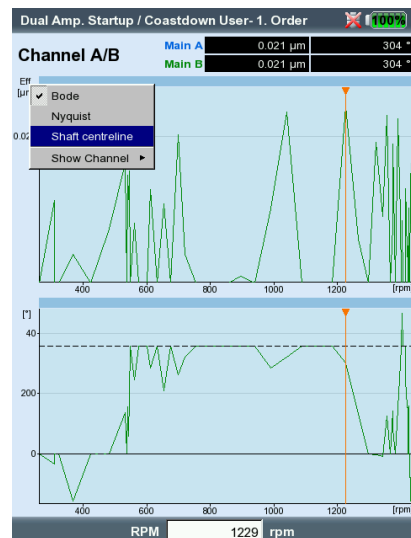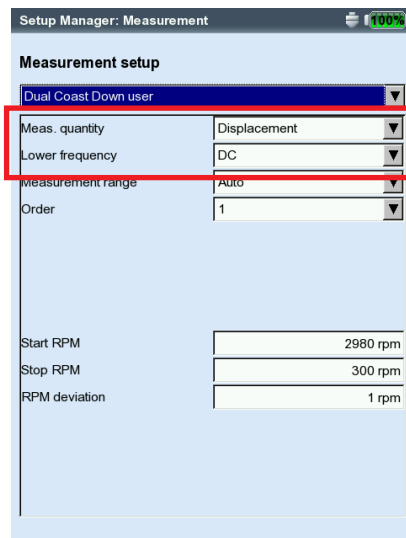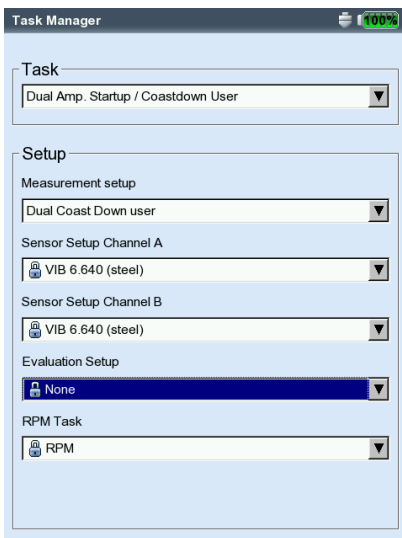

Starting the measurement and displaying the shaft centerline plot


- Click on the measurement task icon and then on 'Start' (see p. 5-6). During data collection, the values for the DC component are displayed in the measurement data dialog window (see p. 5-7).
- After measurement, press the F key and click on 'Shaft centerline'. The shaft centerline plot appears (see below).



Static shaft position

By default, the DC component at the smallest rpm defines the static shaft position in the shaft centerline plot. The static shaft position can also be set after measurement using other methods:

- Press the MENU key in the results screen.
- Select 'Shaft centerline' and click on 'Get shaft rest position'.
- Select one of the following methods:
 - CURRENT CURSOR: Cursor position indicates the rest position.
 - ENTER MANUAL: Enter the coordinates for every channel.
 - MEASURE: Use the 'Static shaft position' measurement task.
 - CHOOSE FROM FILE: Import from a 'Static shaft position' result file.

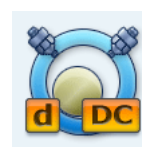


Static shaft position
'Advanced' tab

Sensor arrangement

The arrangement of the sensor relative to the direction of rotation influences the position and orientation of the shaft displacement in the diagram. Because the direction of the shaft displacement with respect to the direction of rotation is a characteristic of certain fault types in journal bearings, the correct sensor arrangement in the diagram is important. If necessary, the arrangement of the sensors and the direction of rotation can be mirrored:



- Press the MENU key.
- Select 'Shaft centreline' and click on 'Fit sensor adjustment'.
- In the next window (sensor geometry, at right), click on 'Flip A-B'.

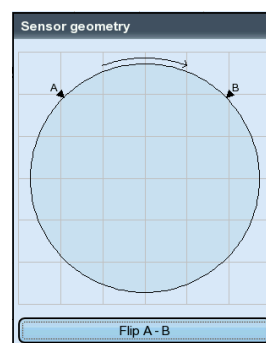

Mirroring the sensor arrangement

Shaft rest position

Methods for reading in the rest position

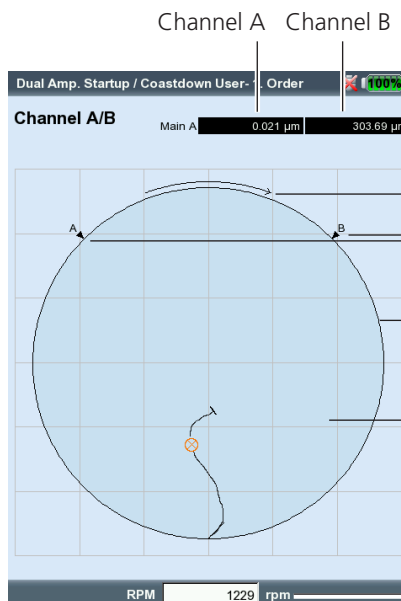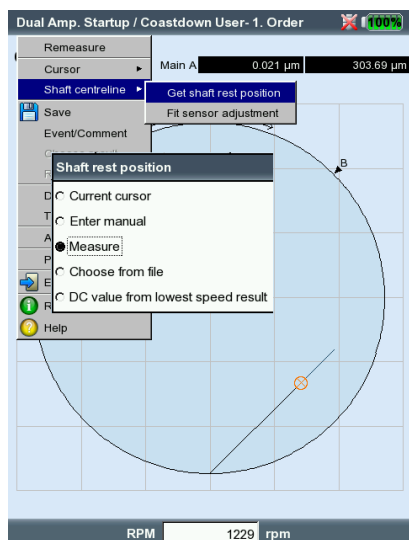

Shaft centerline plot

- Direction of shaft rotation
- Sensor A and B at 90° to each other
- Shaft bearing - does not contain absolute bearing dimensions
- Shaft centerline displacement during measurement
- rpm at cursor position

Synchronous Phase

1 channel
'Overall values' tab




2 channels
'Advanced' tab



Cross Channel Phase

2 channels
'Advanced' tab

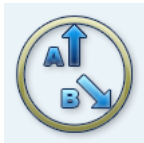

Phase measurement

The phase measurement is used to identify machine faults that cause lines at the same position in the spectrum (e.g. static/ dynamic unbalance). The *synchronous phase measurement* determines the amplitude and the phase angle of the vibration pointer from the RPM-synchronous components of the vibration signal. The reference transducer in this case is a trigger sensor (see p. 5-5). To simplify the diagnosis, the measured signal is processed in an order filter. For example, an unbalance causes severe vibrations in the first order whereas alignment faults dominate in the second order.

Synchronous phase measurement can be performed in one or in two planes. With two channel measurements the phase difference in both planes can be determined. This indicates whether, e. g. static, dynamic or coupled unbalance is present.

In contrast to synchronous phase measurement, the *Cross Channel Phase Measurement* is determined without a reference transducer. The measurement is carried out as a 2-channel measurement where, in addition to the signal amplitudes, the phase difference of the two channels is determined. Depending on where and in which direction measurements have been carried out on the machine, the phase difference is an indicator of the presence of a machine fault.

Enter the RPM of the machine before the measurement as a measurement parameter. The size of the RPM range to be evaluated is set in the measurement setup ('RPM range' parameter, see P. 3-23). Note the setting of the active edge for the trigger signal (see: Keyphaser Menu/ Device Setup, p. 2-23).



The measurement result is displayed in a polar diagram. The respective values for amplitude and phase angle are displayed in the result field below the diagram (see below).

Left:
Synchronous phase measurement
Right:
Cross Channel phase measurement

A: Result for channel A

B: Result for channel B

Max. display range

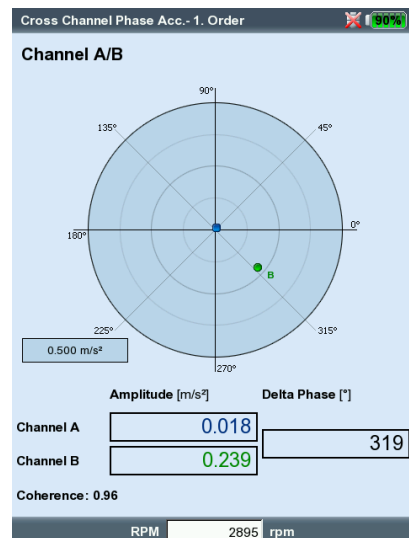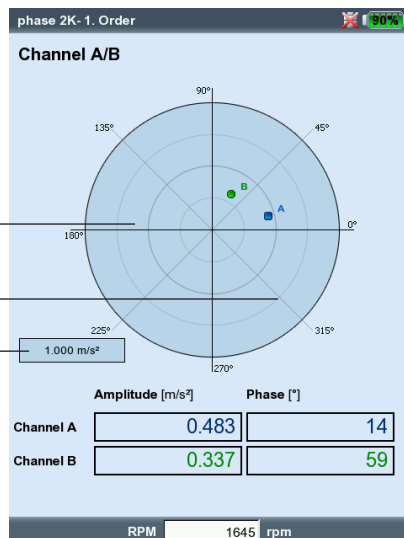

Order filter

After the measurement, the order filter can be changed with the +/- key

Alternative:

- Press the MENU key in the results screen.
- Select 'Order', press the right navigation key and click on the required order.



Scaling

To magnify the scaling of the diagram, press the navigation key up. If a phase vector then moves out of the diagram as a result, the maximum display range is also specified relative to the longer (no longer visible) vector (e.g. '92% of A').



Coherence (Cross Channel)

The coherence factor is a measure of the quality of the measurement and indicates how strongly the signals of both channels are coupled. If the factor is close to 1, the measurement is usable.

Phase trend


If you would like to record the phase trend as a function of time or rpm, save the individual measurements by 'Appending' to a file (see also p. 3-29). In the Display Setup for the trend display (p. 4-20), select either 'Time' or 'rpm' ('Phase over...' parameter). The rpm value and the date of each measurement appear in the lower display field.

To open an individual measurement result in the trend display, press the F key, and click on 'Details' (see below).



Left:
Time-based phase trend

Right:
RPM-based phase trend

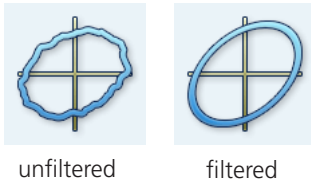

* The movement of the shaft axis while the machine is running up / coasting down is recorded with a shaft centerline plot (see p. 5-12).

Orbit

The movement of the shaft axis* at constant speed is measured with two non-contact sensors that are installed in an angular distance of 90° .

This enables identification of machine faults and damage to the shaft that become apparent in the vibration behavior of the shaft and directly affect the path of the shaft (e.g. unbalance, misalignment, shaft crack, rotation fault - for more details, see VDI 3839 Sheets 1 and 2). When using 'filtered orbit', the signal is processed in an order filter and therefore requires a keyphaser to provide a reference.

A typical measurement installation is shown in the following figure:

- The two displacement sensors are mounted in a single measurement plane at an angular displacement of 90° on the machine. If this angular displacement is not possible, you can mount the sensors at any angular displacement between 5° and 175° . Then enter the angular displacement in the measurement setup ('Sensor angle' parameter). However, measurement accuracy is limited when the sensor angle $\neq 90^\circ$.
- The sensor on channel A defines the X direction and the 0° position.
- The keyphaser is mounted in the 0° position.
- Note the setting of the active edge for the trigger signal (see: Keyphaser Menu/Device Setup, p. 2-23).




Note

The procedure for an orbit measurement is described in the following standards: ISO 7919, ISO 10817-1, VDI 3839 Sheet1.

A description of the measurement procedure with VIBXPERT can be found in the Technical Information CM # 18 'Analysis of radial shaft movement in journal bearings' - available free on our website.

Typical installation with inductive displacement sensors

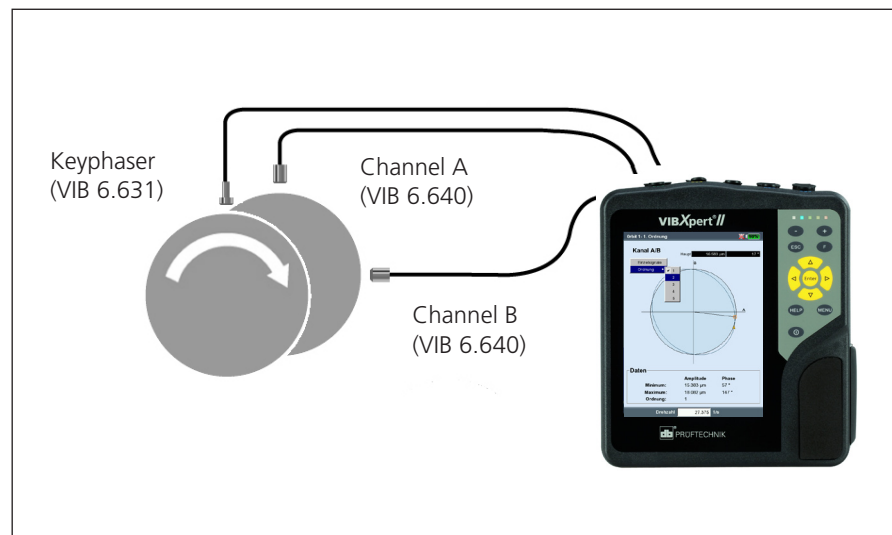

The signals of both sensors are displayed either as individual signals or as an orbit in a polar chart. The maximum and minimum phase vectors and the order filter are displayed in the data field on the orbit display. The angular coordinate of the cursor indicates the angular distance to Keyphaser point*, which is marked in the orbit with an arrow. To check the phase stability, multiple rotations of the shaft can be displayed in the orbit diagram (see p. 3-23).

* Keyphaser point: Point in the orbit, at which the reference mark on the shaft passes the Keyphaser.

Cursor and Zoom

A main and delta cursor are available for evaluation. Details of their function and operation are described in the section 'Evaluate result - Time signal' on page 4-5. The Zoom function is controlled with the '+/-' key or with the navigation keys ('Phase measurement', P. 5-15)

Changing the diagram type

After the measurement,

- Press the F key, and click on 'Individual signals' or on 'Orbit' respectively, or..
- Open the Display Setup and select the diagram type (see below).




Changing the order filter

After measurement, press the F key, and select the required order in the 'Order' field. The order of '0' corresponds to the unfiltered signal and can only be adjusted if the measurement parameters in the measurement setup and the transducer setup are the same.





Orbit, unfiltered

If a keyphaser is not available, record an 'unfiltered' orbit. The angular displacement of the sensors for this measurement task must equal 90°. To stop the measurement, press the 'Enter' key.

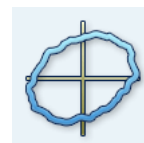

For time-based average enter the shaft RPM value and the number of rotations, if necessary: Press the MENU key and select 'Postprocessing / Timesynchronous average' (see also p. 4-7).

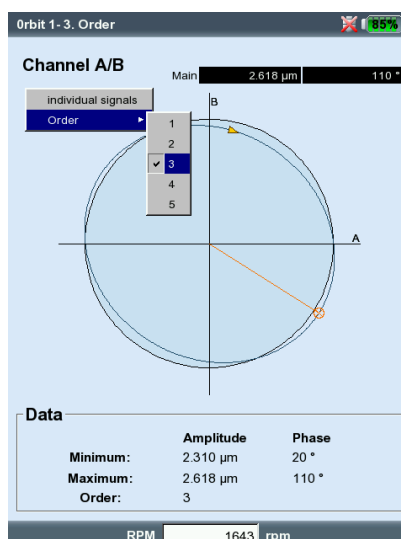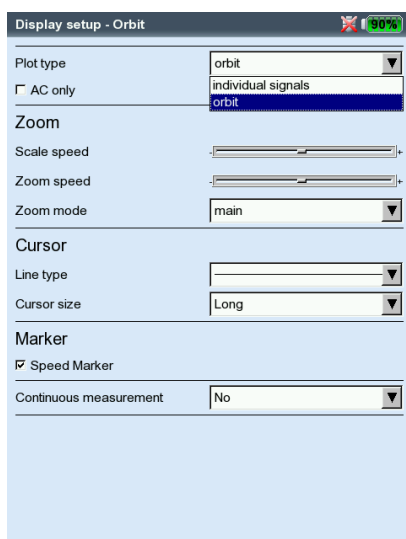

Left:
Change diagram type

Right:
Change order

Envelope spectrum for roller bearing analysis



Envelope spectrum for gearing analysis



Envelope analysis

Envelope analysis is a proven method for detecting periodic impacts in the vibration signal of a machine. It is mainly used for the diagnosis of roller bearing damage and gearing damage and is based on the demodulation of amplitude modulated vibration signals.

Periodic impact sequences in a component excite high frequency machine resonances that serve as a carrier signal of the low frequency impact signal. To separate the low frequency modulation from the high frequency resonance, the signal is filtered with a high pass filter, rectified and then filtered using a low pass filter. Consequently, the remaining signal consists of the modulation signal only - the so-called 'envelope' - from which the FFT of the envelope frequency spectrum can be calculated.



Note

VIBXPRT saves the envelope time signal filtered last together with the envelope frequency spectrum.

To display the time signal, press the MENU key and select 'Info / Time signal' (see below).

VIBXPRT provides two methods for calculating the envelope: High pass and low pass filtering is carried out on the basis of hardware or software.


In the case of hardware filtering, the signal is processed in a filter chip. This method is identical to that used in the VIBSCANNER FFT data collector and, hence, is suitable for comparison measurements with both devices.

Software filtering, on the other hand, calculates the envelope with the aid of an algorithm. This method is more flexible than the hardware-based method and offers more filter combinations.

Left:
Measurement setup
for envelope spectrum

Right:
Envelope spectrum and
appropriate time waveform

Measurement setup	
Meas. quantity	Acceleration
Δf	0.1000 Hz
Filter type	Software
HPLP filter [Hz]	500 10000
Demodulation factor	2500 5000
Upper frequency	1500.00 Hz 10000
Number of lines	15000 20000 40000
Window type	Hanning
Average type	Linear
No. of measurements	3
Measurement range	Auto

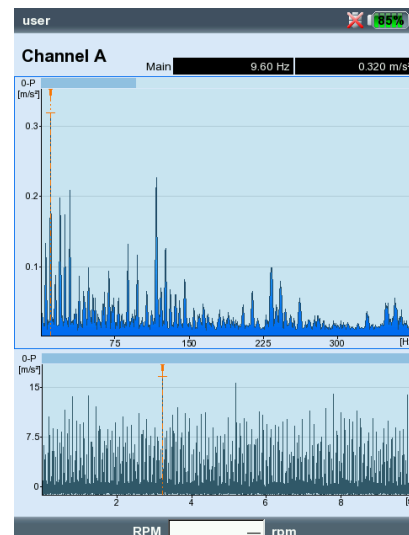

Cepstrum analysis

A cepstrum is the 'spectrum of a spectrum' and is particularly suitable for detecting regular structures in a frequency spectrum. Above all, in the case of complex patterns with many harmonics and sidebands - that frequently occur if roller bearings or gearings are damaged- a cepstrum simplifies the evaluation of the measurement data.



Cepstrum

User-defined measurement quantities

As well as measurement tasks with fixed specified measurement quantities, VIBXPERT provides measurement tasks where the measurement quantities can be freely defined. The voltage ($\pm 30V$, AC/DC) or current ($\pm 30mA$, AC/DC) can be connected as an input signal and recorded as an overall value, as a time waveform* or as a spectrum*. The assignment of the input signal to the measurement quantity is specified by the 'Measurement quantity' and 'Unit' parameters in the transducer setup (see P. 2-20).




AC overall



DC overall



AC time waveform

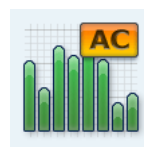

AC Spectrum

Examples of user-defined measurement quantities:



- Measurement of the pressure as a current level ($4-20mA$, DC). Connection to pressure transmitter.
- Measurement of the flow rate as a current or voltage signal ($4-20mA / 0-10V$, DC). Connection to flow rate measuring device.
- Measurement of the sound pressure as a time signal or spectrum. Connection to a microphone.
- Displacement measurement (inductive sensor VIB 6.640).

* DC measurement for time waveform, spectrum, see page 5-30.

Only the following cables can be used as sensor cables:
 VIB 5.433 - Connection cable for low voltage signals
 VIB 5.434 - Connection cable for low current signals



Attention!

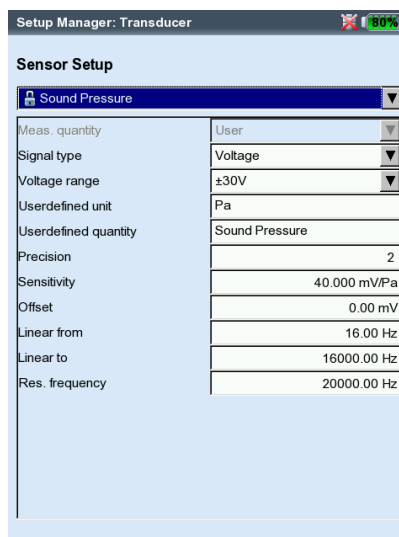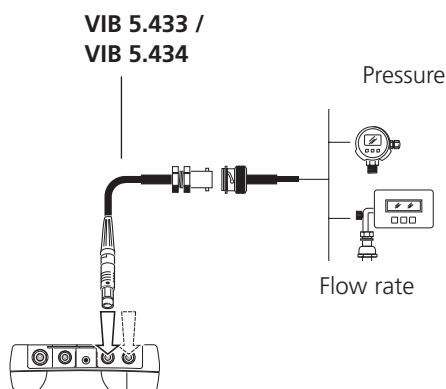

Sensor parameters for sound pressure measurement



* e.g. shock pulse value + envelope + velocity spectrum

Multi-measurement task ('Multitask')

A multi-measurement task shortens the measurement times by combining several, similar measurement tasks*. It is particularly time-saving in the case of measurement tasks that are measured at the same measurement location with the same transducer and the same filter settings. In this case, VIBXPRT only carries out one signal measurement and calculates the results of the individual measurement tasks from this.

Initially, no measurement results appear in the Results screen, just information on the status of the measurement together with the assessment of the results (see below).

Evaluating the results

The evaluation of the results is carried out on the basis of the stored thresholds. If a threshold is exceeded, the corresponding symbol appears in the 'Status' column (see below left).

- For a detailed view of the evaluation scale, press the MENU key and click on 'Evaluation Overview' (see below).

Result of the single measurements



- After the measurement, press a navigation key until a black frame appears around the list field.
- Press 'Enter' to activate the list field.
- Click on the measurement in the list whose result is to be displayed.
- Press ESC to return to the list field.



Multitask
Result display (left)
Evaluation (right)


Status / evaluation icons

- Alarm
- Warning
- Prewarning
- Measuring
- Measured
- Error

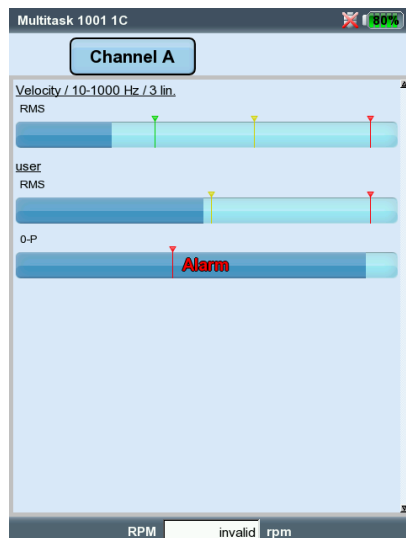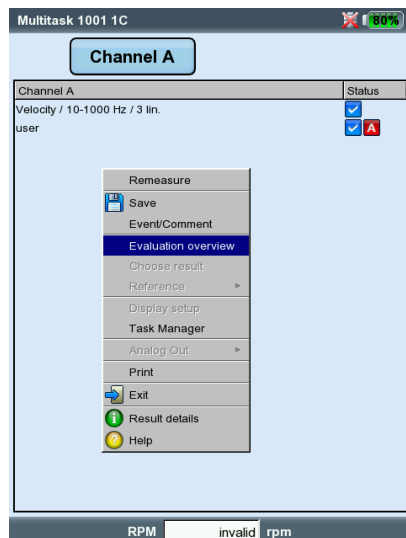

Creating a multi-measurement task for a route / machine template

Multi-measurement tasks for this operating mode are created in the OMNITREND editor for routes or machine templates. To do this, activate the 'Multitask' option (see below). OMNITREND then automatically combines the relevant measurement tasks into a single multi-measurement task.

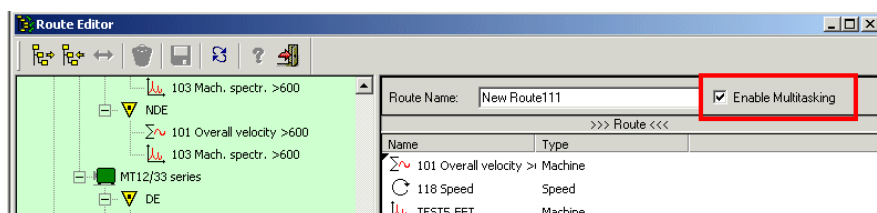

Creating a Multitask
(in the OMNITREND route editor)

Breaking down a multi-measurement task


To measure the measurement tasks of a multi-measurement task individually in the route/machine template, proceed as follows:

- Open the selection list of the measurement tasks (see P. 3-8).
- Highlight the multi-measurement task.
- Press the MENU key and click on 'Break down Multitask' (see below).

This process is not reversible (see P. 3-10)!



Note

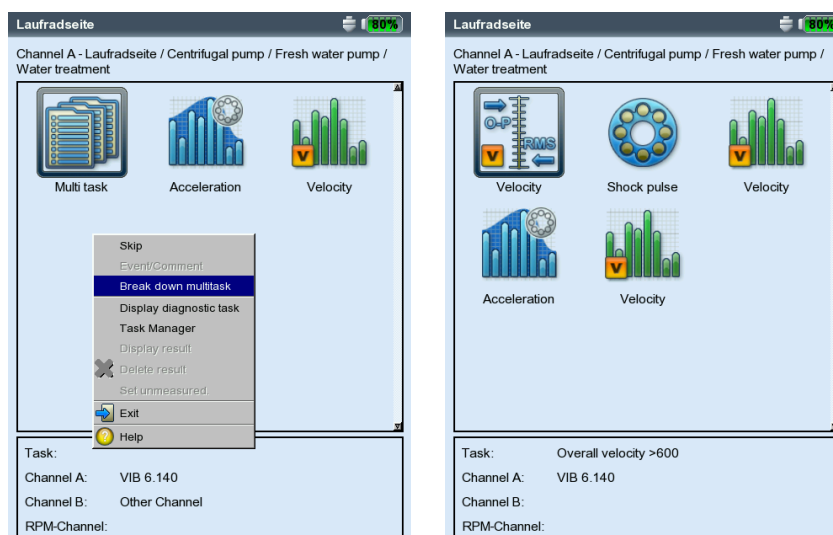

Left:
**Breaking down
a multi-measurement task**
(Route / Machine template)

Right:
Individual measurement tasks

Multi-measurement task in the 'Multimode' operating mode

Multi-measurement tasks are created in the Task Manager:

- Open the Task Manager (see P 3-19).
- Select the upper menu 'Measurement task' and press the MENU key.
- Click on 'New' and enter a name for the new measurement task.
- In the 'Start measurement' field, define whether the measurements should be started consecutively or simultaneously. With the 'Synchronous' setting, you can additionally define a trigger channel ('Synchronous + Channel ...').

The measurement task, sensors and trigger parameters can be set up in the respective tabs:

TASK TAB

Here you can set the sensor for each channel (A/B), and define whether the rpm should be recorded as well.

CHANNEL A / CHANNEL B TAB

Here you can define the measurement task for each channel:

- Press the MENU key and click on 'Select task' (see below). The import wizard appears, in which you can select the individual measurement tasks in three steps (see also the next section, 'Dual measurement').

MENU



TRIGGER TAB

The trigger settings only apply when the multi-measurement task is to start with a trigger (see 'Start measurement' above). The first measurement starts as soon as the *Trigger level* is exceeded and the *Trigger start time* has elapsed (see also p. 3-22). The trigger levels relates to the *measurement range*.

Multitask (Multimode)

Selecting individual meas. tasks (left)
Setting the trigger parameters (right)


Measurement task
Evaluation setup

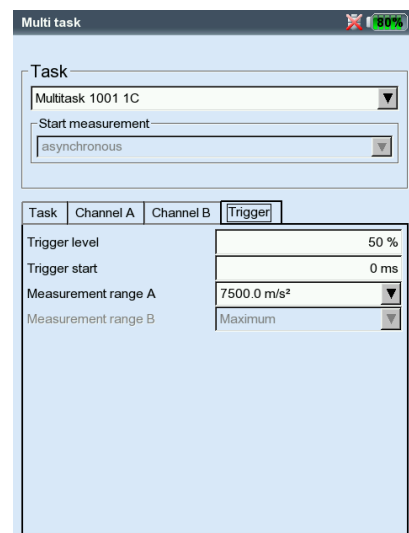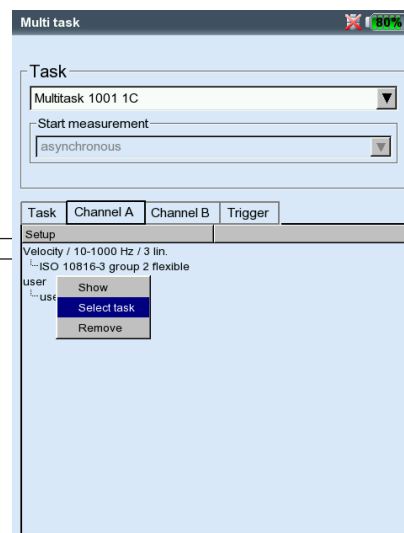

Dual measurement (1+1)

In the case of a dual measurement, vibration measurements can be carried out as a overall value, spectrum or time signal on both channels at the same time, such as

- Overall value on channel A and spectrum on channel B, or
- Spectrum on channel A and time signal on channel B, etc.

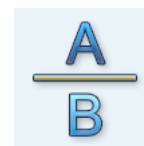

Creating a new dual measurement

- Open the Task Manager (see P. 3-19).
- Highlight the drop-down menu in the 'Measurement Task' field, press the MENU key and click on 'New'.
- Enter a name for the new measurement task in the Text Editor.
- In the 'Start measurement' field, define whether the measurements should be started consecutively or simultaneously on channel A and channel B.

If the averaging type is set to “synchronous averaging” for one channel, the “asynchronous with trigger” start option is identical to the “synchronous + trigger A” start option - i.e., measurements start at the same time on both channels, with channel A acting as the trigger.




Note

- In the 'Setup' field, select the respective measurement parameters for channel A and channel B.

Only the setups of one measurement type can be selected for each channel as a measurement setup - i.e. either overall values, or spectra, or time signals. To select the setups of another measurement type, proceed as follows:

- Highlight the 'Measurement Setup' drop-down menu, press the MENU key and click on 'Import Task' (see below).

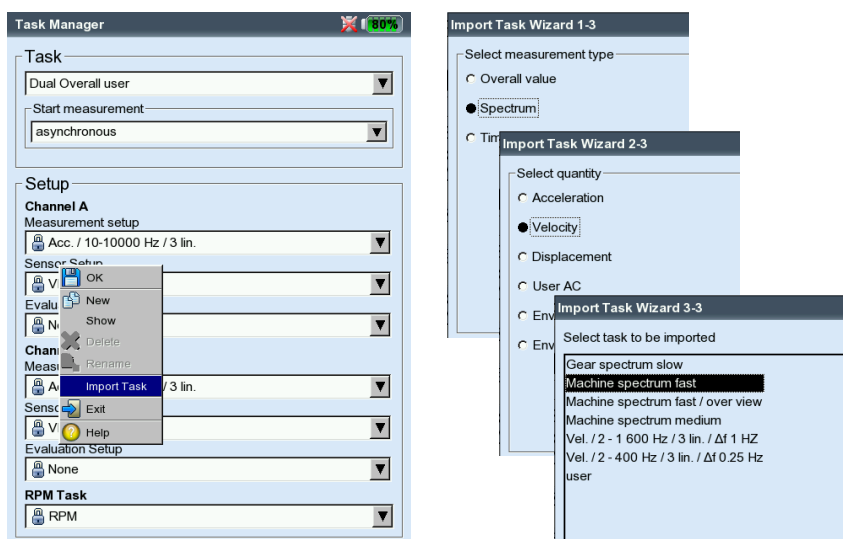

Left:
Importing a task

Right:
Import wizard
Three steps to reach the desired measurement task

Measurement tasks

The 'Import wizard' appears which is used to select the measurement type, the measurement quantity and the measurement task in three steps (see previous page). Transducer setup and evaluation setup of the measurement task will be automatically applied.

Results screen

As soon as both measurements are completed, the blue LED lights up if no thresholds have been exceeded or measurement errors have occurred (see P. 2-2).




Note

The functions that can be triggered via the keyboard only apply to the active pane, which is indicated by a frame.

As well as the pane for channel A and channel B, the entire screen also counts as a pane!

To evaluate or repeat one of the two measurements, activate the corresponding pane as follows:


Navigation in the Results screen
Frame color (gray/ black) indicates the pane status

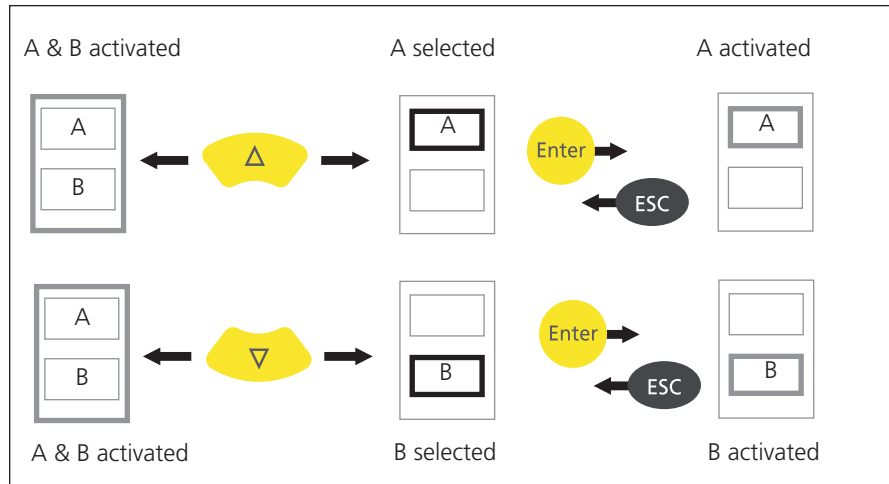

Dual task

(here: Spectrum / time signal)

Channel A pane is selected (black frame)

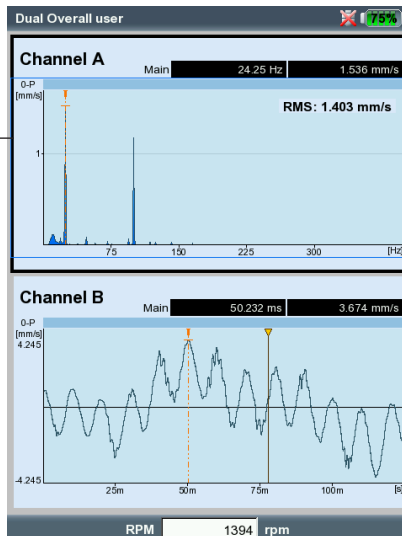

Impact test - 1 channel

The Impact test is used to determine the resonance frequency of a structure. In the case of a rotating machine, it is possible to determine the RPM ranges in which vibrations are disproportionately amplified by resonance* and could damage the machine. These ranges must then be avoided during operation and should be passed through as quickly as possible during runup and coastdown of the machine.

The one-channel impact test only records the system response. The two-channel impact test also records the excitation.

Almost any source of vibration that contains as many frequencies as possible is suitable for exciting a structure - such as a pulse-blow with a rubber hammer.



- Check and change the measurement parameters, if necessary.
The measurement can take place with the machine running or at a standstill. The signals from a running machine can be filtered out using the so-called 'negative averaging method'.
- Attach the transducer to the machine - either with a magnet or, even better, with a screw fitting.
- Set the number of individual measurements in the measurement setup (e.g. 2 measurements, see below).
- Start the measurement by clicking on the task icon (see above).
- When the message 'Wait for trigger' appears, excite the machine with a suitable rubber hammer: Strike near to and in the direction of the transducer once per measurement.
- For each single measurement, strike exactly the same location once with the hammer.

After each single measurement, the result can be accepted or discarded (see below). After all measurements have been completed, the averaged final result appears together with the 10 highest amplitudes in the spectrum.



Impact test

* e.g. excited by an imbalance or misalignment

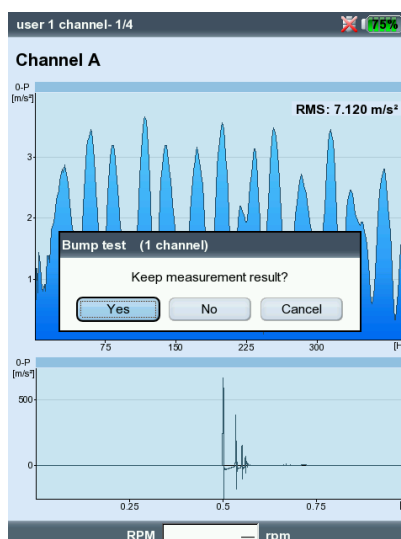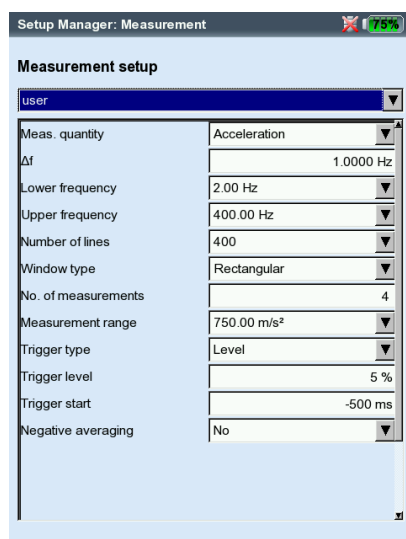

Left:
Setup parameters for impact test
Trigger Start < 0 : Signal is also recorded before the excitation

Right:
Measurement after hammer strike
Spectrum with resonant frequencies and measured time signal

**Note****Tips for setting the measurement parameters**

Set the 'Trigger Start' time to a negative value in order to record the signal before the excitation.

If the measurement starts before the excitation, increase the trigger threshold in the measurement setup by approximately half (P. 3-22).

If the response signal overloads, increase the 'Measurement Range' parameter in the measurement setup accordingly (P. 3-22).

Measurement with the machine running

- Enable 'Negative averaging' in the measurement setup.
- Perform the individual impact tests.
- Click on 'Start' in the window that opens to measure the reference spectrum - without producing a machine excitation!
- Click on 'Stop' when a sufficient number of reference spectra have been recorded and averaged to form a result (see below).

Displaying the results



- Activate the upper pane with the F key (Spectrum, P. 4-8).
 - Press the MENU key and click on 'Choose Dataset'.
- The results of the impact test, the average final result and the reference measurement (negative averaging) are listed here and can be displayed individually by clicking (see below).
- To close the list, press on the ESC key.

Repeating individual measurements

- Activate the upper pane using the F key.
- Press the MENU key and click on 'Repeat'.
- Click on the respective measurement in the list.

Left:
Reference measurement
is required when measuring on a running machine

Right:
Dataset selection
Single measurements /
Averaged final result

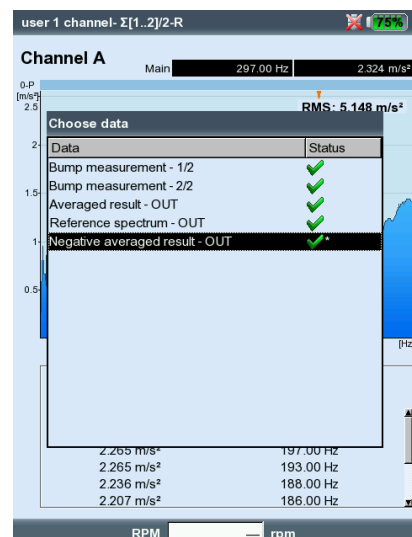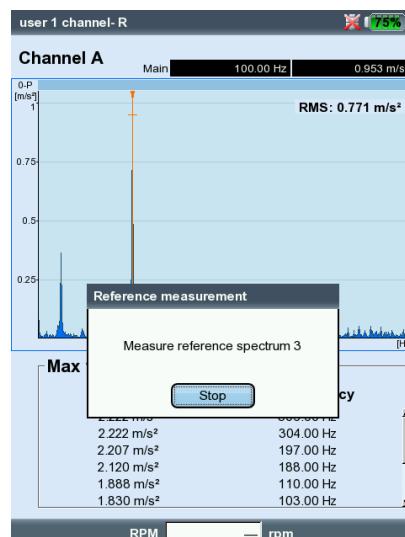

Modal analysis - two-channel impact test

The two-channel impact test is used to visualize the dynamic behavior of a structure and to detect operating-critical natural vibration forms.

ODS - Operating Deflection Shape

To record the vibration modes of a structure, the vibrations are recorded at multiple measurement locations during operation and set in relation to a reference measurement location. The individual vibration modes can be calculated from the relative amplitudes and phase differences of the measurement locations to the reference and can be displayed as an animation*.

Excitation with impulse hammer

If the structure is excited with a suitable excitation source (e.g. impulse hammer) and the structural response is measured with a vibration sensor, the resonance frequency can be calculated.

The described measurement methods are implemented in the following measurement tasks:

- *ODS*
The sensor on channel B records the 'excitational' force and serves as the reference point for all other measurement locations. The sensor on channel A is attached to the designated measurement locations of the structure in sequence and records the respective structural response.
- Impact test with *impulse hammer*
This measurement task is similar to the one-channel impact test; channel B records the excitation and is the trigger for the measurement. To take measurements on a running machine, the 'negative average' averaging procedure is available.

A. Selecting the task and starting the measurement

- Select the task icon 'Modal analysis' (see above).
- Press the F key to open the task selection window.
- Click on the respective task (ODS or Bump test with impulse hammer). The selection window closes.
- Click again to start the measurement.

The measurement procedure with the *impulse hammer* is essentially identical to the one-channel impact test: excitation, measurement, recording of result - excitation, measurement,..., end result (see also previous section).

Connect the impulse hammer with the force sensor to channel B, and




Modal / ODS

* additional information are available on request.


Example of an ODS animation:

Maximum displacement of a mounting platform .

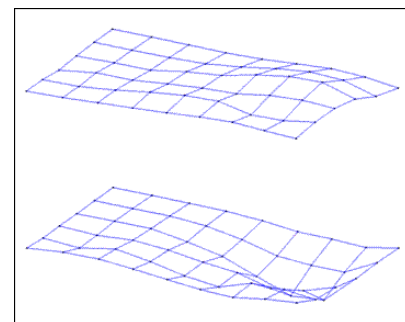

F

Selecting the measurement task and starting the measurement

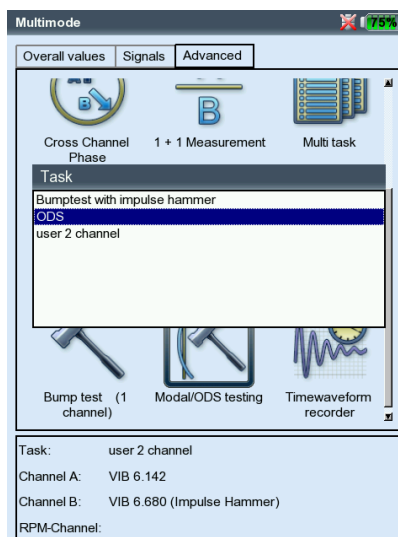

always connect the sensor for the system response to channel A. After the last individual measurement is completed, save the data set in a file.

With the ODS measurement, the measurement starts without a trigger, which means that spectra are recorded until the number of measurements is reached (standard = 4).

B. Saving

With the ODS measurement, you can assign a point number and a direction to each impact result to document the position of the measurement location and the measurement direction. Multiple impact results can be contained in a single file.

C. ODS results

During measurement, the system response appears in the upper window and the excitation in the lower window - either as a spectrum or time waveform (see also p. 4-20).

After the individual measurements are completed, the final result appears. The upper window shows the transfer function while the lower window displays the coherence function.

- Press the MENU key and click on ...
 - ... 'Choose dataset' to call up the individual results.
 - ... 'Choose result' to open the result selection dialog window. Here you can open the result of another measurement or start a new measurement. This dialog window appears automatically when saving when the corresponding option is activated in the display setup (see p. 4-20).



Left:
Result of an ODS measurement for one measurement location

Right:
Selecting a result from a file

Transfer function*

Coherence function

* Select the calculation procedure for the transfer function in the measurement setup.
(Parameter: FRF CALCULATION, p. 3-22)

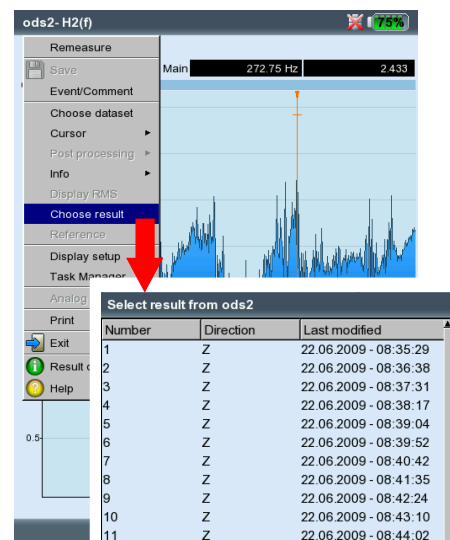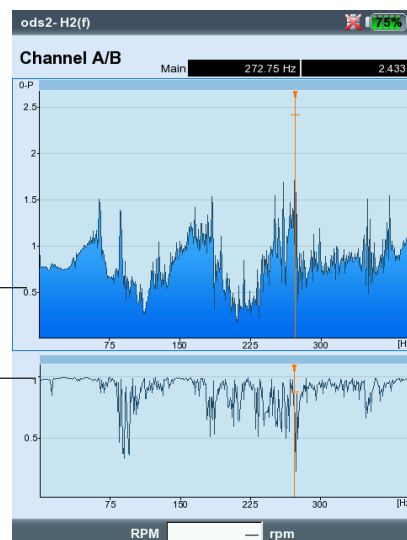

The measurement tasks described on this page are only available in the 'Route / Machine template' mode. The measurement parameters are set in the OMNITREND PC software.



Note

TrendingSpectrum

A TrendingSpectrum is a measurement template for the route mode. It can be used to make data collection significantly faster and more efficient. A TrendingSpectrum is based on a time signal measurement. Based on the TrendingSpectrum, VIBXPRT first generates a spectrum, which in turn is used to calculate up to 30 overall values. The overall values result from the frequency bands defined in OMNITREND and are used for condition monitoring when recorded in the form of a trend.

Based on the spectrum, VIBXPRT also calculates a time signal according to the settings in the OMNITREND software. The measurement quantity of the recorded time signal may differ from the measurement quantity of the measured time signal.



TrendingSpectrum
(Amplitude)



TrendingSpectrum
(Envelope)

Order spectrum

In an order spectrum, the frequencies are recorded and displayed as a multiple of the shaft rotational frequency (= order). In these measurements, the RPM is recorded at the same time as the vibration signal and is taken into account when the order spectrum is calculated. If short-term, system-related fluctuations in the RPM occur, the sample rate of the time signal is adjusted accordingly ('resampling') to avoid a 'smearing' of the frequencies.

An order spectrum cannot be converted into a frequency spectrum, since the time and thus the frequency information are lost through the resampling procedure.



Order spec-
trum

Order-based spectrum

With this type of spectrum, the frequencies are converted into orders*. The RPM is measured, manually entered or passed as a parameter by the OMNITREND software. The maximum order to be displayed is also required. Order-based spectra are advantageous when machines run at different RPMs for process-related reasons because the spectra are only comparable in relation to the RPM.

* Shaft rotational frequency = 1. Order

DC measurements

For the following measurement tasks, the DC component in the signal can be recorded in addition:

* see page 5-19

- Time waveform with the measuring quantity set to vibration displacement or user-defined*.
- Spectrum with the measuring quantity set to vibration displacement or user-defined*.
- Phase with the vibration displacement measuring quantity .
- Coastdown, amplitude/phase with the measuring quantity set to vibration displacement or user-defined*.
- Orbit (unfiltered), with the measuring quantity set to vibration displacement or user-defined*.
- Time waveform recorder, with vibration displacement measuring quantity.

Application examples

The DC component in the *time waveform* can be evaluated when process parameters or distances are measured.

When a *2-channel coastdown curve* is measured with the *vibration displacement* measuring quantity, the shaft centerline plot during runup or coastdown in a machine with journal bearings can be calculated from the DC component of the signal (see p. 5-12).

Setting up a measurement task for measuring the DC components

You can activate a DC measurement in the measurement setup using the 'Lower frequency = DC' parameter (see p. 3-21 / 3-23). You must also set up the 'Vibration displacement' or 'User-defined' measuring quantity and assign a suitable sensor.

Setting up a DC measurement
 Measuring quantity = 'Displacement'
 or 'User'
 Lower frequency = 'DC'

Setup Manager: Measurement	
Measurement setup	
Dual Coast Down user	
Meas. quantity	Displacement
Lower frequency	DC
Measurement range	Auto
Order	1
Start RPM	2980 rpm
Stop RPM	300 rpm
RPM deviation	1 rpm

Chapter 6: Appendix

This chapter provides information on how to use

- the numerical and text editors,
- the VIBXPERT utility software,
- the File Manager
- the VIBCODE transducer system.

Instructions on handling and maintaining the VIBXPERT as well as the technical data complete this chapter.

Numerical editor

The numerical editor appears each time it is necessary to enter a numeric value (see below).


- To enter a numerical value, move the cursor over the character field and click on the required digit.
- To delete numerals, press the ESC key. Only the left digit of a number is deleted.
- The sign can be toggled at any time with ' \pm ' in the character field.
- Decimal places are entered as a period '.'.
- To save the value, press the MENU key and click on 'OK'.

Decimal places

Decimal places can only be entered if the 'Accuracy' of the respective quantity is not set to zero (see the section on 'Units' in the device setup, p. 2-24).

Value range

The permissible value range is defined in the 'Maximum' / 'Minimum' fields. If the value is outside of this range, the threshold that has been exceeded is displayed with a black background. In this case, the entered value cannot be saved.

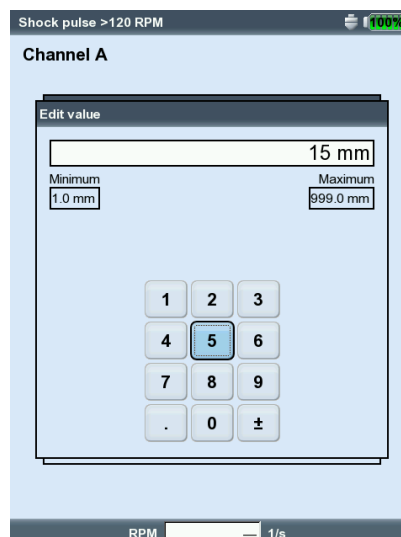

Numerical Editor

Text Editor

Entering text



- Press the F key until the cursor appears in the *character table* (see below).
- To enter the text, click on the respective characters in the table . If the required character is not included, then press the '+' key to display further character tables.
- Finally press the MENU key and click on 'OK'.
- To cancel, press the ESC key.

Deleting text

- Press the F key until the cursor appears in the *text field*.
- To delete an individual character/word:
 - Place the cursor to the right of the character/word to be deleted.
 - Press the F key to switch the cursor into the character table.
 - Click on '<=' in the character table (backspace key, see below).
- To delete a text field:
 - Press the F key until the entire text field is highlighted.
 - Click on 'Enter'.
 - Press the F key again to switch the cursor into the character table.
 - Click on '<=' in the character table (backspace key).



Note

Special characters (*Space, comma, +, /*) are not allowed in file names.

The *text defaults* field contains texts which you can accept and, if necessary, modify by clicking.


Text editor

Text defaults, only for
- Measurement task/ Create new setup
- Search route

Text field (one line or several lines)

Character table

'Backspace' key

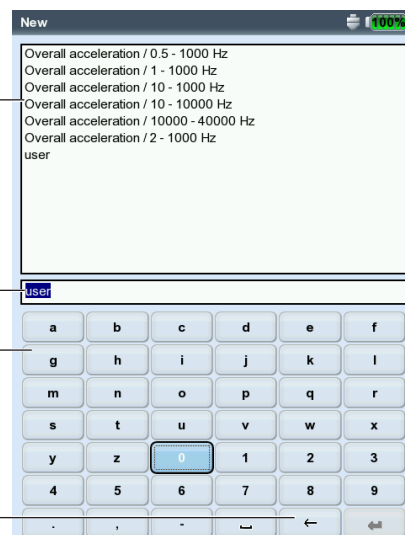

File Manager

The File Manager administrates the measurements which were saved in the 'Multimode' and 'Balancing' operating modes. In the 'PDF files' folder you will find the print files generated in the PDF format. You can print out or delete these here.

The File Manager is opened by ...

... clicking on the 'File Manager' icon in the start screen.

... selecting the 'Load file' menu option in the Multimode Measurement Task screen.

... saving a measurement result.



For opening and saving, only the files of the current measurement type are displayed (e.g. overall value - vibration acceleration). If you open the File Manager from the start screen, all files are displayed (see below).



Note

Functions of the MENU key

SAVE: Saves the measurement result.

OPEN: Opens the highlighted file

CREATE DIR: Creates a new folder

RENAME: Renames a file/folder

PRINT: Prints out a PDF file



COPY, PASTE, CUT: Copies, inserts, moves file/folder via the clipboard.

DELETE: Deletes a file/folder

SORT: Sorts files by name, by time or by type.

FIND: Searches a file/folder. Enter the complete name or the first letter of the name. Call up the search function with the F key.

F

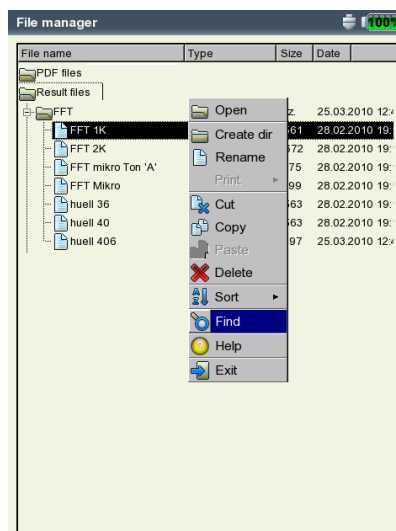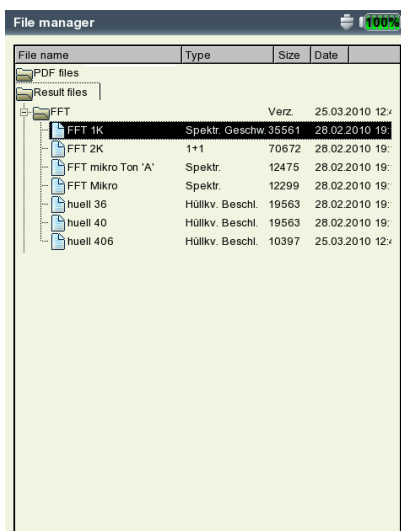

Left:
File Manager
contains result files and print files (PDF)

Right:
Search File Manager

Printing out the PDF file

The print files saved in the PDF format can be printed as follows:

- Connect VIBXPRT to a printer.
- Open the File Manager and select the file to be printed.
- Press the MENU key and select 'Print > Printer'. Printing starts.


**Note**

Details on connecting and setting up a printer can be found in Chapter 2 (p. 2-26).

Transferring a PDF file on a USB pendrive

See page 4-25.

Print PDF file
Select printer

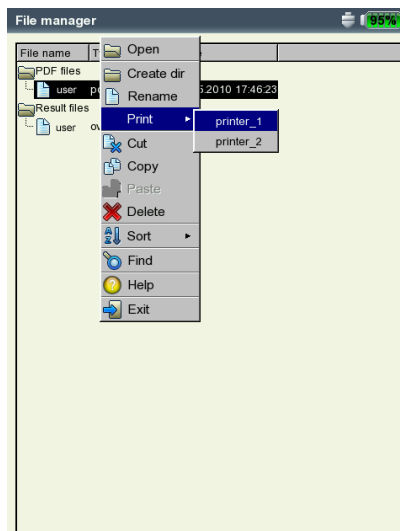

VIBXPRT utility

The 'VIBXPRT utility' tool can be used for the following tasks:

- Updating firmware (with the VIBXPRT update tool)
- Saving and restoring results and settings
- Formatting the CF memory card
- Export results in CSV format (Phase, Balancing, ODS analysis)
- Export results into MS Excel.
- Loading screen contents onto the PC.
- Loading PDF files onto the PC.
- Converting spectra, time signals, impact tests and phase measurements to the UFF file format for evaluation in other analysis programs.
- Converting timewave recording measurement files to the IEEE format for further processing in the DASyLab analysis program.
- Transferring language and help files for translation (for authorized PRÜFTECHNIK representatives only).

Installing and starting the program

The installation program ('VibXpert_utility_version.exe) can be found on the PRÜFTECHNIK homepage (www.pruftechnik.com) or on the Condition Monitoring CD (included with the delivery):

- Double click on the file to start the installation.
- Follow the instructions on the screen.
- To start the program, open the Windows START menu and select 'Programs / PRÜFTECHNIK Condition Monitoring / VIBXPRT utility / VIBXPRT utility'.

Alternative: In the installation directory* double click on 'vxpTool.jar'.

* C:\Programs\Pruftechnik\vibxpert\VIBXPRT utility



A start screen appears in which all available functions are accessible via buttons:



Show version number

Select language



Registration

Registering optional functions

The following functions are optional and must be enabled by a password:

- Conversion of measurement files into formats that can be processed by other analysis programs (UFF / IEEE)
- Export results into MS Excel.

Activate the 'Excel report' demo version

- Connect VIBXPRT to the PC and perform a connection test (see next section).
- Click on the 'Registration' button to open the registration window.
- Click on 'Get Serial'.
- As soon as the serial number appears in the field to the right, click 'Register serial'. The demo version is valid for 30 days. If you wish to use the module after that, you must request the password.

Left:
Activate Excel demo version
Enter / Request password

Right:
Send / Print data for registration

Registry (Excel export demo expired)

Select preferred modules
Enter company and password

Company: PRÜFTECHNIK Condition Monitoring
City: 85737 Ismaning
Country: Germany

Excel Report: VIBXPRT utility db spectra
 VIBXPRT utility advanced file export

Password: 3831588027 (Not registered)

Buttons: Get Serial (highlighted), Register serial, Request registration (highlighted)

Require registration

Registration details
VIBXPRT utility 1.4.2 (115)

Company: PRÜFTECHNIK Condition Monitoring
City: 85737 Ismaning
Country: Germany
PC-CM-UNGAR
ID No.: 98481343
Request for: Excel export
Valid until: 26.04.2012
serial no.: 3831588027
Request for: VIBXPRT utility advanced file export VIB 8.984

Buttons: eMail (highlighted), Print (highlighted)

Request the password

- Enter the address data in the registration window.
- Activate the desired function and click on 'Request registration'.
- In the next screen, check the entries and click on 'Print' to print out the data. Send the printout to the following fax number:
+49 89 99616300.
To send the data to PRÜFTECHNIK by eMail, click on 'eMail'.
- The password will be sent to you by fax or eMail within a short period of time.


Enter the password

- Enter the password in the registration window.


Setting up a connection with VIBXPRT

Data transmission takes place via a network or USB connection.

- Connect VIBXPRT to the network or a PC using the cable provided (see also p. 2-32).
- Click on the 'Connection' button.
- Set the type of connection (USB or Ethernet).
- *For Ethernet only:* Enter the IP address of the data collector in the network in the 'IP address' field (see also p. 2-34f.).
- To test the connection, click on the 'Test communication' button. If the connection is working, a yellow 'Smiley' symbol appears. A red 'Smiley' symbol indicates a faulty connection.

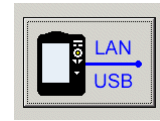

Connection

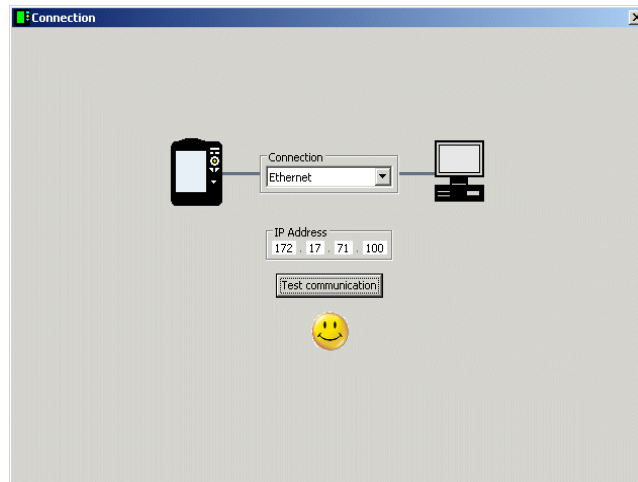

VIBXPRT successfully connected


Configuring VIBXPRT

The configuration encompasses the following functions:

- Updating the firmware
 - Transferring logo images for the report printouts
- Click on the 'Configure device' button.
 - The 'New firmware' button starts the 'VIBXPRT update tool' that updates the firmware in VIBXPRT (see also p. 2-37f.).

The program must be installed in the designated directory on the PC:
C:\Programs\Pruftechnik\vibxpert\VxpUpdateTool

- Click on 'Report-Logo' button, to load a new logo image into VIBXPRT. The logo appears on each printed report page top right. File requirements:
 - Format: PNG / Size: 186 pixel (longest side)

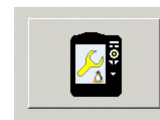

Device configuration




Update Firmware



Note



Report-Logo

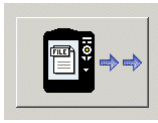

Get files



File selection window

Transferring files

The following files can be transferred from the device to the PC:

- PDF files generated with a PDF printer driver.
- Screenshots generated by pressing <F> & <-> simultaneously .
- Results in CSV format for analysis and display in a spreadsheet program (eg MS Excel).



- Click on the 'Get files' button.
- Then click on the respective button and select the files you wish to transfer.

- Click on 'Transfer' to start the file transfer.



'Export *.xls' exports results into a MS Excel file.

Use 'Delete' to remove a file from the device.

'Close' closes the file selection window.

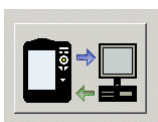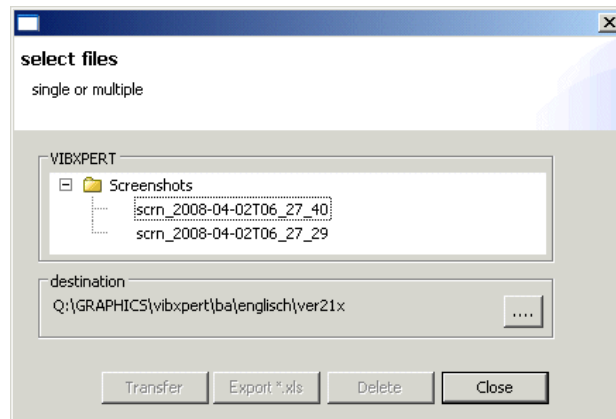

System

  

Backup settings


Transferring system files

You can perform the following procedures:

- Backup and restore of the data and device configuration
- Format CF memory card.
- All the above mentioned steps in a procedure ('Defragmentation').

- Click on the 'System' button.
- To perform a data backup, click on 'Backup'.
- In the screen that opens, select the data category (Settings / Results) and enter the target directory, if necessary.
- Click on 'Backup' to start the procedure.



The 'Restore' procedure is performed in the same manner.

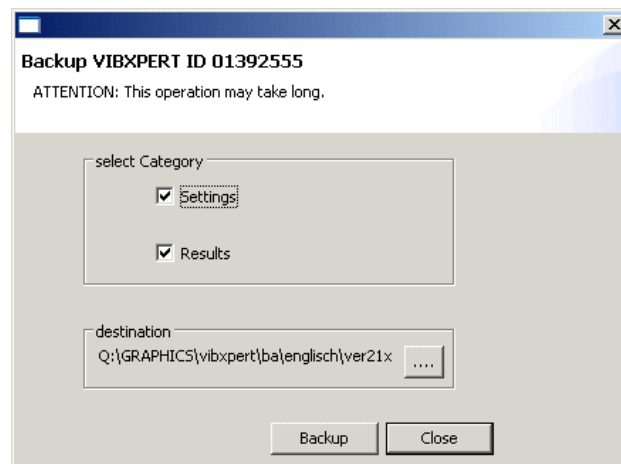

- Click on 'Format CF card' to format the memory card in the device.

Risk of data loss!

 Before proceeding, make sure that all important data and settings are backed up on an external storage device. Formatting deletes all data on the memory card. The process is not reversible!

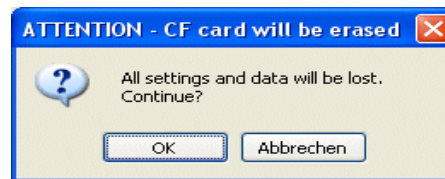


- Click on OK to start formatting.
- Click on 'Defragmentation' to perform the procedures 'Backup', 'Restore' and 'Format' in one step.



For authorized PRÜFTECHNIK representatives only:

Transferring language / help files

The following screen contains buttons that can be used to update the language and help files in the device.

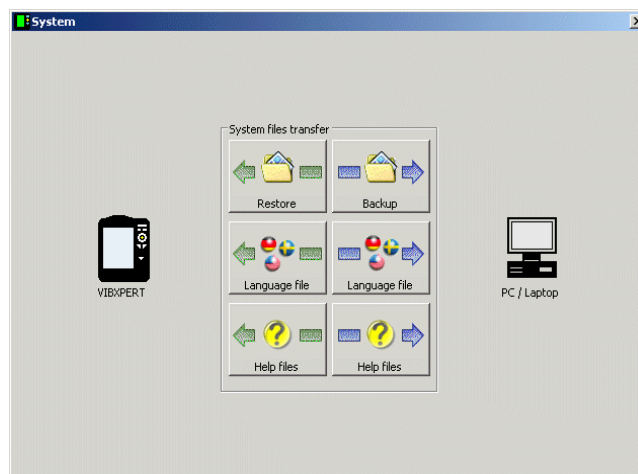

VIBCODE

VIBCODE is a vibration measurement system that uses coded measurement points for certain identification of measurement locations on the machine. The system consists of the VIBCODE sensor and the VIBCODE measurement location.



Note

Note also the respective installation and operating manuals: VIBCODE, art. no.: VIB 9.834.G


Mechanical coding

VIBCODE sensor

The sensor head contains a piezoelectric accelerometer that measures the vibration signals via the measuring pin. Several pressure-sensitive sensors are arranged as a ring around the vibration sensor. When coupled to a measuring pin, these sensors detect the pattern in the plastic ring in the measuring pin. This coding identifies the measurement location to the connected evaluation device and determines which measurement tasks are to be performed on it.

VIBCODE measurement location

The measuring pin contains a plastic code ring that obtains a unique identity - similar to a fingerprint - through the removal of individual teeth.

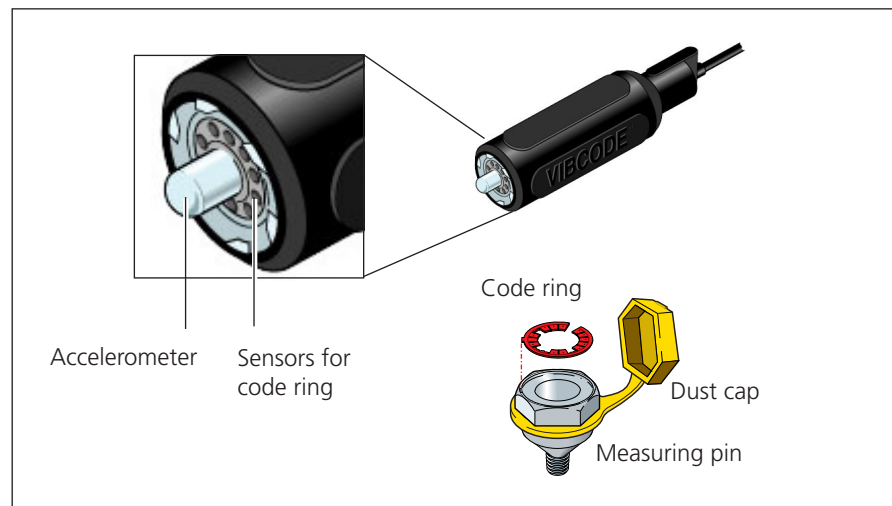

Coding ...

... or, "How are the measurement locations in the data base linked to the measurement locations on site on the machine?"

The coding of the "mechanical" measurement locations is defined in the measurement location data base using the OMNITREND software and stamped into a special plastic ring using a tool. The coded ring is installed on the machine together with the measuring pin. This forms the link between the data base and the machine.

VIBCODE concept

... or, "What is the difference between a route and a pool?"

A machine park contains many VIBCODE measurement locations. However, not all measurement locations are measured with the same frequency since they are assigned different roles in the data base. Thus, the VIBCODE concept is structured as follows:

A: VIBCODE route


VIBCODE measurement locations at which measurements are taken regularly are part of a route. Because each route is created for a particular purpose (e.g. weekly inspection), it only contains a certain subset of all VIBCODE measurement locations. VIBCODE features automatic measurement location recognition so that the measurement locations can be visited in any order.

B: VIBCODE pool

A "pool" contains additional measurement locations that are measured on a route only if there is a special need. Pool measurement locations are loaded into the data collector together with the corresponding route.

C: Unknown VIBCODE measurement location

If the VIBCODE sensor is connected to a measurement location that is contained neither in the current route nor in an associated pool, VIBPERT interrupts the route. A measurement can only be performed in the 'Multimode' (see also next page).

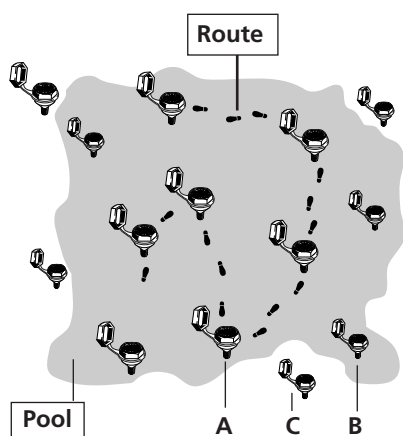

Measuring with VIBCODE



Never use the VIBCODE sensor to take a measurement directly from the machine surface. This sensor must always be locked onto the measuring pin!

Do not remove the VIBCODE sensor neither from the VIBCODE measurement location nor from VIBXPERT during measurement.


Connecting the VIBCODE sensor*

Insert the sensor straight into the measurement location, press it in place lightly and lock it by turning it clockwise until it stops.

This secure connection ensures that the measurement direction and pressure are the same for each measurement and that the results are reproducible.

To disconnect the sensor, turn it in the opposite direction and remove it from the measurement location.

Connect the sensor cable to the measurement channel that is set in the measurement task (A or B).

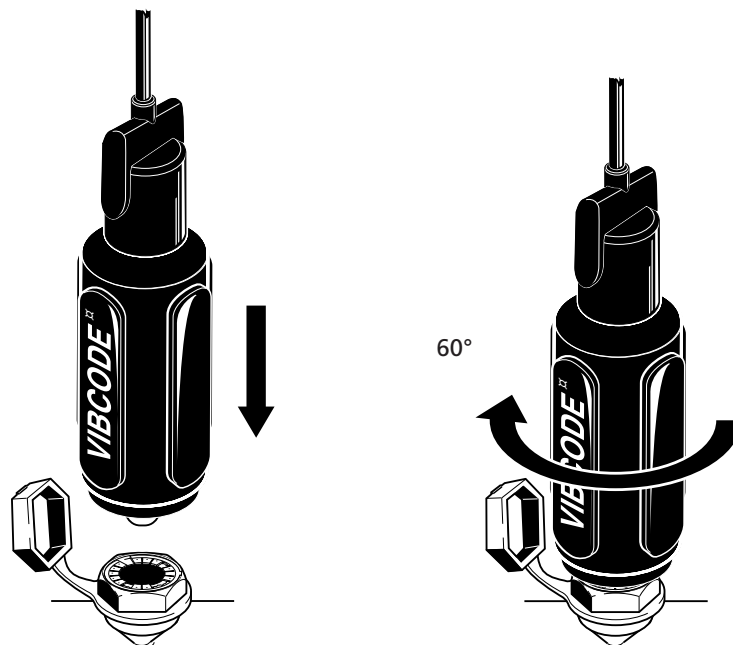

Measuring VIBCODE Route/ Pool

- Click on 'Route' in the start screen.
- Open the route to be measured.
- Connect the VIBCODE sensor to a VIBCODE measurement location:





VIBXPRT reads the coding of the measurement location and checks if this is created in the route. If VIBXPRT finds a measurement task, measurement starts automatically. If all measurement tasks at the measurement location are complete, plug the VIBCODE sensor into the next VIBCODE measurement location and continue measurement of the route.

If VIBXPRT finds the measurement location in the VIBCODE pool, the measurement task scheduled first starts automatically. All other measurements must be triggered manually via the measurement task selection.

To return to route mode from pool mode, press the MENU button and click on 'Route'.

If the VIBCODE measurement location is not contained in either the route or in the pool, change to the 'Multimode' mode to perform the required measurement. To do so, click on 'Multimode' in the message window or press the MENU button and click on 'Multimode'. Under certain circumstances it may be necessary to change the transducer in the task manager to 'VIBCODE' beforehand. After saving the measurement result, repeatedly press the ESC button to return to the route mode.

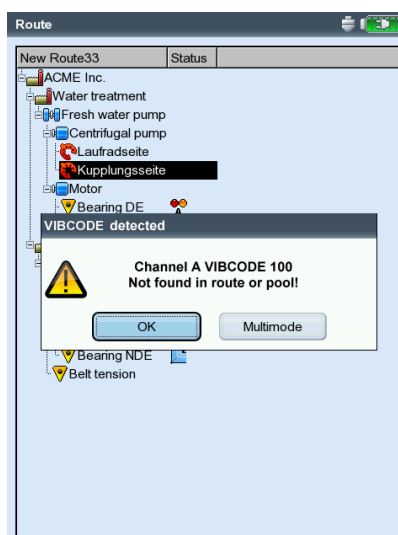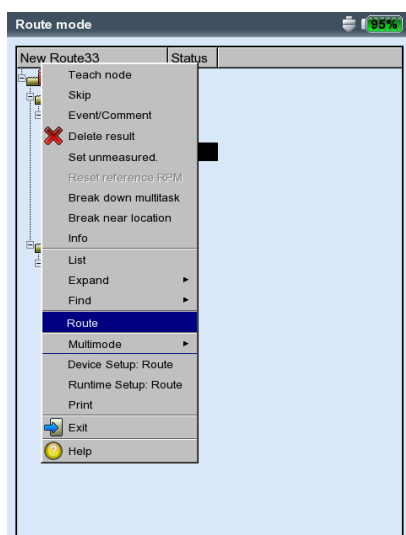

Left:
VIBCODE Pool

Right:
Unknown VIBCODE location

Technical notes

VIBXPERT is a precision instrument and should be treated as such.

Storage

Use the VIBXPERT carrying pouch for transporting VIBXPERT and for making on-site measurements. If VIBXPERT is not used for lengthy periods, stow the measurement instrument in the pouch and connect it regularly to the mains to avoid the battery from completely discharging.

Make sure that

- the storage location is dry
- the measurement device is not stored near electronic equipment which can generate strong electromagnetic fields.
- the measurement instrument is not exposed to temperatures above 70°C / 156°F or under -20°C / -4°F.
- the humidity is not more than 90%.

Cleaning

If lightly soiled, the carrying case and the housing can be wiped with a damp cloth. In cases of more stubborn soiling, use a household cleaner.

The display is protected against damage by a scratch-free transparent film. Use a soft dry cloth to clean the film. If necessary, the protective film can be ordered from your PRÜFTECHNIK representative.



Never use solvents or other strong cleaning agents

Maintenance & Calibration

Various factors such as aging or temperature can cause an offset in the analog electronics. This offset should be compensated every two months. Details are given on page 2-29.

To guarantee the high measurement accuracy of the device, VIBXPERT requires calibration every two years. The calibration date is indicated on the colored sticker on the rear of the measurement instrument. A couple of months before the next calibration a warning will appear on the display when the instrument is switched on. Send the device to your PRÜFTECHNIK representative for calibration.



Next calibration: November 2008

Before you send the unit in for repairs or calibration, transfer the measurement data to the OMNITREND software. Afterwards, conduct a backup. For data backup, use the program VIBXPERT utility (p. 6-5f).



For safety reasons, do not send units if the battery is obviously defective or if you suspect a defect in the battery!

Guarantee

The measurement device has a guarantee period of 1 year. Any guarantee claims expire if service work is carried out by non-authorized personnel.

Spare parts, accessories

Only original spare parts and accessories may be used. Information on these parts is given in the VIBXPERT product catalog (LIT 01.700. EN). The current edition can be downloaded from the PRÜFTECHNIK homepage (www.pruftechnik.com).

Disposal

Dispose of the instrument and the battery at the end of its lifetime according to the applicable environmental regulations.

For safety, cover the metal contacts of the battery with sticky tape.



Attention!

The following information applies to customers in member states of the European Union (EU) in which EU Directive

2002/96/EG "Waste Electrical and Electronic Equipment" (WEEE)


has been implemented in national law:

PRÜFTECHNIK products that fall under this directive are labeled with the symbol shown here.

What this means for you:

- All electrical and electronic PRÜFTECHNIK products and electrical and electronic accessories (e.g. cables, sensors, etc.) must henceforth be disposed of with PRÜFTECHNIK or their authorized disposal partner. Under no circumstances may these products be disposed of in household or municipal waste.
- Information on the waste disposal partner to whom you can turn when you wish to discard your equipment is available from the following sources:
 - your PRÜFTECHNIK sales partner
 - your authorized PRÜFTECHNIK dealer

PRÜFTECHNIK Condition Monitoring
WEEE-Reg.-No.: DE 72273578

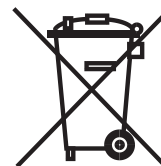

Technical data

Input Channels

2 analog inputs for

Voltage (AC/DC, ± 30 V max.)
 Current (AC/DC, ± 30 mA max.)
 ICP® signal (2 mA, 24 V max.)
 LineDrive accelerometer (10 V, 10 mA max.)

1 analog input for temperature measurement

Thermocouple (type K)

1+1 pulse/tachometer (RPM, Trigger, Keyphaser)

Accepts pulse & AC signals : 0V ... +26V or -26V ... 0V

Input parameters

Analog channels

Frequency range: DC .. 40 kHz (Accel. from 0.5 Hz)
 Dynamic range: 96 dB / 136 (meas. / total)
 Sampling rate: up to 131 kHz per channel
 Impedance: 90 kOhm, w/ cable VIB 5.433

Pulse/ Tachometer Channels

Max. input voltage: ± 26 V
 Switching threshold for
 0V...+26V signals max. 2,5V rising,
 min. 0,6V falling
 -26V...0V signals min. -8V rising,
 max. -10V falling
 Min. pulse length 0.1 ms

Output Channels

Stroboscope control

Connection for stroboscope, TTL output

Signal-Out

Connection for headphones to listen to the analog input signal; signal processing (oscilloscope)

Output parameters

Stroboscope control

Frequency range: 0 - 500 Hz
 Resolution: 0.05 Hz

Signal-Out

Frequency range: 0.5 Hz - 40 kHz
 Output impedance: 100 Ohm

Measurement parameters

RPM

Range 10 ... 200 000 min.⁻¹
 Accuracy* $\pm 0.1\%$ or ± 1 min.⁻¹

Temperature

Range -50 ... +1000°C (type K)
 Accuracy* $\pm 1\%$ or $\pm 1^\circ\text{C}$

Shock pulse (bearing condition)

Range -10 ... 80 dB_{sv}
 Accuracy* ± 3 dB_{sv}

Vibration acceleration

Range depends on the transducer connected

Standards fulfilled

Frequency response according to ISO 2954

Computer

Processor

Marvell PXA320 806 MHz

Keyboard

1 navigation pad and 7 keys (Zoom, Escape, Function, Help, Meno, On/Off); Keyboard illumination controlled by ambient light.

Display

TFT-LCD, backlit
 Color depth: 18 bit (262144 colors),
 Resolution: VGA (640 x 480 pixel) w/ 140 ppi
 Pixel area: 116 x 87 mm

Memory

128 MB DDR RAM
 CompactFlash: 2 GB to 8 GB

Serial interface

RS 232 - up to 115 kBaud

USB Interface

USB host for printing.
 USB slave for data exchange with OMNITREND.

Ethernet Interface

100 Mbit (100Base T), 10 Mbit (10Base T)

Printing

Direct printing of measurement reports via the USB port

Compatible printer types

HP, Epson and other printers with USB connection

Power Supply

Battery

Lithium ion battery pack (7.2V / 4.8Ah - 34Wh).
 Charging in the device or external with optional charging station.

Charger

Input: 110 V - 240 V / 50 Hz to 60 Hz
 Smart charging
 Charging time < 5 hrs.
 Charging temperature: 0°C to 50°C

Mechanical properties

Connectors

Analog channels: MiniSnap socket (compatible to VIBSCANNER)
 Digital channel 1: MiniSnap socket (RS 232) (compatible to VIBSCANNER with add. trigger input)
 Digital channel 2: MiniSnap (Ethernet-10Mbit, USB)
 Thermocouple channel: QLA (compatible to VIBSCANNER - Type K thermocouple).

Housing

Material: ABS

Dimensions

186 x 162 x 52 mm (LxWxH)

Weight

1.15 kg

Environmental

IP rating

IP65, dust and splash-proofed

Temperature range

-20°C to +60°C (storage)
 -10°C to +60°C (operating)

* the lower accuracy is applicable

Firmware features in the 1-channel version

Measurement Modes

Multimode

- Characteristic Overall Values
 - Vibration (Acceleration, Velocity, Displacement)
 - Current, Voltage (AC / DC)
 - Shock pulse (bearing condition)
 - Temperature
 - Rotational speed
- Signals
 - Amplitude spectrum for acceleration, velocity, displacement, current, volt.
 - Envelope spectrum for acceleration, velocity, shock pulse, current, volt.
 - Time waveform for acceleration, velocity, displacement, current, volt.
 - Phase measurement (polar diagram)
 - Coast down analysis for 1st order (tracking);
 - Phase / overall value/ spectrum over RPM
 - display as Bode or Nyquist diagram (phase - RPM)
 - Impact test
 - Orbit (filtered / unfiltered)
 - Cepstrum
 - Cross channel phase measurement

Route

- Set of measurement tasks for machine condition monitoring and diagnosis
- Route guidance via tree / list view or machine graphics
- Optimizer levels, TrendingSpectrum, 'Near location' mode for rapid data collection

Recording (optional)

- Recording of overall values & spectra
- Interval / Event triggered
- Pre- and post history

Balancing (optional)

- Dynamic 1 or 2 plane balancing under working conditions

Analysis functions

Cursor

- Main, Delta, Harmonics, Subharmonics, Sidebands

Frequency marker

- Fixed and RPM-variable characteristic frequencies for machines, roller bearings and gearboxes can be displayed in 'Multimode' and 'Route' mode

Band alarms

- Narrow band monitoring of damage frequencies (route mode)

Max 10

- List of the 10 highest amplitudes in the spectrum

Display

- linear scaling, logarithmic scaling (Y axis), trend, cascade diagram (waterfall), polar plot, order scaling for amplitude / envelope spectrum, sound spectrum (octave / third octave bars)

Measurement functions

Multi Measurement Tasks

- Combination of several measurements and modes in one task.

Averaging

- none (not for temperature),
- linear (not for timewaveform),
- peak hold (not for timewaveform and temperature),
- exponential (not for timewaveform & temperature),
- time-synchronous (timewaveform, spectrum, balancing)

Trigger Modes

- Free running, external (time-synchronous), internal
- Amplitude, Edge, Pre and post triggered.

FFT

- F_{min} : between 0.5 Hz and 10 Hz programmable
- F_{max} : between 200 Hz and 51.2 kHz programmable
- Lines: 400, 800, 1600, 3200, 6400, 12800, 25600, 51200, 102400
- Window: Rectangular, Hanning, Hamming, Blackman, Bartlett, Flattop, Kaiser

Additional functions in the 2-channel ver.

Measurement Modes

Multimode

- Overall values
 - 2-channel measurements
- Signals
 - 2-channel measurements with trigger
 - Impact test for natural frequency analysis on a shutdown or running machine
 - ODS - Operation deflecting shape analysis

Troubleshooting

Symptom:

VIBXPert will not start up. The start procedure is not executed completely, the display stops at the screen showing the LINUX penguin.

Cause: Failure in the flash memory.

Solution: Reload the firmware.



Reloading firmware

Before reloading the firmware, ensure that the following components are at hand or installed on the PC:

- VIBXPert update tool version 1.47 or higher (see P. 2-37).
- Serial cable - VIB 5.430-2 and Ethernet cable - VIB 5.331
- Connect VIBXPert to the serial port and to the network connector of the PC.
- Start the VIBXPert update tool on the PC.




- Click on the 'Start Emergency Recovery' button.
- In the next screen, set up the COM port to be used on the PC.
- Enter the IP address that is to be used by VIBXPert. 'Local IP address' appears only if the PC has access to more than one network (virtual or physical). In this case, specify the IP address of the PC to be used for communication with VIBXPert.

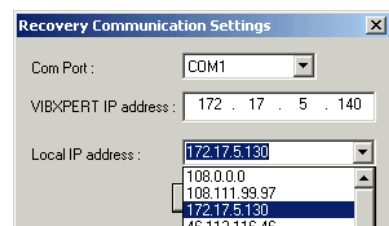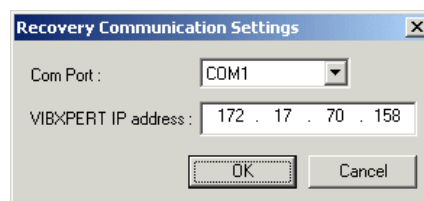


- Click on OK.

- Switch VIBXPRT off and on again.
The update tool subsequently contacts VIBXPRT and starts transfer of the basic firmware. The progress of the data transfer is shown in the right pane: 'Transferring data X%'

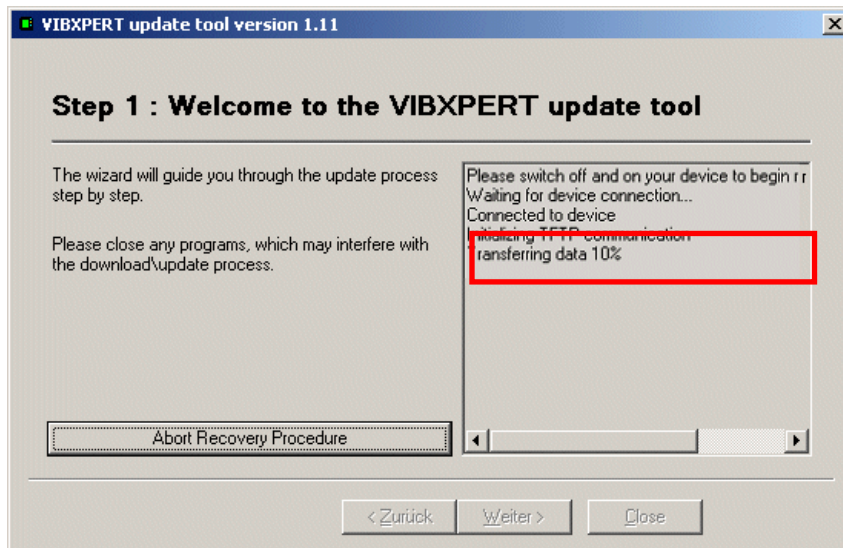

- Then it is only necessary to load the firmware: To do this, follow the instructions on Page 2-37.

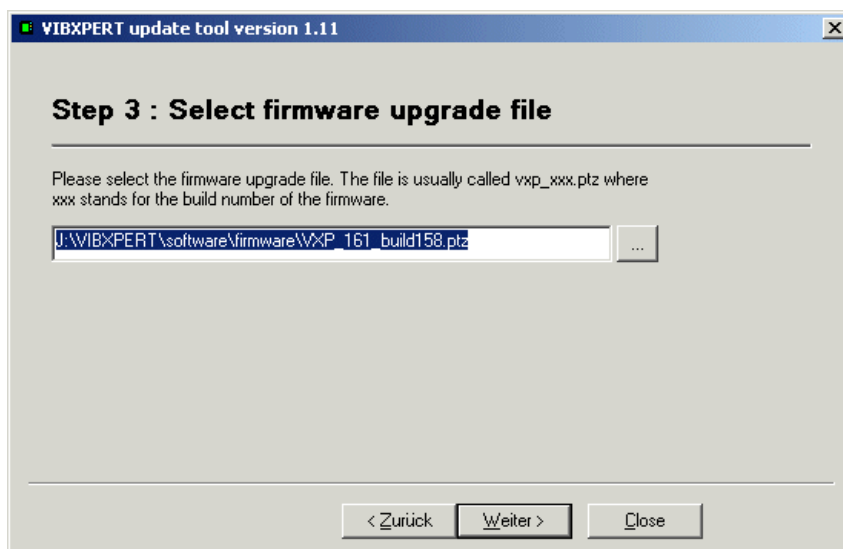


VIBXPERT Firmware modules

Module	Operat. mode	Measurement type	Remarks
Basic , Default registration	Multimode	<ul style="list-style-type: none"> • Overalls - vibration (a, v, s) • Overalls - user (current / voltage, each in AC / DC) • Bearing condition • Rotational speed • Temperature • FFT spectrum (v) 	FFT spectrum: 1. two factory-set tasks* 2. only main cursor, no postprocessing 3. Option 'New task' not available
E-Registration (1-channel) VIB 5.318-E	Multimode Route	<ul style="list-style-type: none"> • FFT spectrum (a, v, s, AC) • Envelope spectrum • Time waveform (a, v, s, AC) • Multi task <i>In Route mode only:</i> <ul style="list-style-type: none"> • TrendingSpectrum • Envelope TrendingSpectrum • Order spectrum • Manual input • Visual inspection 	MultiTask: Only with registered measurement tasks Route : Only with registered measurement tasks
1-channel VIB 5.311	Multimode Route Machine templates	<ul style="list-style-type: none"> • FFT spectrum (a, v, s, AC) • Envelope spectrum • Time waveform (a, v, s, AC) • Multi task <i>In Route mode only:</i> <ul style="list-style-type: none"> • TrendingSpectrum • Envelope TrendingSpectrum • Order spectrum • Manual input • Visual inspection <i>Special analyses:</i> <ul style="list-style-type: none"> • Phase measurement • Coast-down/ Run-up (overalls, phase, spectrum) • Shaft centerline plot • Impact test 	MultiTask: Only with registered measurement tasks Route / template : Only with registered measurement tasks
2-channels VIB 5.311-CH2	--	<ul style="list-style-type: none"> • 1+1 measurement • 2-channel measurements for Overalls, Time waveform, Spectrum • Phase measurement, 2-channel • Phase measurement, cross-channel • Orbit, filtered / unfiltered • Cepstrum 	--
Modal analysis VIB 5.319-ODS	--	<ul style="list-style-type: none"> • Impact test with impulse hammer • ODS 	1-channel and 2-channel module must be registered
Recording VIB 5.315-REC	--	<ul style="list-style-type: none"> • Recording function • Time waveform recorder for longterm data collection 	For Time waveform recorder the 1-channel meas. or the E-Registration module is required
Balancing VIB 5.316-BAL	Multimode Balancing	<i>Diagnosis, Balancing:</i> <ul style="list-style-type: none"> • Phase measurement, 1-/ 2-channel • FFT spectrum (v) • Time waveform (v) • Rotational speed • Overalls - vibration (v) 	Balancing in one or two planes

*Factory-set tasks in the 'Basic' module:
 Velocity spectrum / 2-400Hz / 1600 lines / df=0,25 Hz
 Velocity spectrum / 2-1600Hz / 1600 lines / df=1 Hz

Upgrade matrix for VIBXPERT II packages



		ex OMNITREND		with OMNITREND		
		Advanced, 1-channel VIB 5.310-1	Advanced, 2-channel VIB 5.310-2	Data collector, 1-channel VIB 5.314-1E	Advanced, 1-channel VIB 5.314-1	Advanced, 2-channel VIB 5.314-2
ex OMNITREND	Data collector, 1-channel VIB 5.310-1E	VIB 5.311-1UG	VIB 5.311-2UG	VIB 5.311-UOM VIB 8.115	VIB 5.311-1UG VIB 5.311-UOM VIB 8.115	VIB 5.311-2UG VIB 5.311-UOM VIB 8.115
	Advanced, 1-channel VIB 5.310-1	N/A	VIB 5.311-3UG	N/A	VIB 5.311-UOM VIB 8.115	VIB 5.311-3UG VIB 5.311-UOM VIB 8.115
	Advanced, 2-channel VIB 5.310-2	N/A	N/A	N/A	N/A	VIB 5.311-UOM VIB 8.115
with OMNITREND	Data collector, 1-channel VIB 5.314-1E	N/A	N/A	N/A	VIB 5.311-1UG VIB 8.115	VIB 5.311-2UG VIB 8.115
	Advanced, 1-channel VIB 5.314-1	N/A	N/A	N/A	N/A	VIB 5.311-3UG

Index

Symbole

1+1 measurement (Dual) 5-23
3D display 4-13

A

Accessories 6-15
Active Hierarchy 2-15
Adaptive task 3-6, 3-12
Amplitude spectrum 4-13
Analog Out / Headphone
 Configuration 2-28
 Sensitivity 3-27
Angle direction 4-19
Append result 3-29
AutoSave 2-16, 2-18
Average overlap 3-21
Averaging type 3-21, 3-24

B

Bandalarms 4-9
Bar display 4-10
Basic settings 2-12
Battery icon, display 2-7
Bearing condition 5-2
Belt 2-9
Bode plot 5-9
Break down multitask 3-10

C

Calibration 6-14
Carrying pouch 2-9
Cepstra analysis 5-19
Changing the meas. channel 3-17
Charger 2-7
Charging station, external 2-8
Circular plot 4-5
Cleaning
 VIBXPRT 6-14
Coastdown 5-6
Communication 2-6, 2-34
Connection to PC 2-32
Continuous measurement 3-4, 4-17
Continuous phase 4-19
Crest factor 5-1
Cross Channel phase 5-14
 Coherence 5-15
Cursor 4-4, 4-10, 4-12, 4-18

D

Date 2-12
Daylight saving 2-12
dB scaling 2-31
DC measurements 5-30
Declaration of conformity 6-24
Default vibration sensor 2-22
Delete files 2-31, 6-3
Delivery packages 1-9
Demo 2-30
Demodulation factor 3-23
Device Info 2-29

Device Setup 2-12
Diagram type 5-17
Display 2-13
 Protective film 2-13
Display mode 4-18
Display settings
 Route 2-14
Disposal 6-15
Dual task (1+1) 5-23

E

Editor
 number 6-1
 text 6-2
Envelope analysis 5-18
Evaluation 4-2
 overall values 3-25
 timewaveform 3-25
Event 3-26
External charging station 2-8

F

Factory Defaults 2-29
File Manager 6-3
Filter - HP/LP 3-23
Filter Type 3-23
Find 6-3
Find peak 4-11
Find (route) 3-11
Firmware, re-installing 6-18
Formatting 2-31
Frequency marker 4-9
Frequency, upper/lower 3-21
FRF calculation 3-22

G

Getting started 2-1
Graphic Route 2-18
Guarantee 6-15

H

Hand strap 2-9
Harmonics cursor 4-12
Historical data 3-30
HP/LP Filter 3-23

I

Icons 3-9
Impact test 5-25
Impulse hammer 5-27
Independent values
 Phase trend 4-20
Input voltage range 2-20
Interfaces 2-5
ISO 10816-3 5-1

K

Keyboard 2-2
Key controls 2-25
Keyphaser 2-23

L

Language 2-23
Laser trigger sensor 5-4
Laser-trigger sensor 5-4
LED indicators 2-2
Linear from / to 2-20
Lines 3-24
List view 3-8
Live mode 3-4, 4-17
LogLevel 2-30
Lower / Upper Frequency 3-23

M

Machine templates 3-1, 3-13
Maintenance 6-14
Manual entry 3-6
Max 10 4-10
Measurement 3-3
 abort 3-17
 channel, changing 3-17, 3-18
 quantity 2-20, 2-21
 range 3-22
 rate 5-11
 repeat 3-17
 report 4-22
 task 3-2, 5-1
 manager 3-19
 new 3-19
 user-defined 5-19
 time 3-21, 3-24
 type 3-2, 3-21
Measurement value
 deviation 3-31
Memory card 2-10, 2-31
Modal analysis 5-27
Multi meas. task 5-20
Multimode 3-1
multiplexer 3-41
Multiplexer 3-41
Multitask optimize 2-16

N

Nameplates 1-12
Near location 3-32
Negative average 3-22, 5-26
Network communication 2-34
Network connection 2-33
Normalization, dBi, dBa 5-2
Number editor 6-1
Number of lines 3-24
Nyquist diagram 5-9

O

Octave 4-15
ODS - Operating Defl. Shape 5-27
Offset 2-20
Offset Compensation 2-29
Options - Measurement 3-17
Orbit 5-16
Order-based spectrum 5-29

Order filter 5-15
 Order scaling 4-18
 Order spectrum 5-29
 Overall value 4-2
 calculating 4-5
 Display setup 4-17
 Overall vibration 5-1
 Overlap 3-21

P

Parameters
 Evaluation 3-25
 Measurement setup 3-21, 3-23
 RPM measurement 3-25
 transducer 2-19
 Patch connection 2-32
 PC licence 2-24
 Peak, find 4-11
 Phase measurement 5-14
 Phase trend
 diagram 4-20
 Plot type 4-19
 Pool 3-11
 Post-Processing 4-11
 Power supply 2-7
 Print 4-21
 Printer 2-26
 Protective display film 2-13

R

Rechargeable battery 2-7
 Recording 3-36
 Reference 4-12
 Reference data 3-30
 Reference edge 2-23
 Registration 2-24
 Repair CF card 2-31
 Report
 Measurement 4-22
 Route / Template 4-24
 Report-Logo 6-7
 Reset multiplexer 3-43
 Resonance frequency 2-21
 Result
 Details 4-2
 print 4-21
 RMS, show 4-11
 Route 3-7
 Display settings 2-14
 Graphic 2-18
 Reference data 4-12
 Report 4-24
 Runtime setup 3-11
 Setup 2-14
 RPM deviation 5-11
 RPM entry, manual 3-18
 RPM range 3-23
 RPM run 4-6
 RS 232 2-32
 Runtime setup 3-11
 Runup / Coastdown 5-6

S

Safety 1-10
 Sampling rate 3-21
 Save 2-25, 3-4, 6-3
 Scaling 4-4
 Screenshot 4-21
 Search 6-3
 Sensitivity
 Analog Out / Headphone 3-27
 Sensor angle 3-23
 Sensor check 2-22
 Sensor detection 2-17
 Serial connection 2-32
 Service menu 2-29
 Settling time 2-21
 Setup
 new 3-20
 Shaft centerline plot 5-12
 Shock pulse 5-2
 Sidebands 4-5, 4-12
 Signal
 Display-Setup 4-18
 Signal type 2-20
 Skip 3-12
 Sound spectrum 4-15
 Spare parts 6-15
 Spectrum 4-13
 calculating 4-6
 Speed Marker 4-18
 Start measurement
 Machine template 3-15
 Multimode 3-3
 Route 3-7
 Start Route 3-7
 Start-Stop, RPM
 Runup/ coastdown 3-23
 Static shaft position 5-13
 Status display - LED 2-2
 Storage 6-14
 Stroboscope 4-11
 Subharmonics 4-12
 Switching on 2-3
 Symbols 1-10

T

Task manager 3-19
 Technical data 6-16
 Technical notes 6-14
 Temperature meas. 5-5
 Text editor 6-2
 Third-octave 4-15
 Time 2-12
 Time format 2-12
 Time signal 4-4
 Time-synchronous average 3-21, 4-7
 Time waveform recorder 3-40
 Time zone 2-12
 Transducer
 new 2-21
 Parameter 2-19
 used in 2-19

Tree view 3-8
 Trend 4-19
 Display-Setup 4-19
 measurement 3-28
 Trending Spectrum 5-29
 bar display 4-10
 Trending values 4-10
 Triaxial sensor 3-34
 Trigger 3-22
 Trigger sensor 5-4
 Troubleshooting 6-18

U

Units 2-24
 Unskip 3-12
 Update 2-37
 Upgrade matrix 6-24
 Upgrade Matrix 6-21
 USB connection 2-32
 USB pen drive 2-33, 4-25

V

VIBCODE 6-10
 handling 2-17
 Pool 6-11, 6-13
 Procedure 2-17
 Route 6-13
 Unknown location 6-11
 VIBRONET multiplexer 3-41
 VIBXPRT
 Technical notes 6-14
 VIBXPRT delivery packages 1-9
 VIBXPRT Firmware-Module 6-20
 VIBXPRT PC license 2-24
 VIBXPRT utility 6-5
 Visual inspection 3-6

W

Waterfall diagram 4-13
 WEEE 6-15
 Window 3-22, 3-24

Z

Zoom 4-4, 4-18

CERTIFICATE

Declaration of conformity

in accordance with EN ISO/IEC 17050-1



PRÜFTECHNIK Condition Monitoring GmbH,
Oskar-Messter Str. 19-21, 85737 Ismaning, Germany
declares in sole responsibility, that the equipment

Name: **VIBXPERT II**

Type: **VIB 5.310 / VIB 5.320 / VIB 5.321**

Description: **FFT data collector and signal analyzer incl. charger**

complies with the appropriate European Directives. The essential safety requirements set out in the European Directives are fulfilled.

Directive

EMC directive

2004/108/EC

Low voltage directive

2006/95/EC

Standards applied

DIN EN 61000-6-1: 2007

Immunity for residential, commercial and light-industrial environments

DIN EN 61000-6-3: 2007

Emission standard for residential, commercial and light-industrial environments

CE marking was affixed in 2010.

Ismaning/ May 6, 2010

Place and date of issue



Johann Lösl – Managing director

Productive maintenance technology

PRÜFTECHNIK
Condition Monitoring
Oskar-Messter Straße 19-21
85737 Ismaning, Germany
www.pruftechnik.com
Tel. +49 89 99 61 6-0
Fax +49 89 99 61 6-300
eMail: info@pruftechnik.com



Printed in Germany LIT 53.201.05.2012.0EN
VIBXPERT®, VIBCODE®, OMNITREND® are registered trademarks
of PRÜFTECHNIK AG. Contents subject of change without further
notice, particularly in the interest of further technical development.
Reproduction, in any form whatever, only upon express written
consent of PRÜFTECHNIK AG.

© Copyright by PRÜFTECHNIK AG